

98kW FIXED TILT SYSTEM



PV INSPECTION REPORT

INSPECTION DATE: 10 APRIL 2019

INSPECTOR: SAM LAURIE - LEVEL 1 THERMOGRAPHER




SPECTRE

UAV CONCEPTS

.....
DATA ACQUISITION ACROSS THE SPECTRAL RANGE



Report date:
Apr 12, 2019

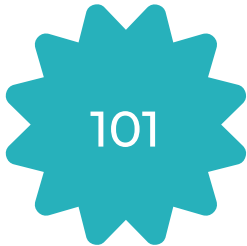

Number of
annotations



Status:
Published



Type:
Solar Panels



Company:
Spectre UAV Concepts



Inspection created:
Apr 10, 2019



Report Images:
57



Report created by:
Spectre
admin@spectreuavconcep
ts.com.au

💡 Inspection summary

The [REDACTED] site was inspected on the 10th April 2019 using an unmanned aerial system (UAS). The UAS was a DJI M600 Pro equipped with Flir Duo Pro Radiometric 640x512 25mm infrared sensor.

Weather Conditions: Sunny with clear skies

Date: 10/04/2019

Time: 11:30am - 12:30pm

Each panel in this installation has some level of soiling / dirt build-up and could benefit from a clean.

A number of panels have damaged cells causing hot spots and will require further investigation.


It has also been noted that a number of junction boxes appear to be running hotter than the system average and will require further investigation.

No visual damage has been observed.

Annotation overview



Severity overview

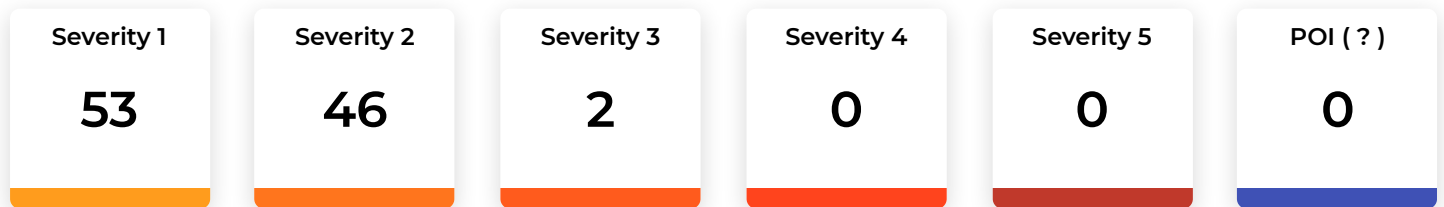

Id	Severity	User tags	Issues	Comments	Page
399696	2	Thermal	Single Cell		8
399708	1	Thermal	Soiling		8
399709	2	Thermal	Single Cell		9
399715	2	Thermal	Single Cell		10
399719	1	Thermal	Soiling		11
399720	1	Thermal	Soiling		11
399693	2	Thermal	Hotspot		12
399694	2	Thermal	Module		12
399695	2	Thermal	Hotspot		13
399726	2	Thermal	Junction box		14
399837	1	Thermal	Soiling		15
399839	2	Thermal	Junction box		15
399840	1	Thermal	Junction box		16



Id	Severity	User tags	Issues	Comments	Page
399729	1	Thermal	Junction box		17
399730	1	Thermal	Soiling		18
399731	1	Thermal	Soiling		18
399733	2	Thermal	Junction box		19
399735	1	Thermal	Soiling		20
399736	1	Thermal	Soiling		20
399738	1	Thermal	Soiling		21
399739	1	Thermal	Soiling		22
399740	2	Thermal	Hotspot		23
399744	1	Thermal	Junction box		24
399752	2	Thermal	Single Cell		25
399753	2	Thermal	Junction box		25
399756	2	Thermal	Single Cell		26
399758	2	Thermal	Single Cell		26
399760	1	Thermal	Junction box		27
399761	2	Thermal	Junction box		28
399763	2	Thermal	Junction box		28
399764	2	Thermal	Single Cell		29
399765	2	Thermal	Junction box		29
399767	1	Thermal	Soiling		30
399768	1	Thermal	Soiling		30
399769	2	Thermal	Junction box		31
399770	1	Thermal	Soiling		31
399771	1	Thermal	Soiling		32
399774	2	Thermal	Single Cell		33
399775	1	Thermal	Junction box		33

Id	Severity	User tags	Issues	Comments	Page
399776	2	Thermal	Junction box		34
399777	2	Thermal	Single Cell		34
399779	2	Thermal	Junction box		35
399780	2	Thermal	Single Cell		35
399781	1	Thermal	Soiling		36
399782	2	Thermal	Junction box		36
399783	2	Thermal	Junction box		37
399784	2	Thermal	Junction box		37
399785	2	Thermal	Junction box		38
399786	1	Thermal	Junction box		39
399787	2	Thermal	Junction box		40
399790	2	Thermal	Single Cell		41
399791	2	Thermal	Single Cell		41
399792	2	Thermal	Junction box		42
399793	2	Thermal	Junction box		42
399795	2	Thermal	Single Cell		43
399796	2	Thermal	Junction box		44
399797	1	Thermal	Soiling		44
399798	1	Thermal	Soiling		45
399799	2	Thermal	Junction box		46
399800	2	Thermal	Junction box		47
399801	1	Thermal	Junction box		47
399802	2	Thermal	Junction box		48
399803	1	Thermal	Single Cell		49
399804	1	Thermal	Single Cell		50
399841	1	Thermal	Soiling		51

Id	Severity	User tags	Issues	Comments	Page
399842	1	Thermal	Soiling		51
399843	1	Thermal	Soiling		52
399844	1	Thermal	Soiling		52
399808	1	Thermal	Soiling		53
399805	1	Thermal	Junction box		54
399806	1	Thermal	Soiling		55
399807	1	Thermal	Soiling		55
399809	1	Thermal	Junction box		56
399845	1	Thermal	Soiling		56
399810	2	Thermal	Single Cell		57
399846	1	Thermal	Junction box		57
399847	1	Thermal	Junction box		58
399812	1	Thermal	Junction box		59
399848	1	Thermal	Soiling		60
399813	1	Thermal	Junction box		61
399815	2	Thermal	Junction box		62
399817	1	Thermal	Soiling		63
399818	2	Thermal	Junction box		63
399819	1	Thermal	Junction box		64
399822	1	Thermal	Junction box		65
399821	1	Thermal	Soiling		66
399820	2	Thermal	Junction box		67
399823	1	Thermal	Junction box		68
399824	2	Thermal	Junction box		69
399825	2	Thermal	Junction box		69
399826	1	Thermal	Junction box		70


Id	Severity	User tags	Issues	Comments	Page
399827	1	Thermal	Junction box		70
399828	3	Thermal	Junction box		71
399829	3	Thermal	Junction box		71
399830	2	Thermal	Single Cell		72
399831	2	Thermal	Junction box		73
399832	1	Thermal	Soiling		73
399833	1	Thermal	Soiling		74
399834	1	Thermal	Soiling		74
399835	1	Thermal	Soiling		75
399836	1	Thermal	Soiling		75

File name:	20190410_112619_678_R.JPG	Altitude:	36.8m
Date taken:	Apr 10, 2019 11:26:19 AM	Heading:	North (0°)
Position:	 -31.8614691, 115.8066092	User tags:	Thermal

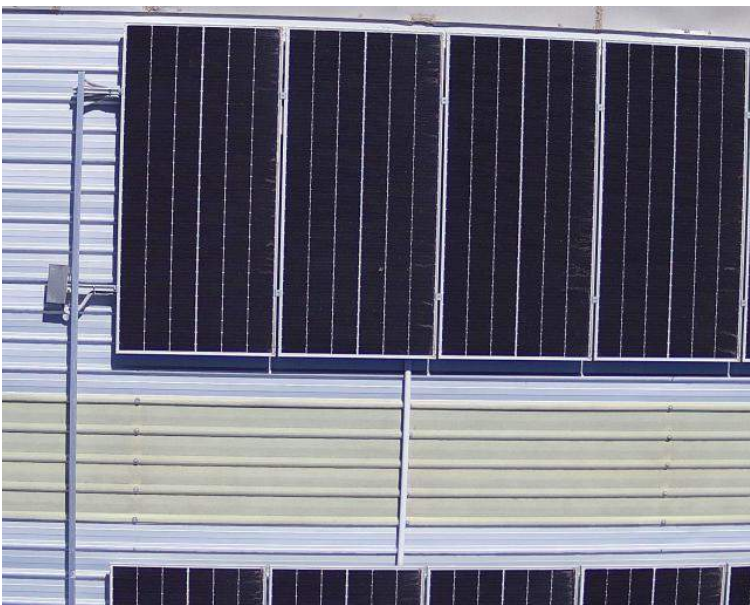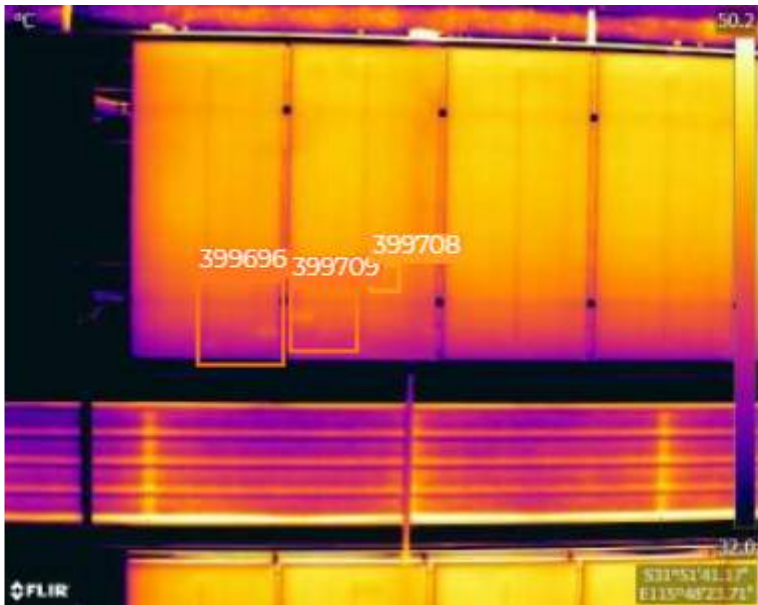

For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403607

- 399696Severity: 2Single Cell
- 399708Severity: 1Soiling
- 399709Severity: 2Single Cell

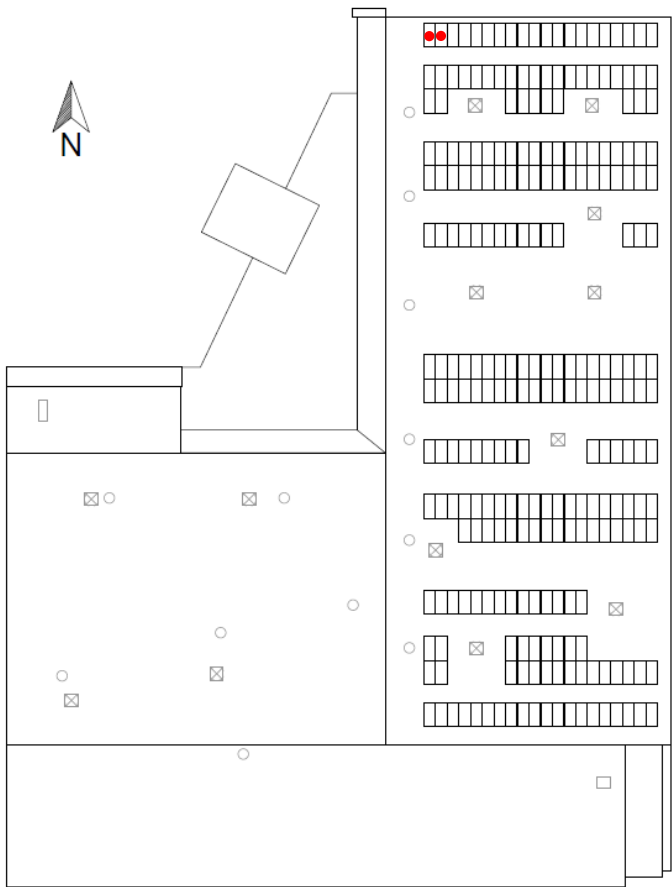

File name: 20190410_112634_797_R.JPG



Altitude: 36.4m

Date taken: Apr 10, 2019 11:26:34 AM

Heading: North (0°)


Position:  -31.8614669, 115.8066494

User tags: Thermal

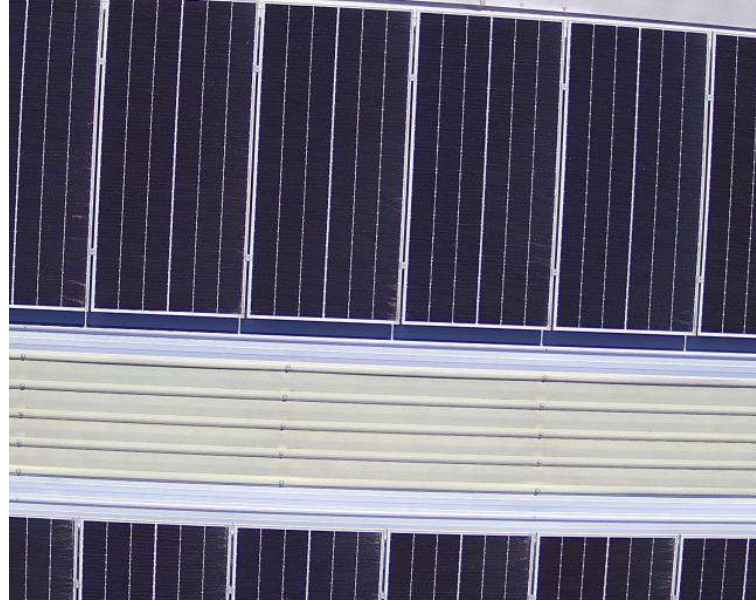
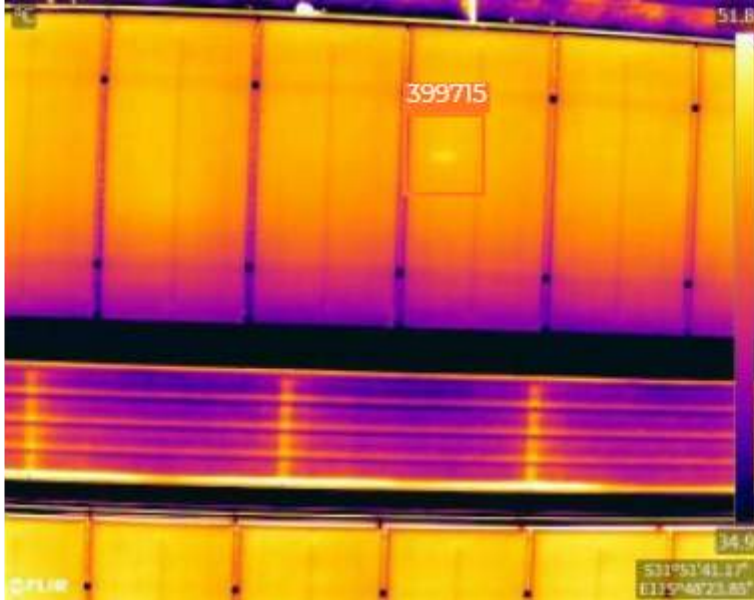


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403609

399715 Severity: 2 Single Cell

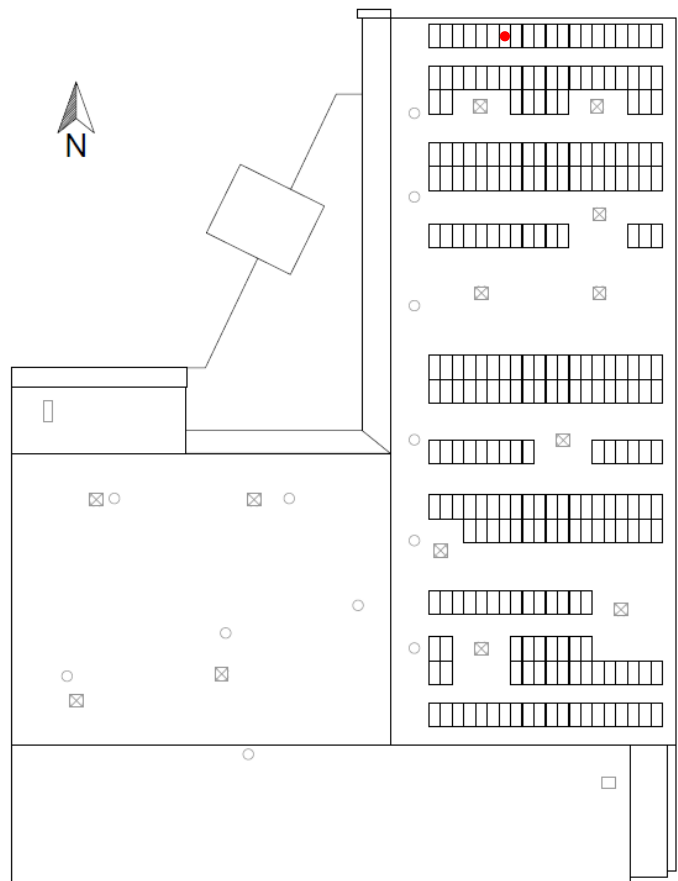

File name:	20190410_112651_378_R.JPG	Altitude:	35m
Date taken:	Apr 10, 2019 11:26:51 AM	Heading:	North (0°)
Position:	 -31.8614664, 115.8067271	User tags:	Thermal

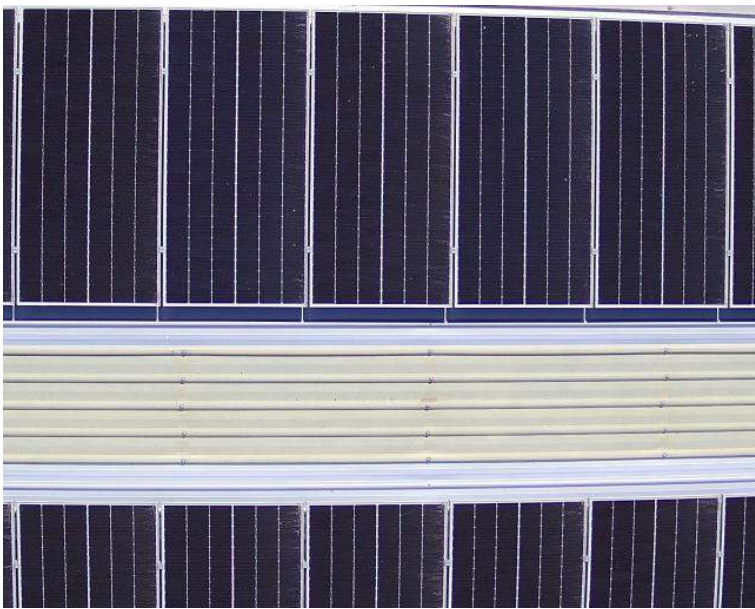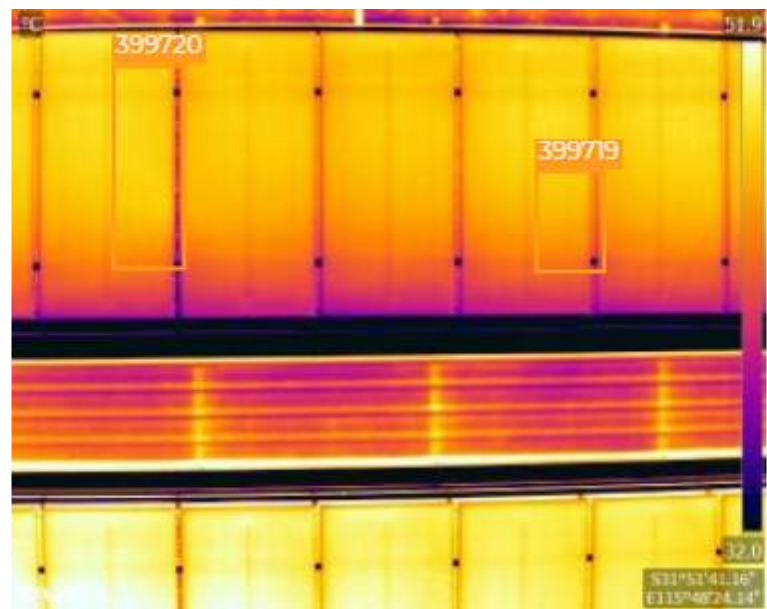

For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403613


- 399719

Severity: 1

Soiling
- 399720

Severity: 1

Soiling

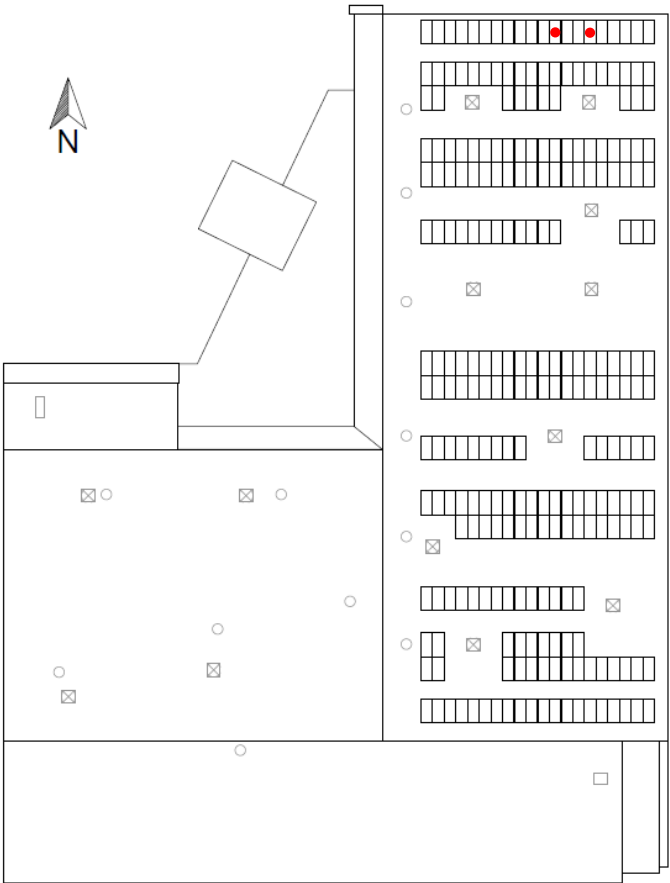

File name: 20190410_112721_208_R.JPG



Altitude: 33.3m

Date taken: Apr 10, 2019 11:27:21 AM

Heading: North (0°)


Position:  -31.8614644, 115.8067877

User tags: Thermal

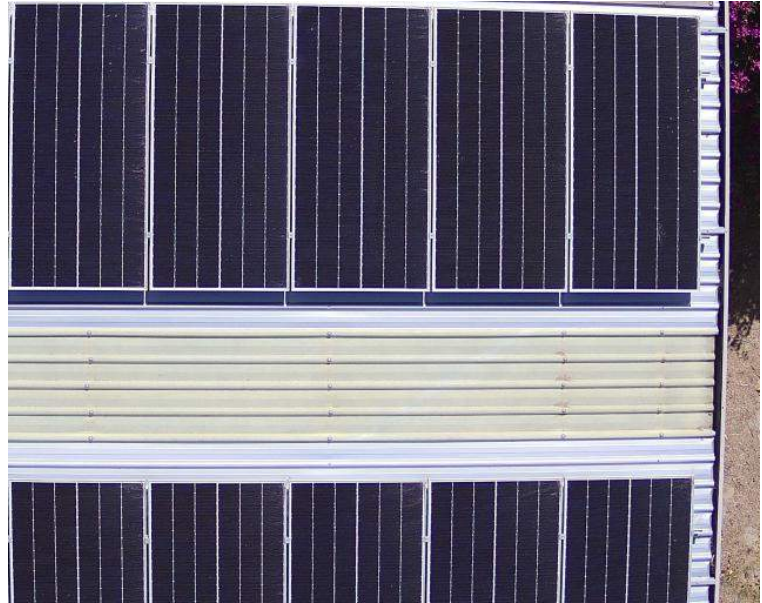
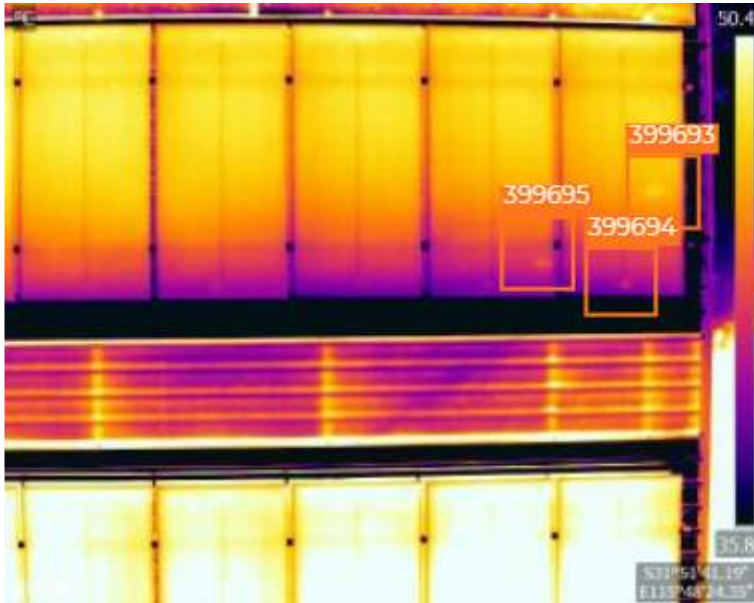


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403617

399693	Severity: 2	Hotspot
399694	Severity: 2	Module
399695	Severity: 2	Hotspot

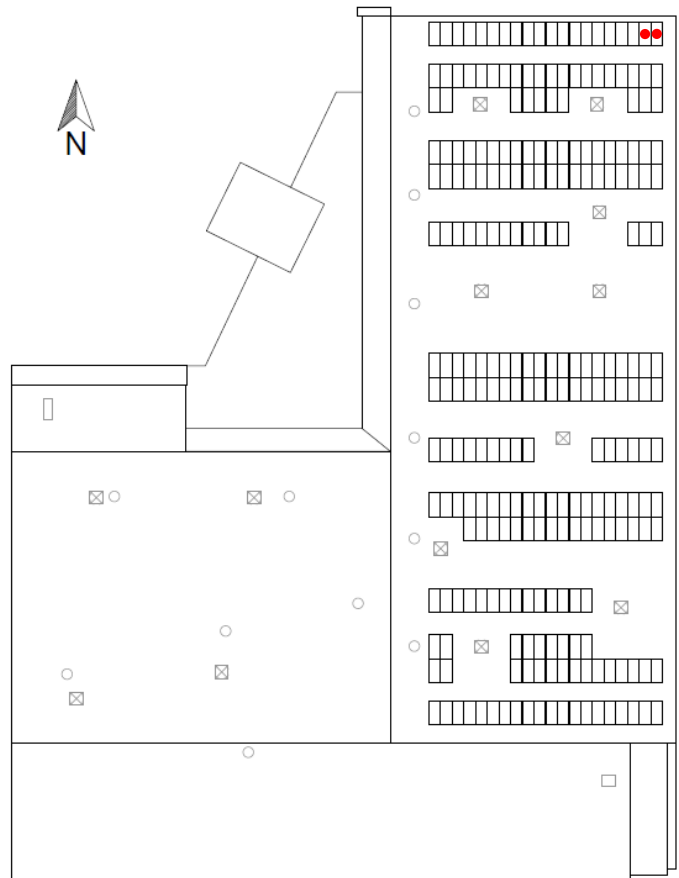


File name:	20190410_112736_289_R.JPG	Altitude:	32.6m
Date taken:	Apr 10, 2019 11:27:36 AM	Heading:	North (0°)
Position:	 -31.8614916, 115.8067896	User tags:	Thermal

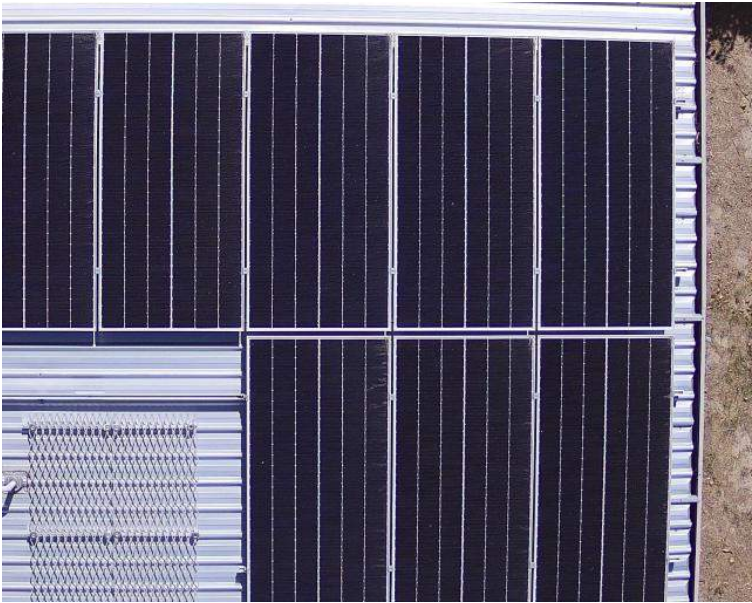
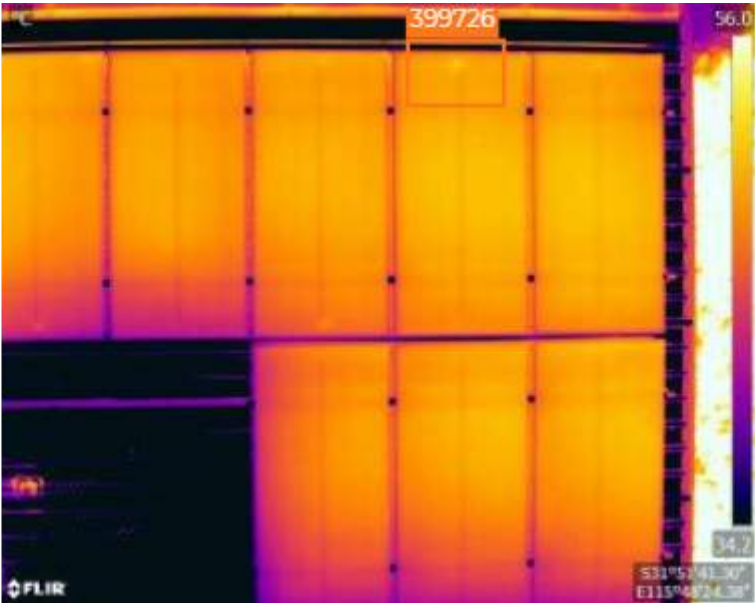


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403619

399726 Severity: 2 Junction box

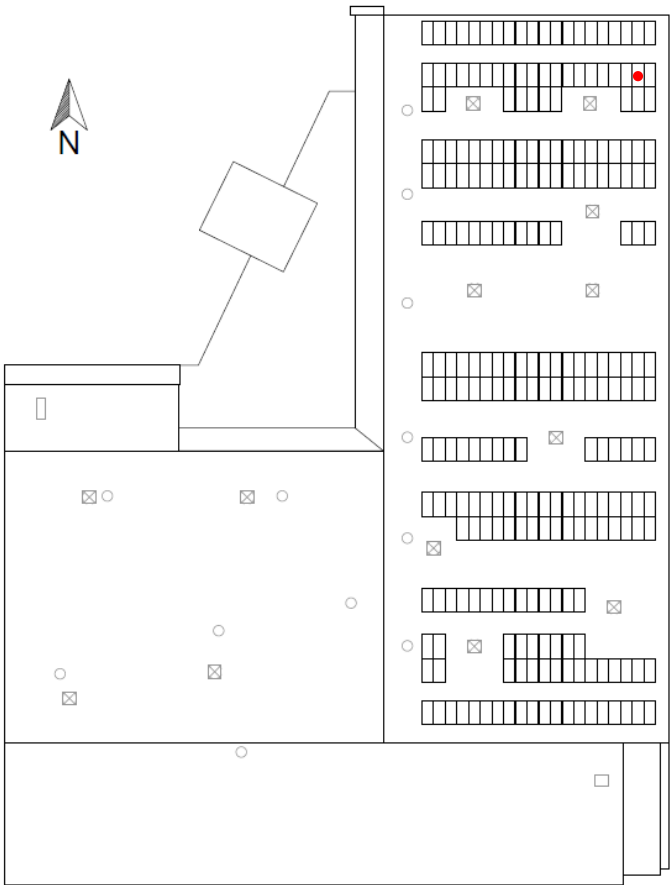


File name:	20190410_112750_008_R.JPG	Altitude:	33.5m
Date taken:	Apr 10, 2019 11:27:50 AM	Heading:	North (0°)
Position:	 -31.8614964, 115.8067566	User tags:	Thermal

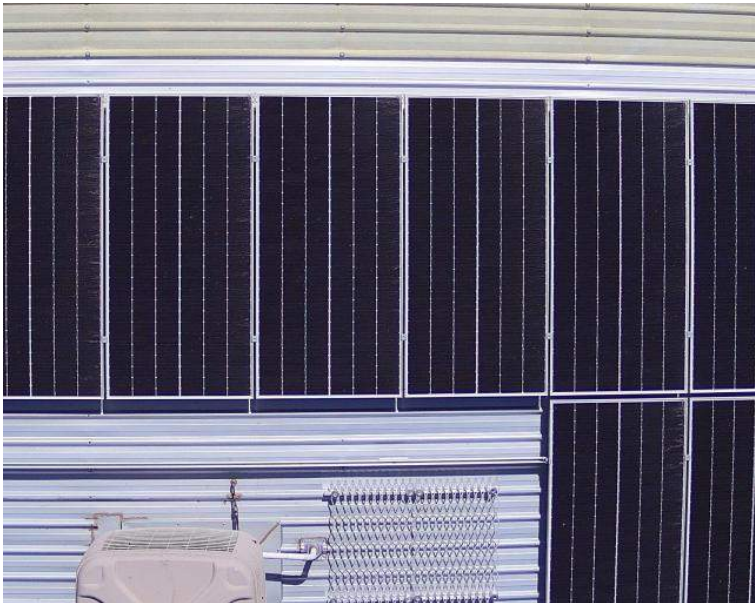
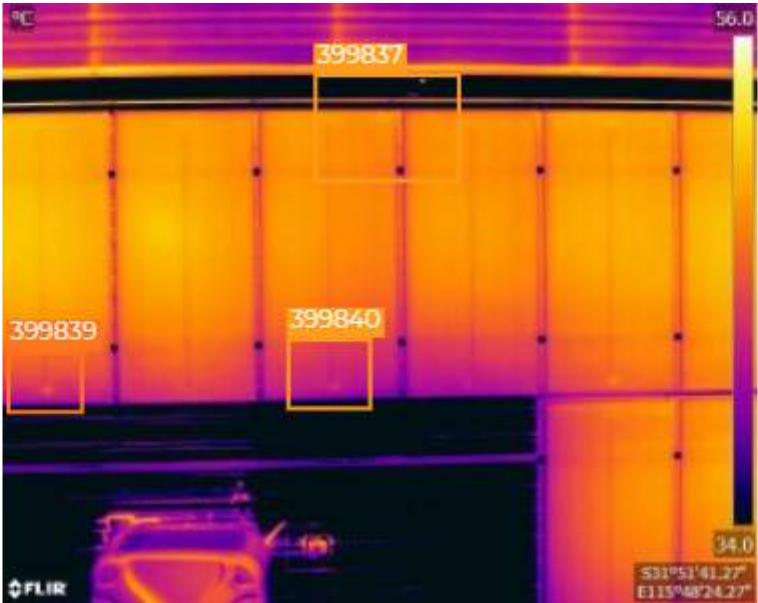


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403621

399837	Severity: 1	Soiling
399839	Severity: 2	Junction box
399840	Severity: 1	Junction box

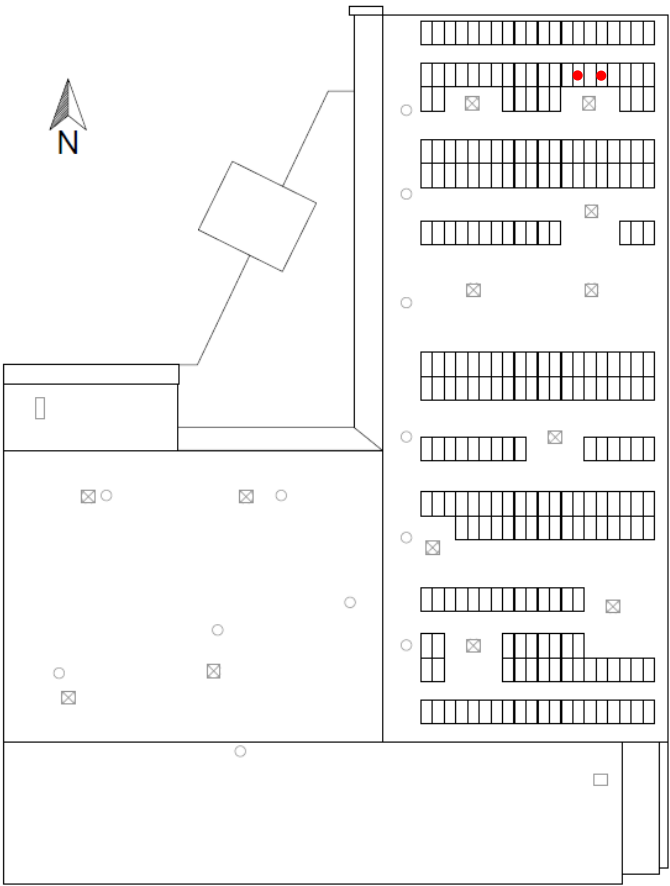


File name:	20190410_112810_589_R.JPG	Altitude:	34.1m
Date taken:	Apr 10, 2019 11:28:10 AM	Heading:	North (0°)
Position:	 -31.8614977, 115.8066990	User tags:	Thermal

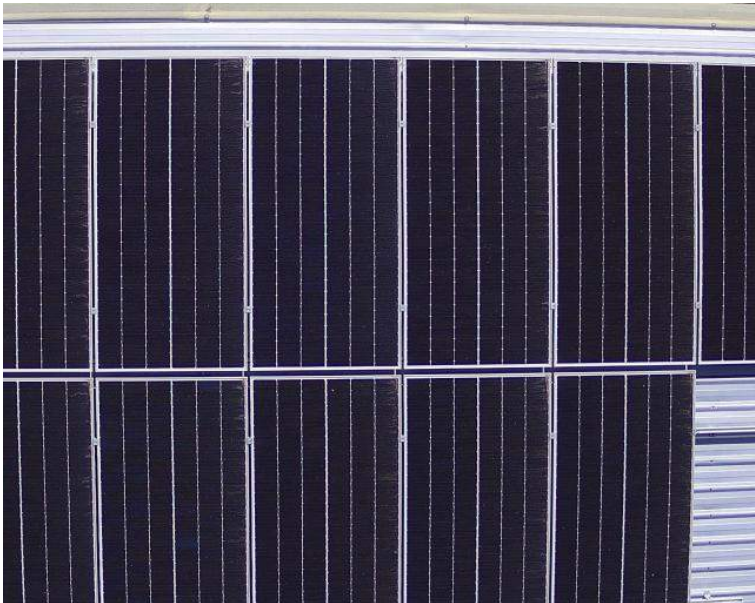
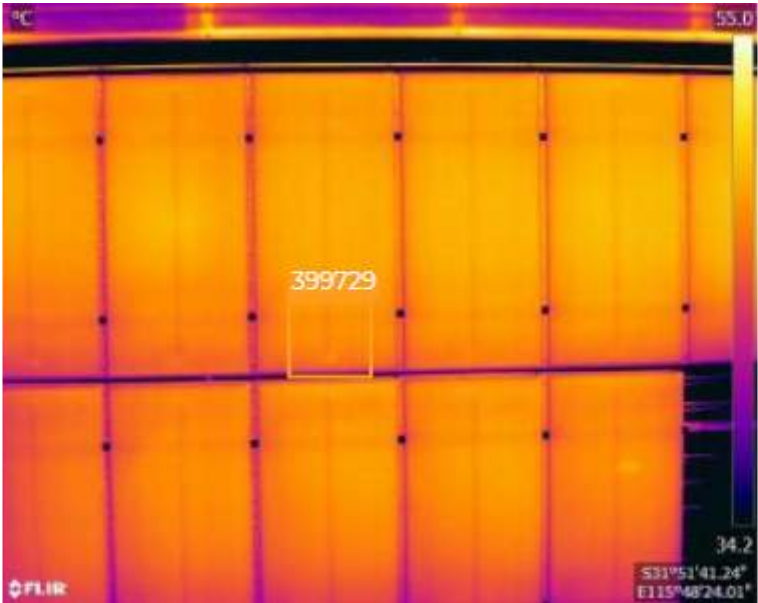


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403625

399729 Severity: 1 Junction box

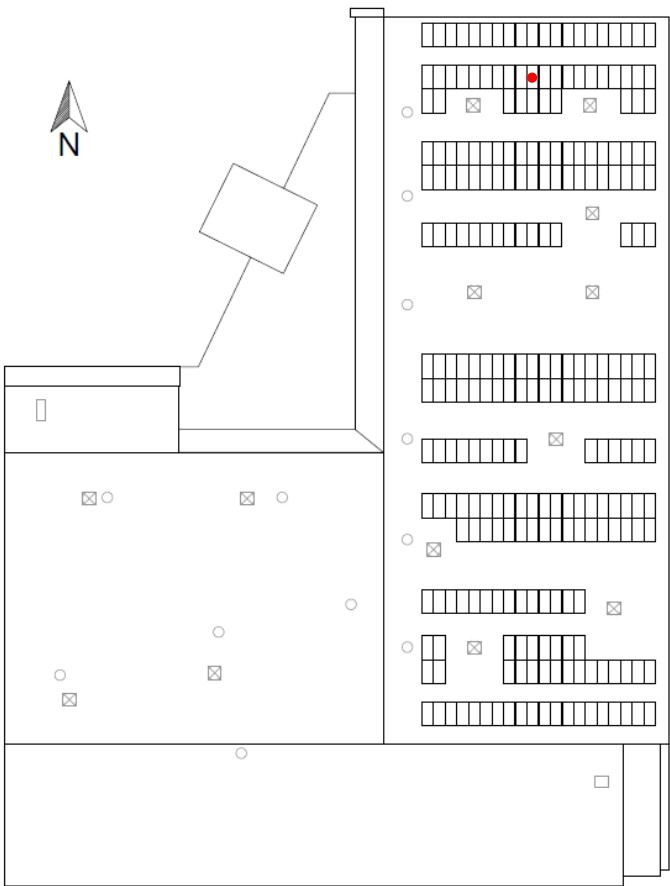

File name:	20190410_112817_898_R.JPG	Altitude:	34.4m
Date taken:	Apr 10, 2019 11:28:18 AM	Heading:	North (0°)
Position:	 -31.8614972, 115.8066749	User tags:	Thermal

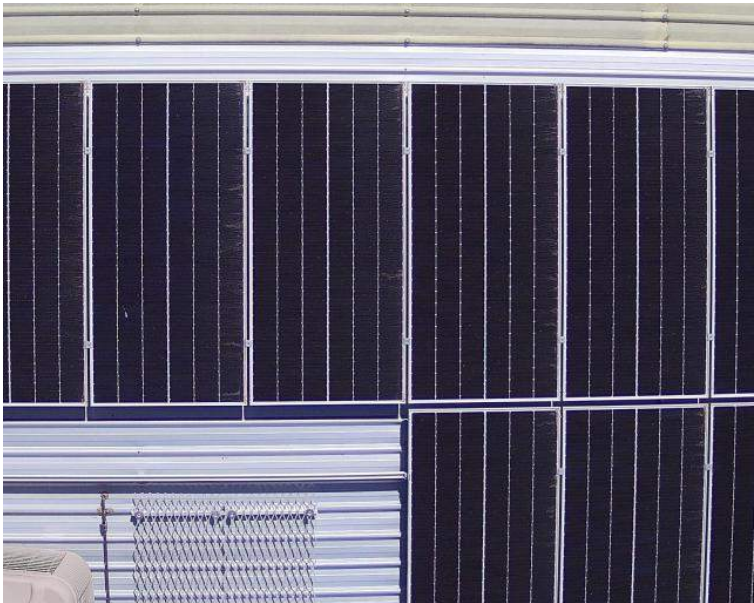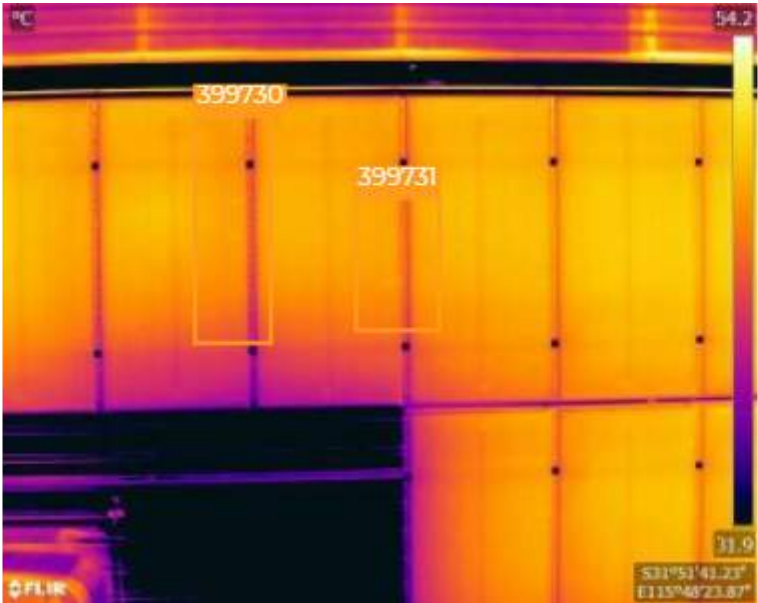

For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403627


- 399730

Severity: 1



Soiling
- 399731

Severity: 1

Soiling

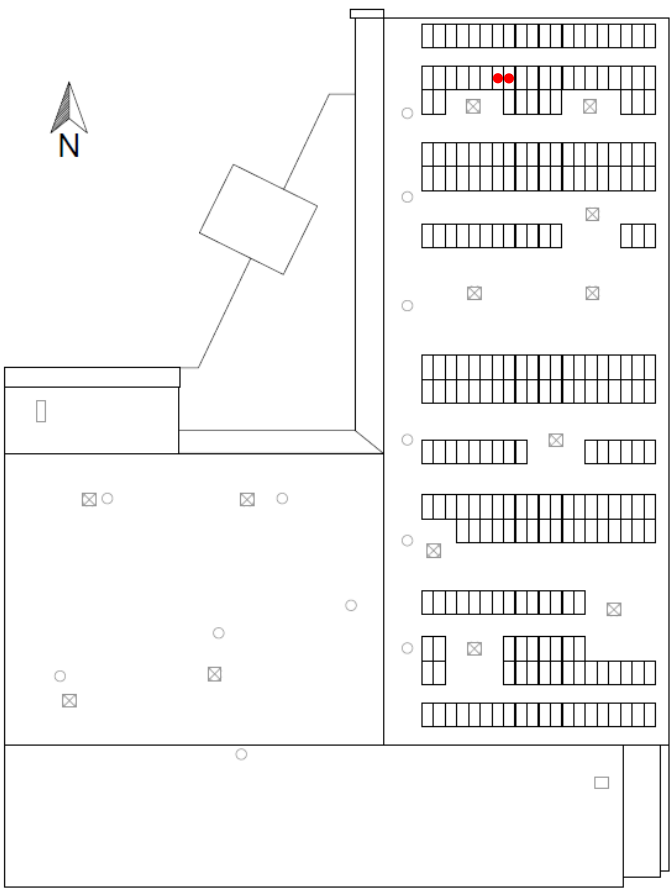


File name:	20190410_112825_708_R.JPG	Altitude:	34m
Date taken:	Apr 10, 2019 11:28:25 AM	Heading:	North (0°)
Position:	 -31.8614990, 115.8066333	User tags:	Thermal

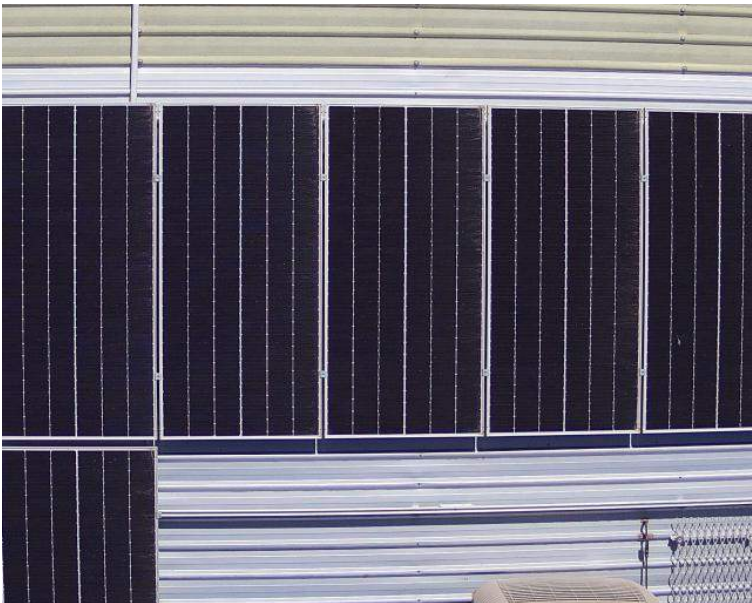
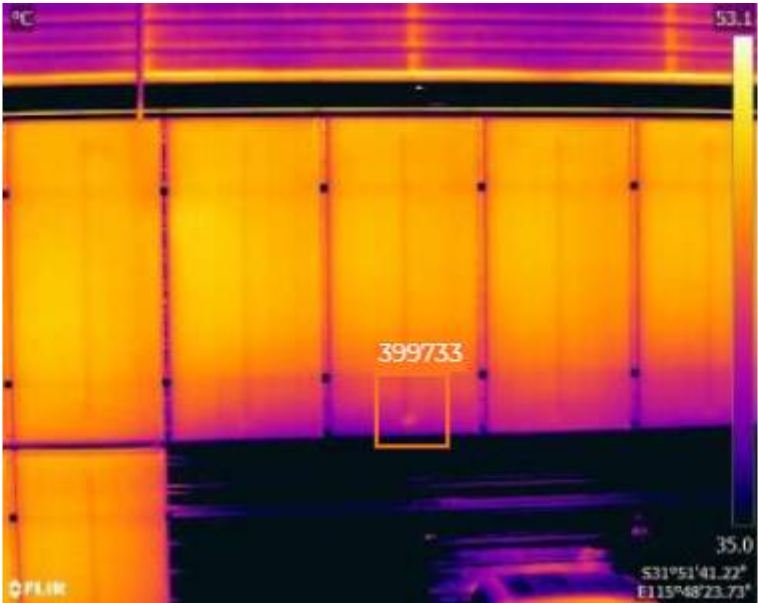


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403629

399733 Severity: 2 Junction box

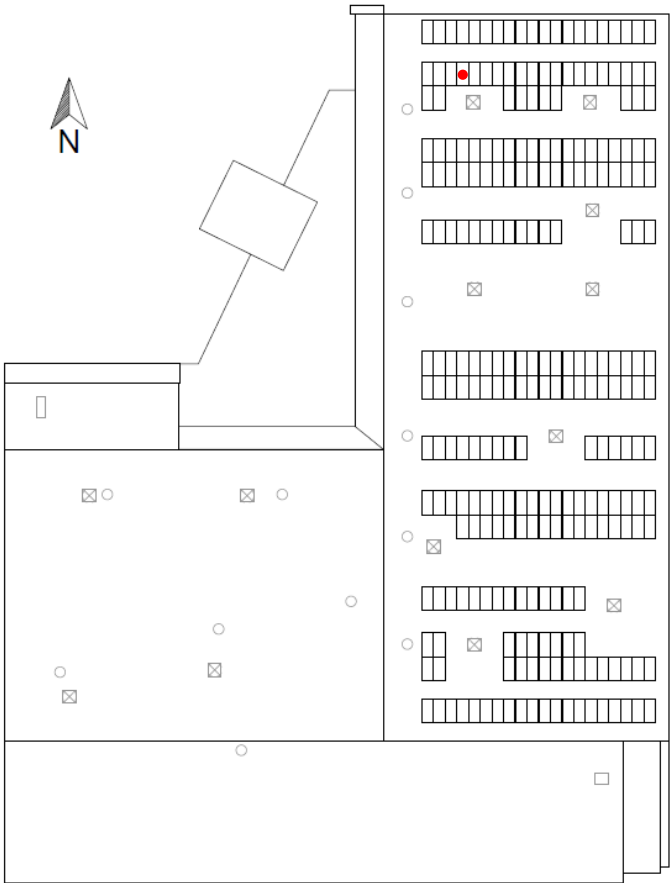


File name:	20190410_112834_778_R.JPG	Altitude:	34m
Date taken:	Apr 10, 2019 11:28:34 AM	Heading:	North (0°)
Position:	 -31.8614967, 115.8066068	User tags:	Thermal

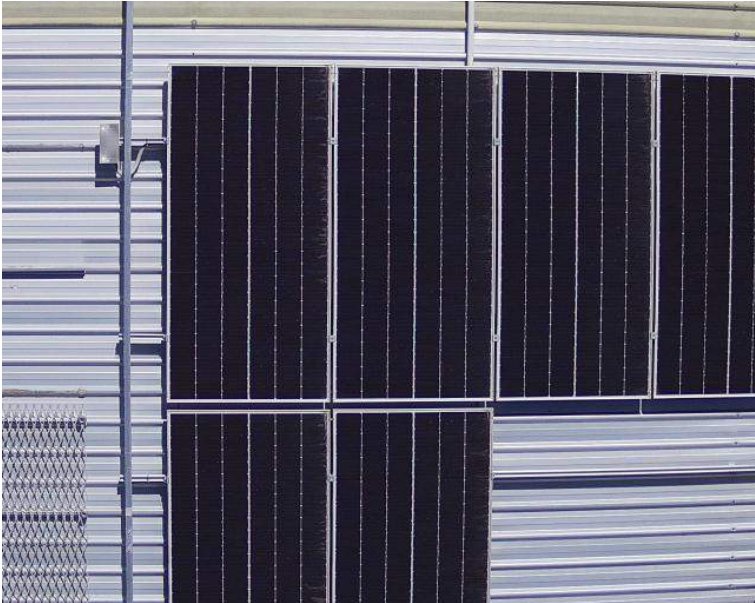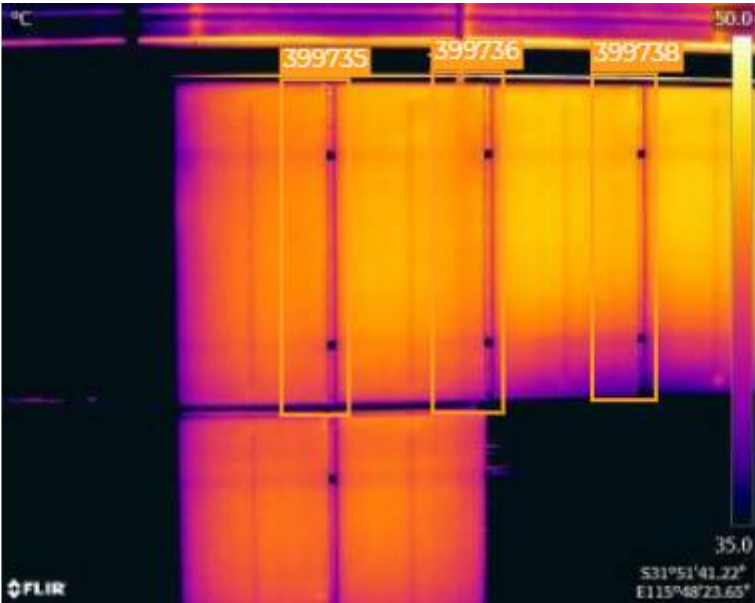


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403631

- 399735Severity: 1Soiling
- 399736Severity: 1Soiling
- 399738Severity: 1Soiling

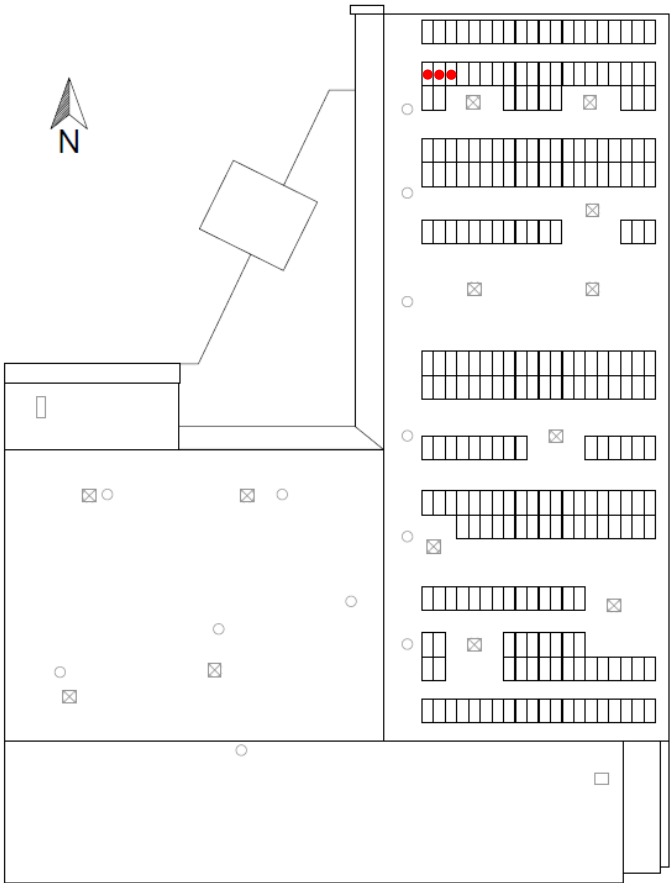


File name:	20190410_112918_591_R.JPG	Altitude:	35.5m
Date taken:	Apr 10, 2019 11:29:18 AM	Heading:	North (0°)
Position:	 -31.8615099, 115.8066041	User tags:	Thermal

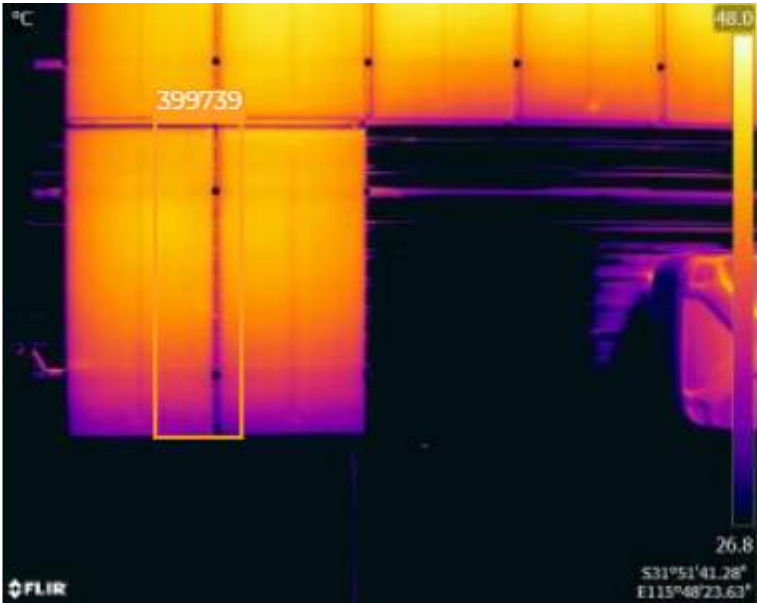


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403633

399739 Severity: 1 Soiling

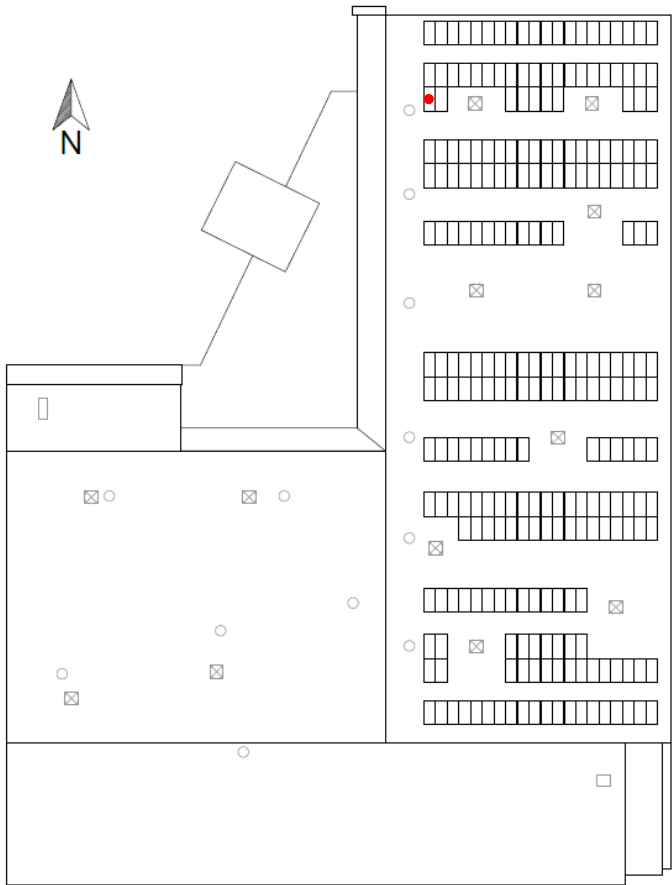


File name:	20190410_112924_698_R.JPG	Altitude:	36.3m
Date taken:	Apr 10, 2019 11:29:24 AM	Heading:	North (0°)
Position:	 -31.8615139, 115.8066843	User tags:	Thermal


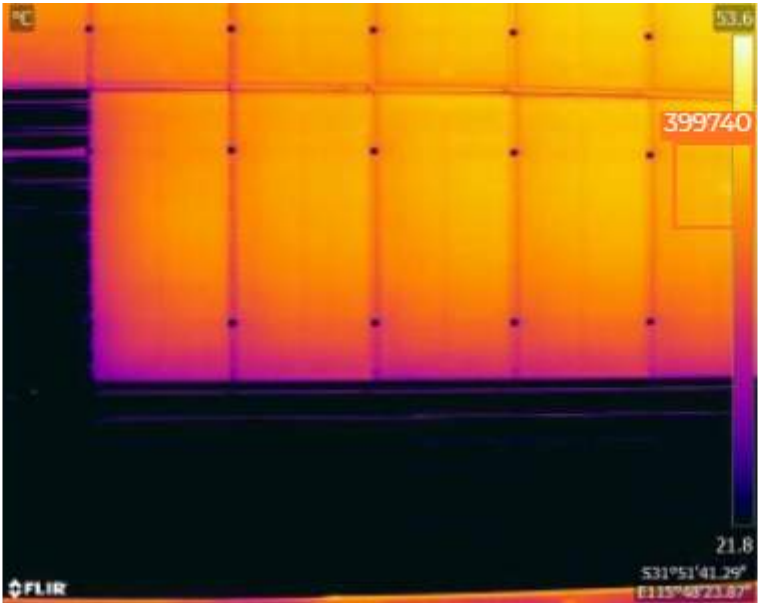


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403635

399740 Severity: 2 Hotspot

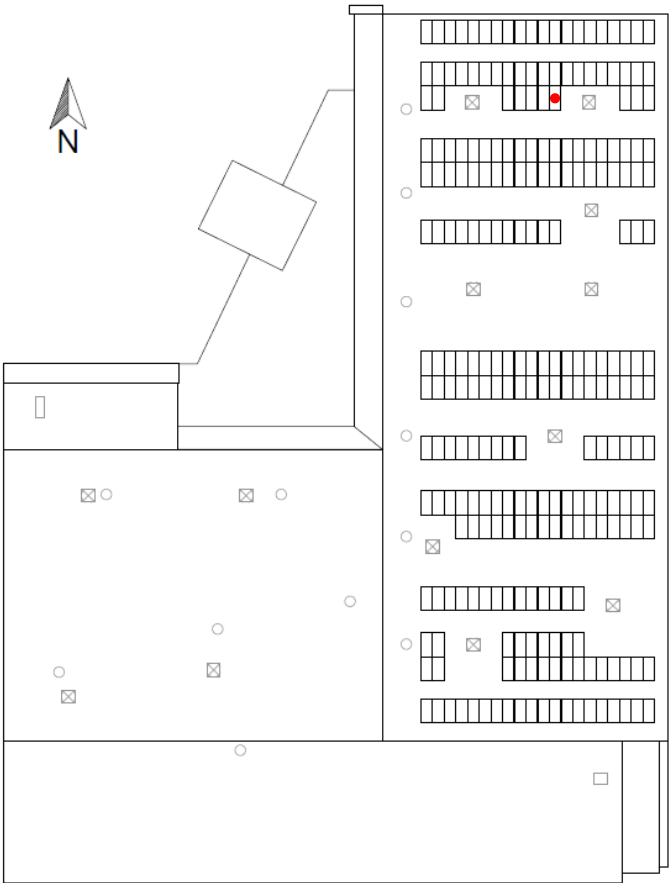


File name:	20190410_112942_980_R.JPG	Altitude:	35.8m
Date taken:	Apr 10, 2019 11:29:43 AM	Heading:	North (0°)
Position:	 -31.8615555, 115.8067915	User tags:	Thermal

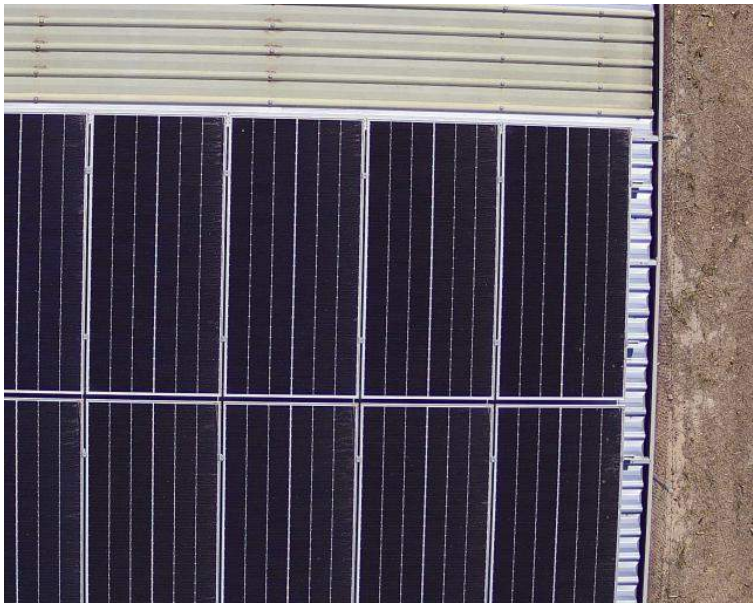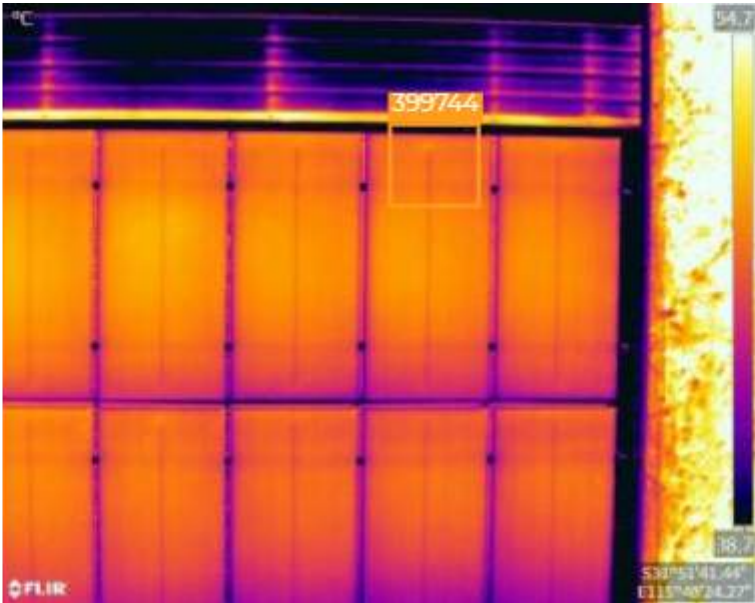



For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403639

399744 Severity: 1 Junction box

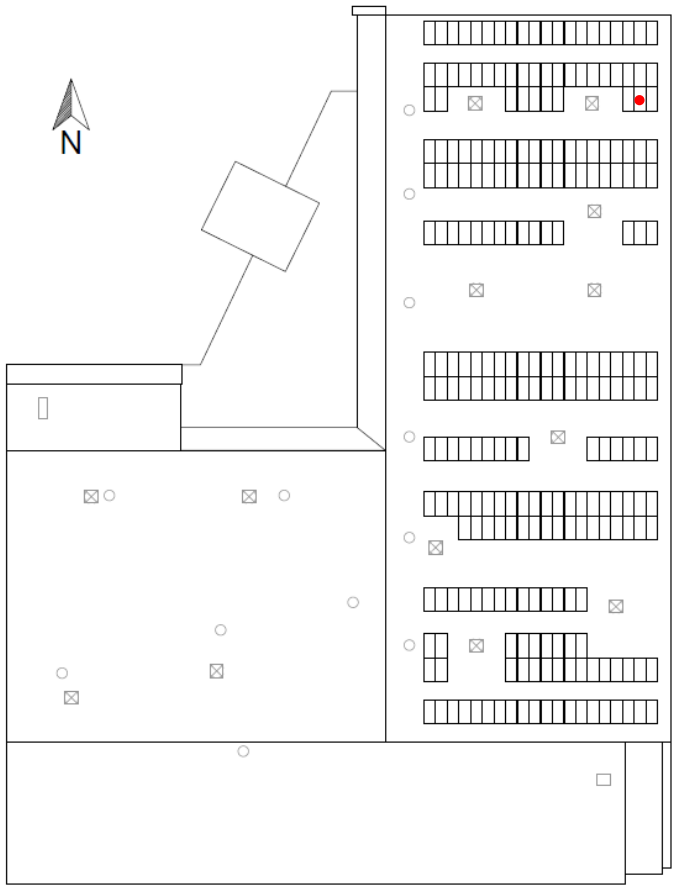


File name: 20190410_112950_988_R.JPG
Date taken: Apr 10, 2019 11:29:51 AM
Position:  -31.8615554, 115.8067052

Altitude: 34.6m
Heading: North (0°)
User tags: Thermal

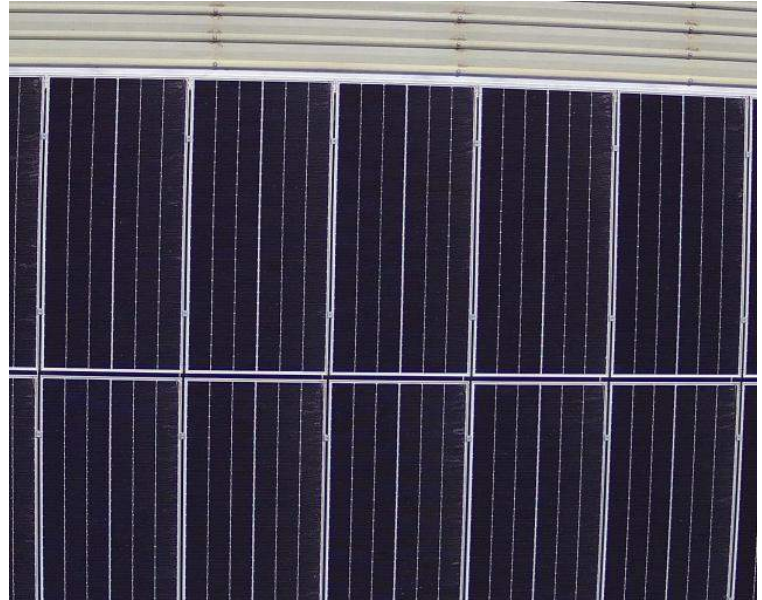
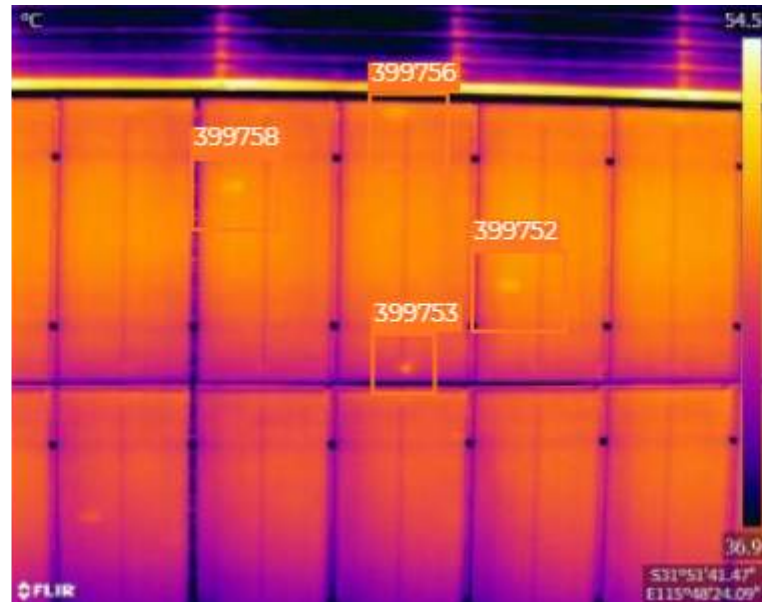


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403643

- 399752 Severity: 2 Single Cell
- 399753 Severity: 2 Junction box
- 399756 Severity: 2 Single Cell
- 399758 Severity: 2 Single Cell

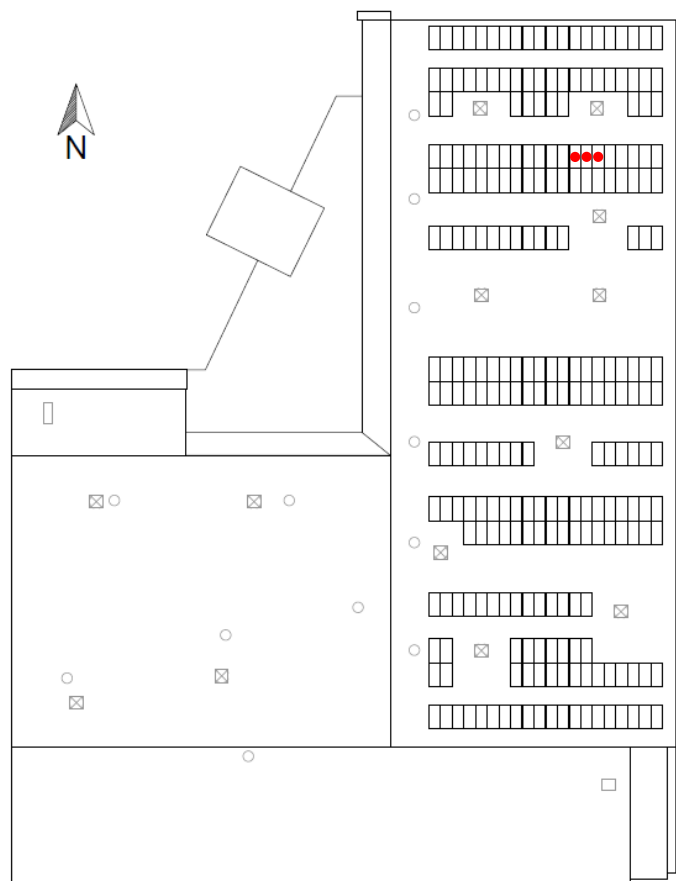


File name:	20190410_112954_697_R.JPG	Altitude:	34.7m
Date taken:	Apr 10, 2019 11:29:54 AM	Heading:	North (0°)
Position:	 -31.8615559, 115.8066716	User tags:	Thermal

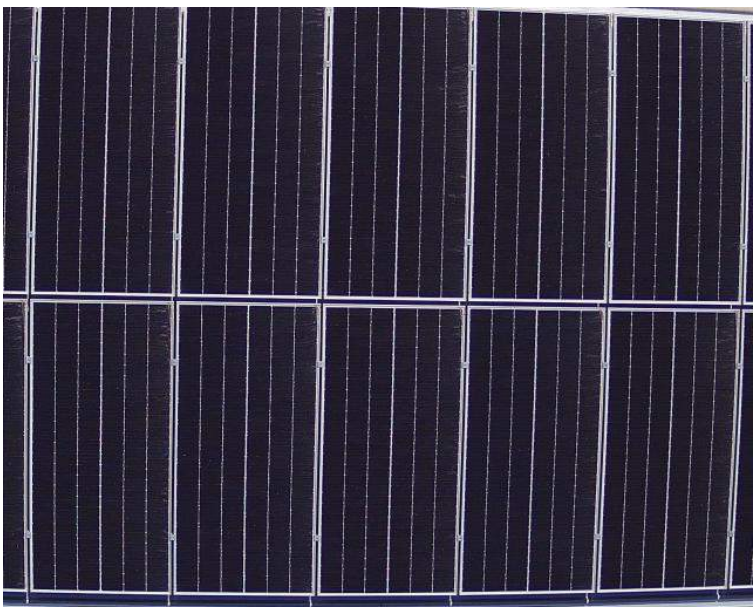
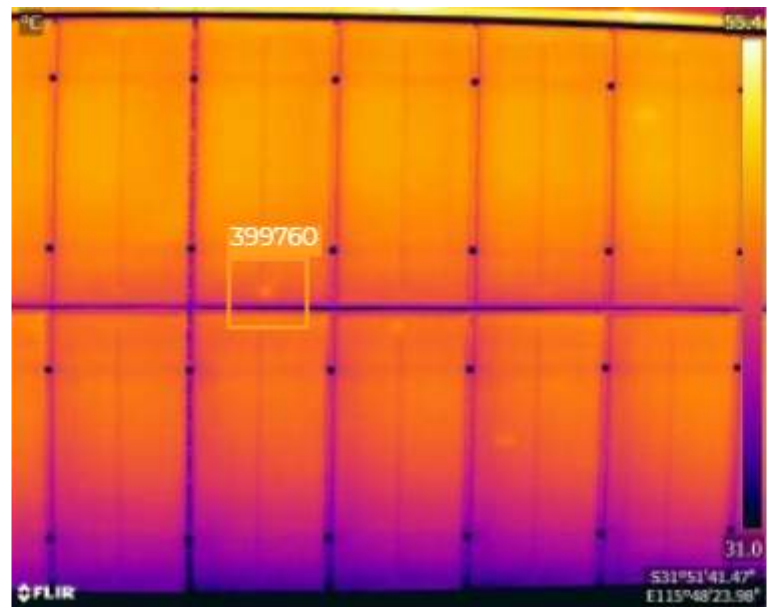


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403645

399760 Severity: 1 Junction box

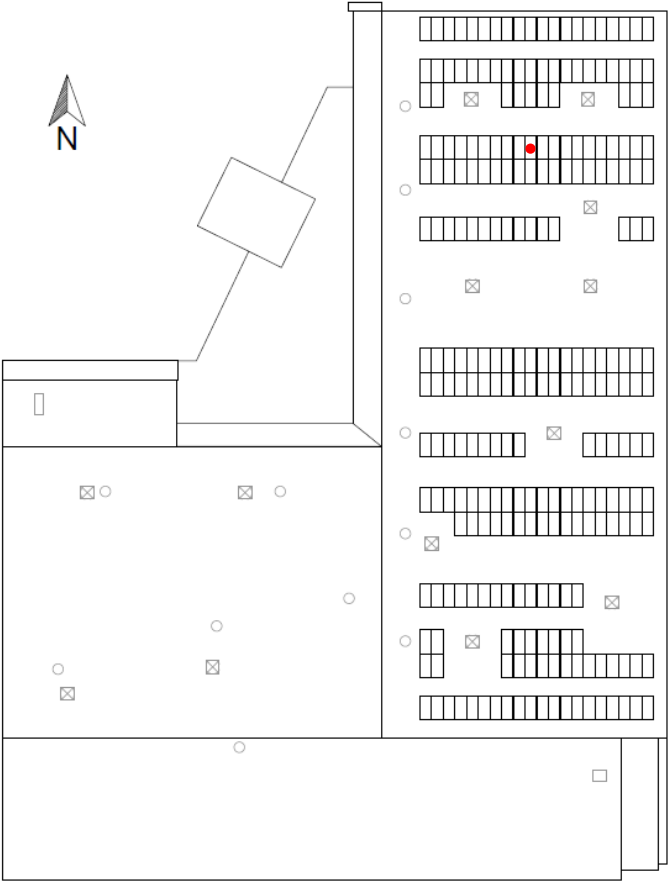


File name:	20190410_112959_197_R.JPG	Altitude:	34.6m
Date taken:	Apr 10, 2019 11:29:59 AM	Heading:	North (0°)
Position:	 -31.8615538, 115.8066354	User tags:	Thermal

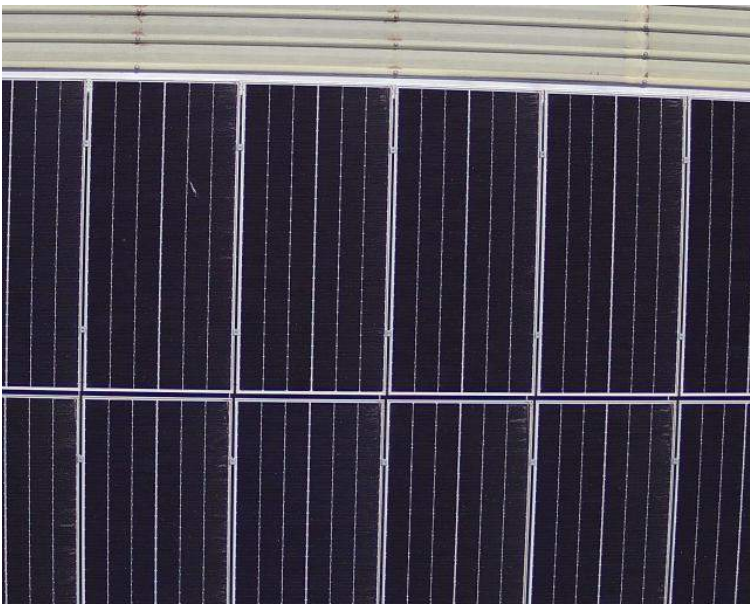
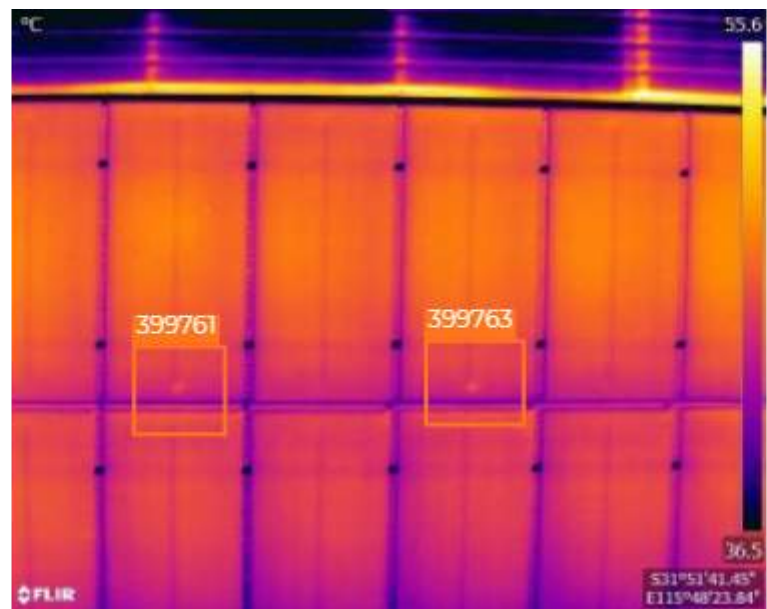


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403647

- 399761 Severity: 2 Junction box
- 399763 Severity: 2 Junction box

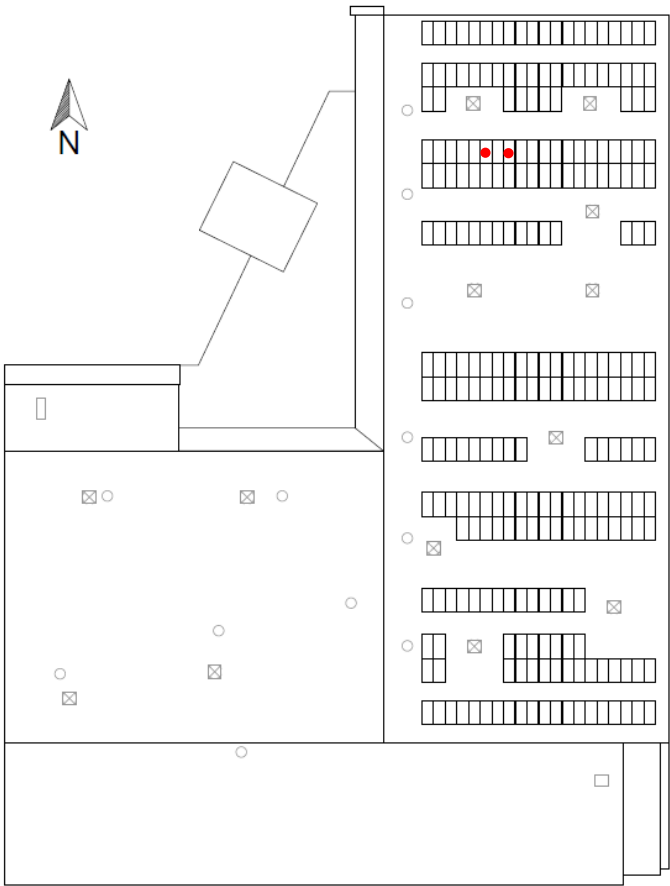

File name:	20190410_113742_368_R.JPG	Altitude:	33.9m
Date taken:	Apr 10, 2019 11:37:42 AM	Heading:	North (0°)
Position:	 -31.8615540, 115.8066047	User tags:	Thermal

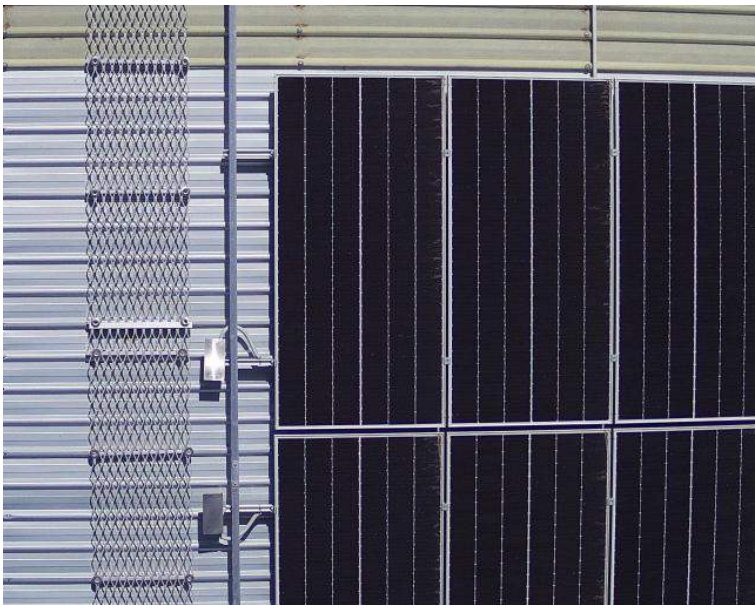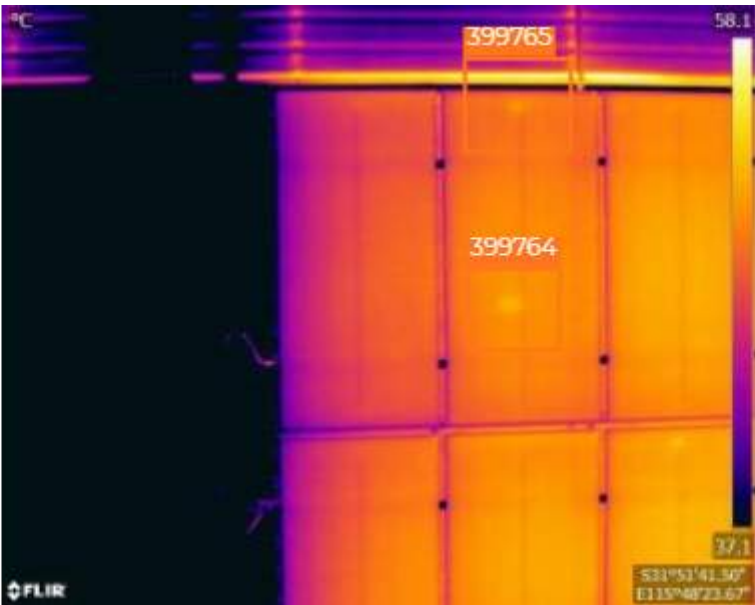

For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403649


- 399764

Severity: 2



Single Cell
- 399765

Severity: 2

Junction box

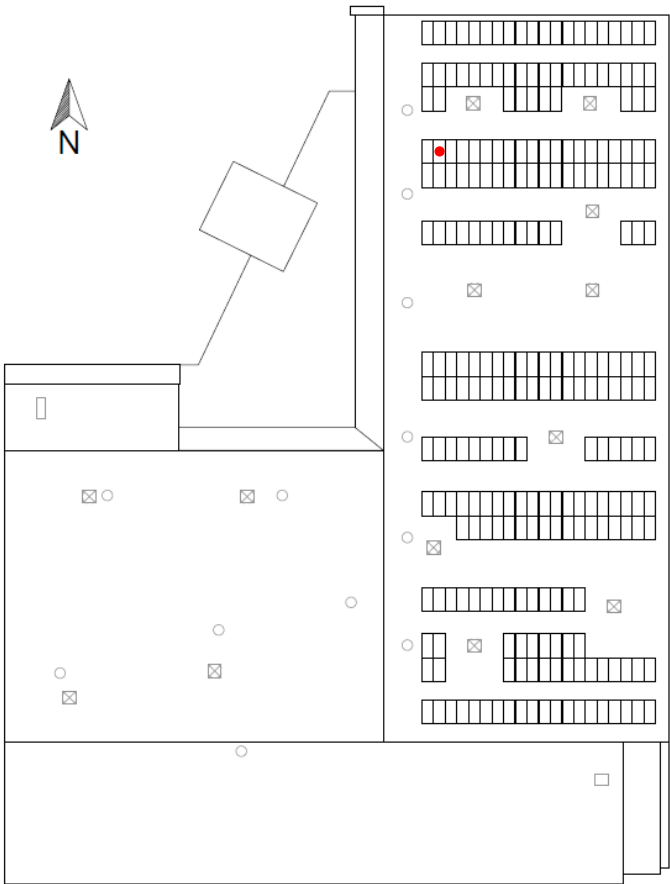


File name:	20190410_113949_360_R.JPG	Altitude:	31.9m
Date taken:	Apr 10, 2019 11:39:49 AM	Heading:	North (0°)
Position:	 -31.8615705, 115.8067915	User tags:	Thermal

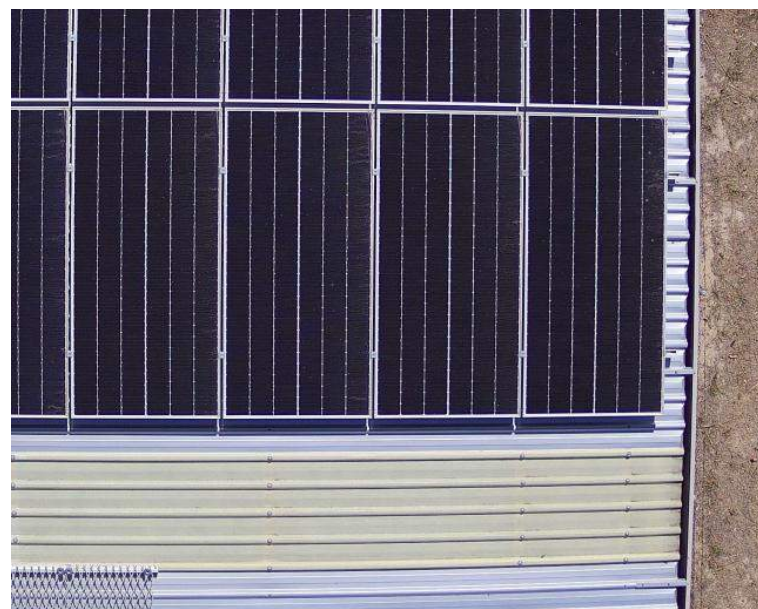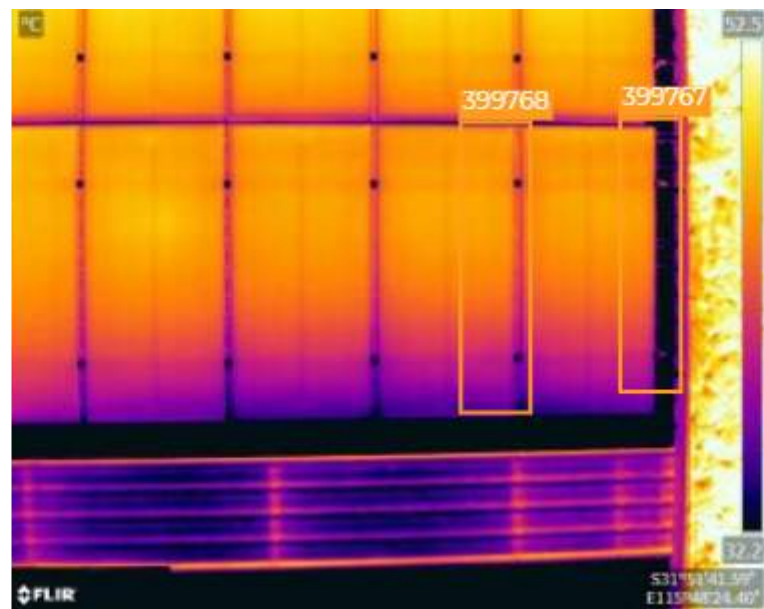



For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403651

- 399767 Severity: 1 Soiling
- 399768 Severity: 1 Soiling

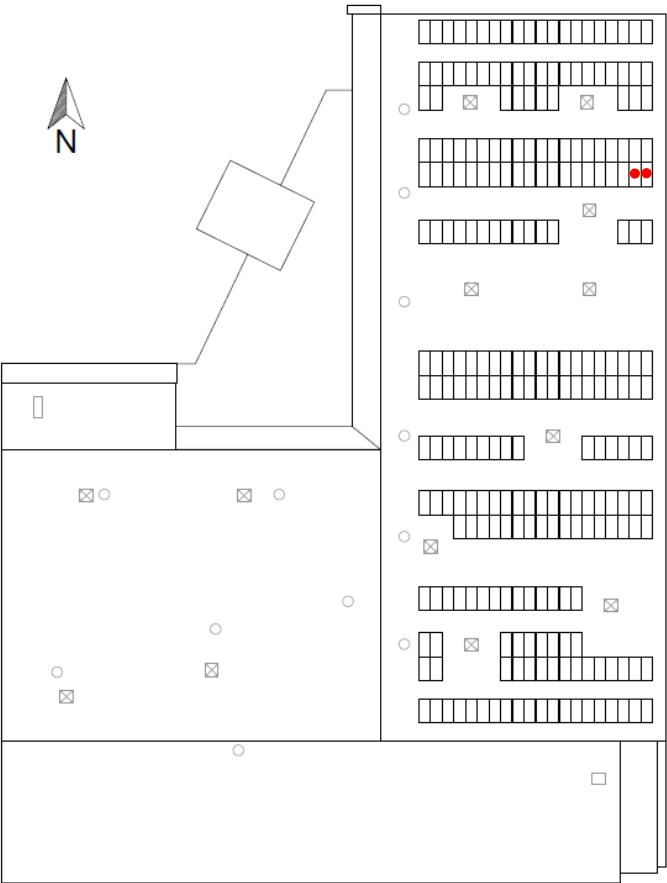


File name: 20190410_114003_278_R.JPG
Date taken: Apr 10, 2019 11:40:03 AM
Position:  -31.8615724, 115.8067620

Altitude: 33.4m
Heading: North (0°)
User tags: Thermal

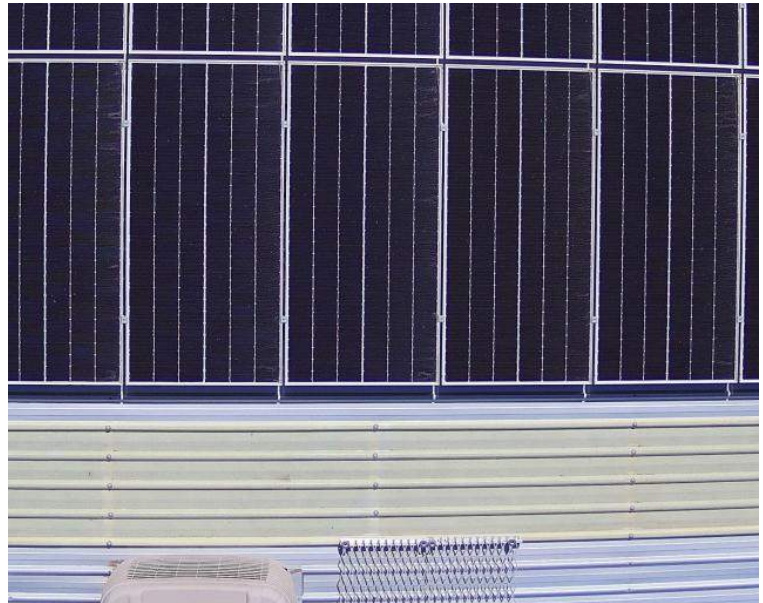
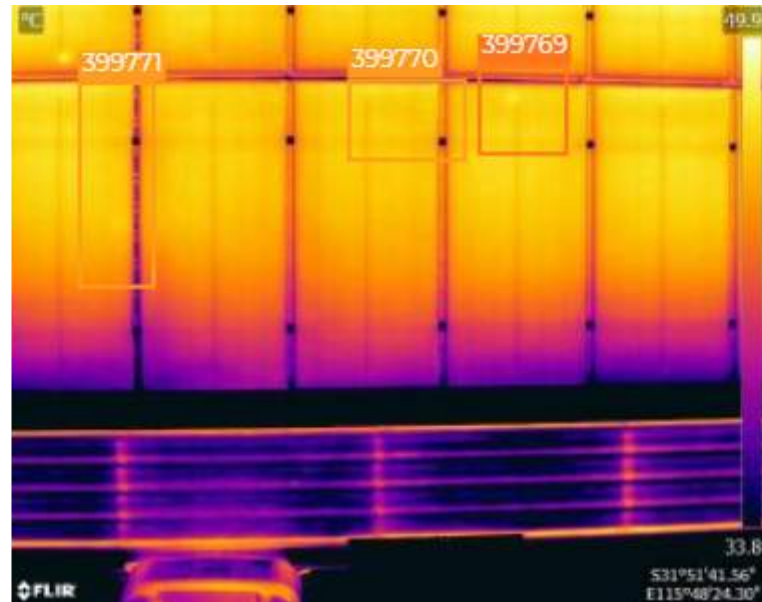


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403653

399769 Severity: 2 Junction box
399770 Severity: 1 Soiling
399771 Severity: 1 Soiling

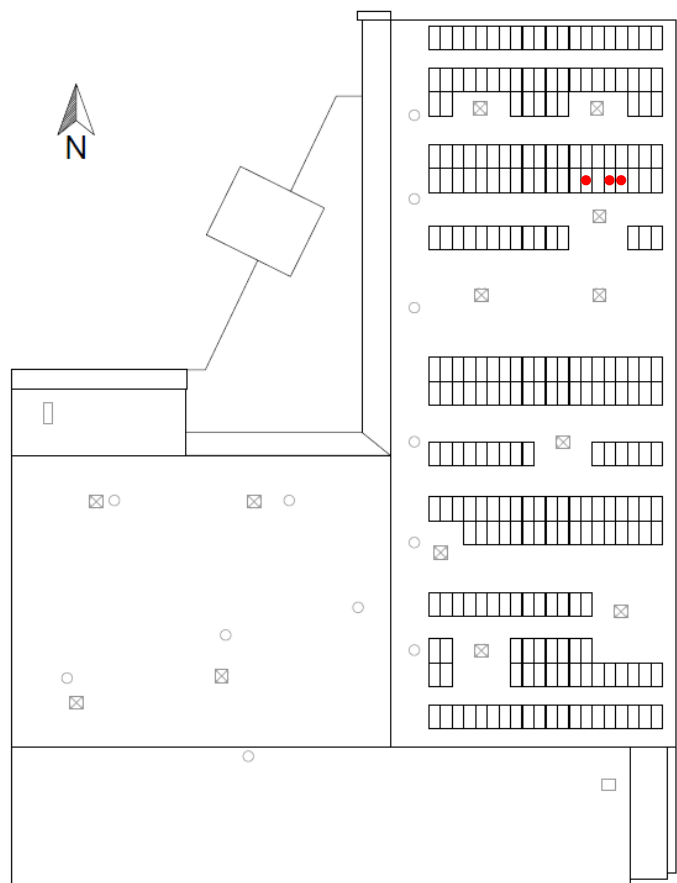


File name:	20190410_114019_757_R.JPG	Altitude:	31.5m
Date taken:	Apr 10, 2019 11:40:19 AM	Heading:	North (0°)
Position:	 -31.8615706, 115.8067065	User tags:	Thermal

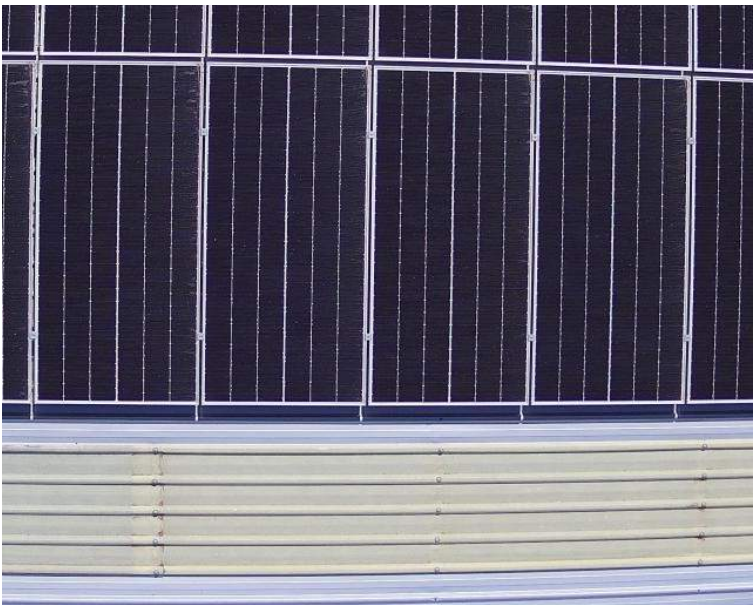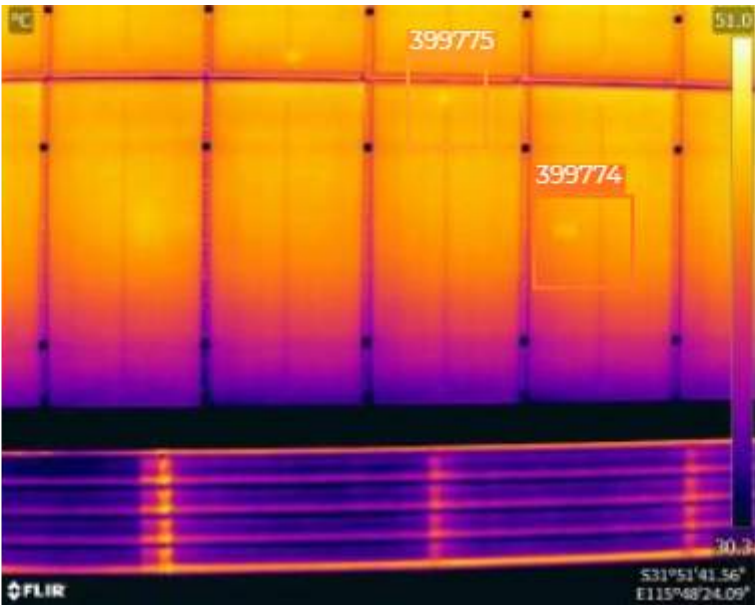



For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403657

- 399774 Severity: 2 Single Cell
- 399775 Severity: 1 Junction box

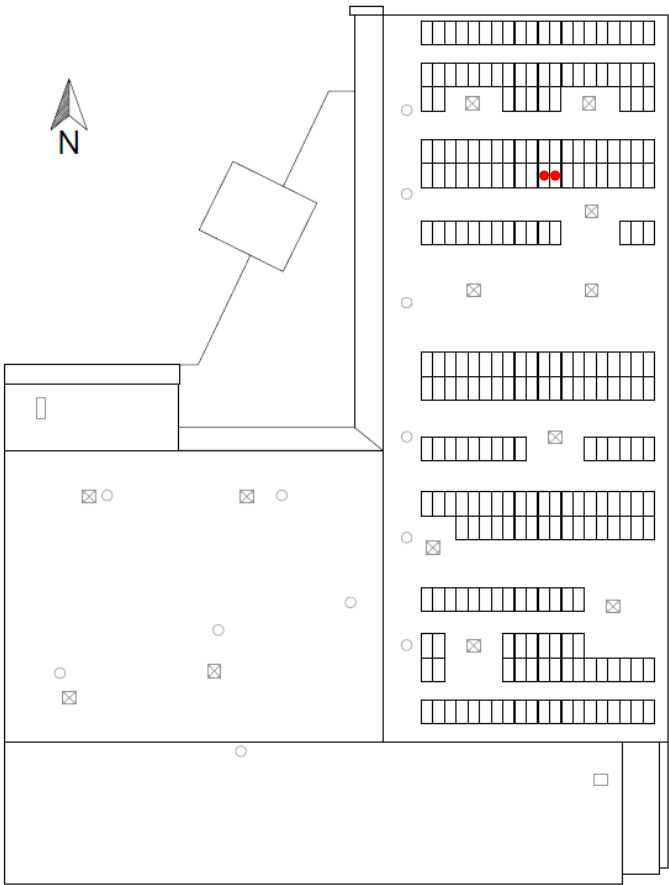

File name: 20190410_114048_688_R.JPG
Date taken: Apr 10, 2019 11:40:48 AM
Position:  -31.8615758, 115.8066323


Altitude: 32.7m
Heading: North (0°)
User tags: Thermal

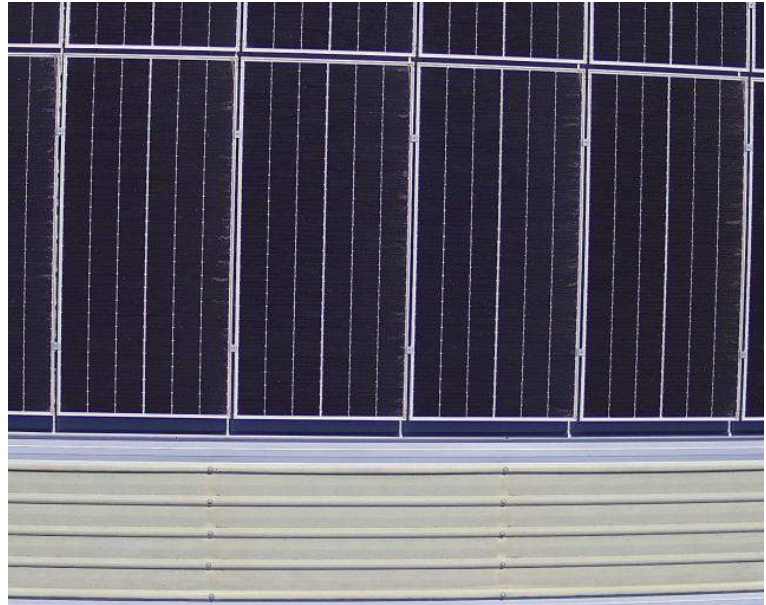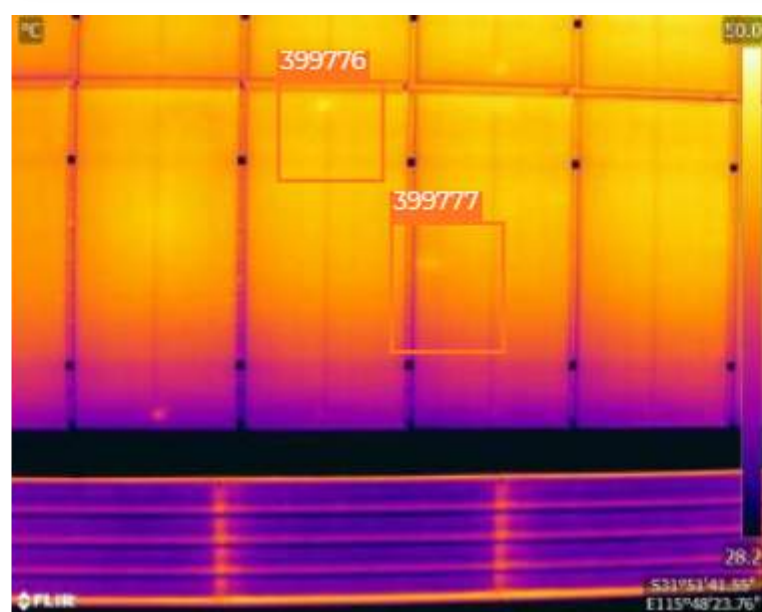

For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403661


399776 Severity: 2 Junction box

399777 Severity: 2 Single Cell

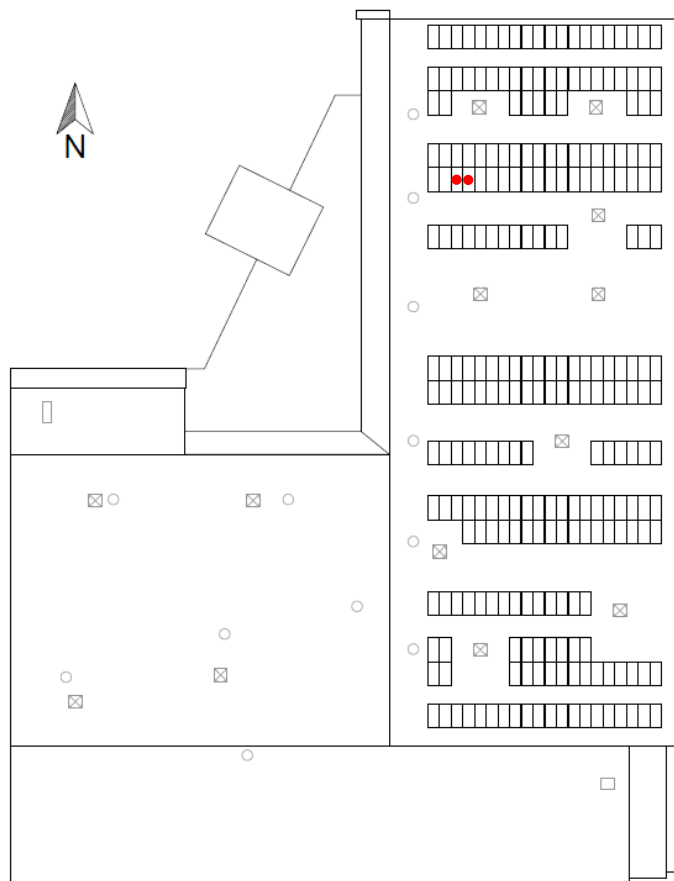


File name: 20190410_114105_369_R.JPG
Date taken: Apr 10, 2019 11:41:05 AM
Position:  -31.8615764, 115.8066060

Altitude: 32.9m
Heading: North (0°)
User tags: Thermal


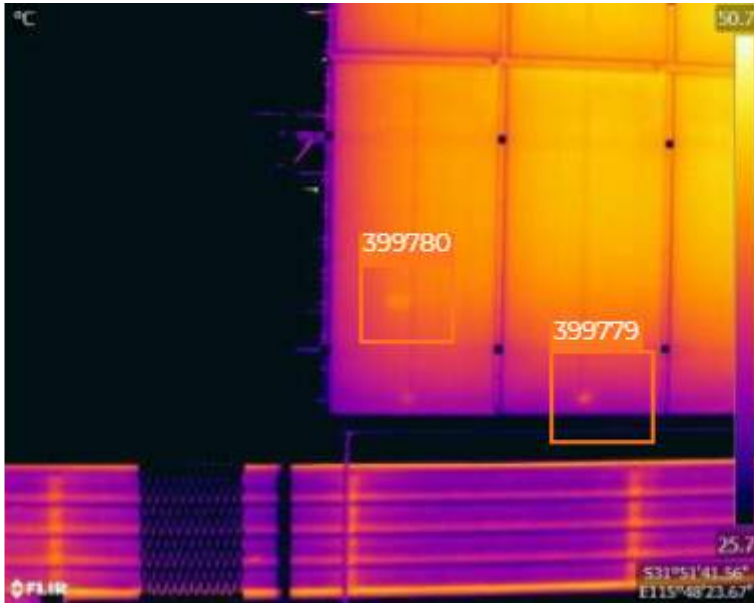


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403663

399779 Severity: 2 Junction box
399780 Severity: 2 Single Cell

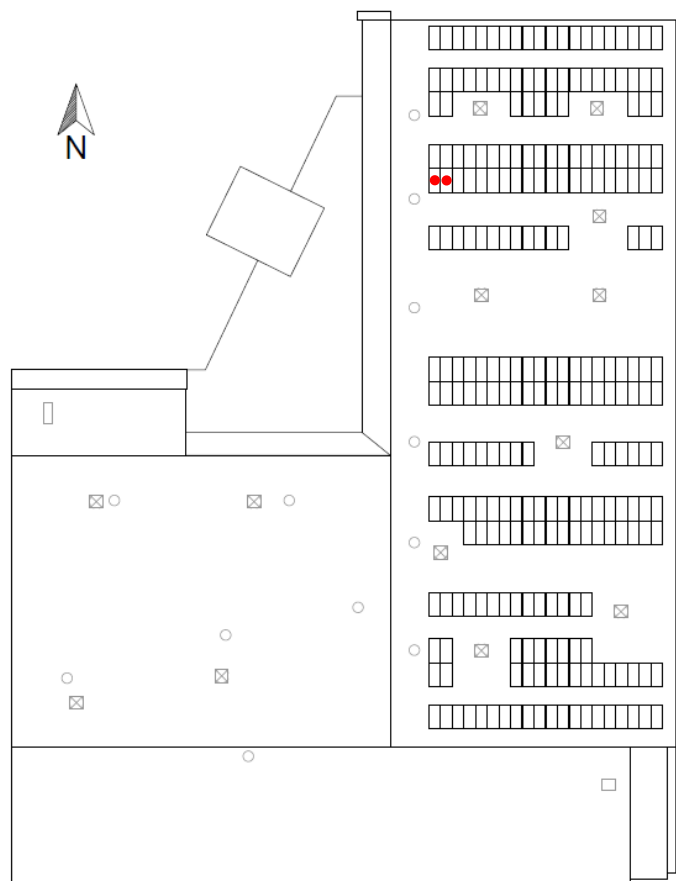

File name:	20190410_114120_587_R.JPG	Altitude:	34.1m
Date taken:	Apr 10, 2019 11:41:20 AM	Heading:	North (0°)
Position:	 -31.8616117, 115.8066055	User tags:	Thermal

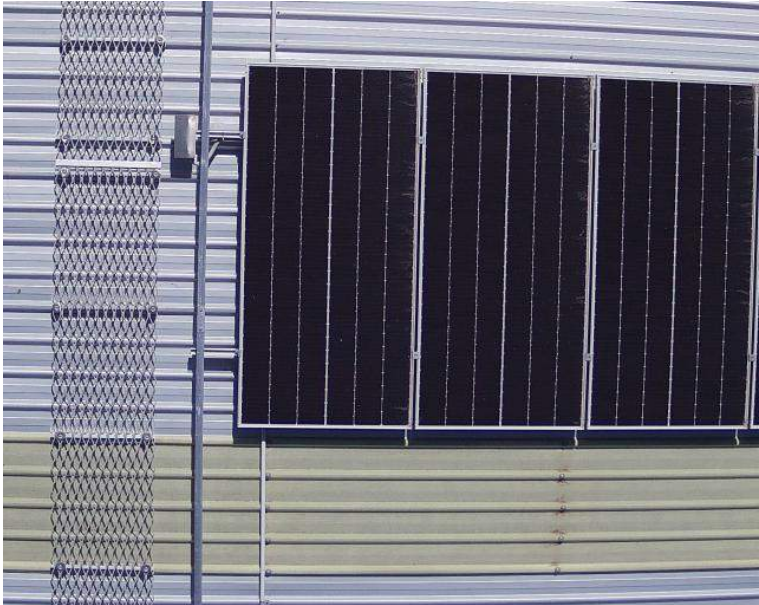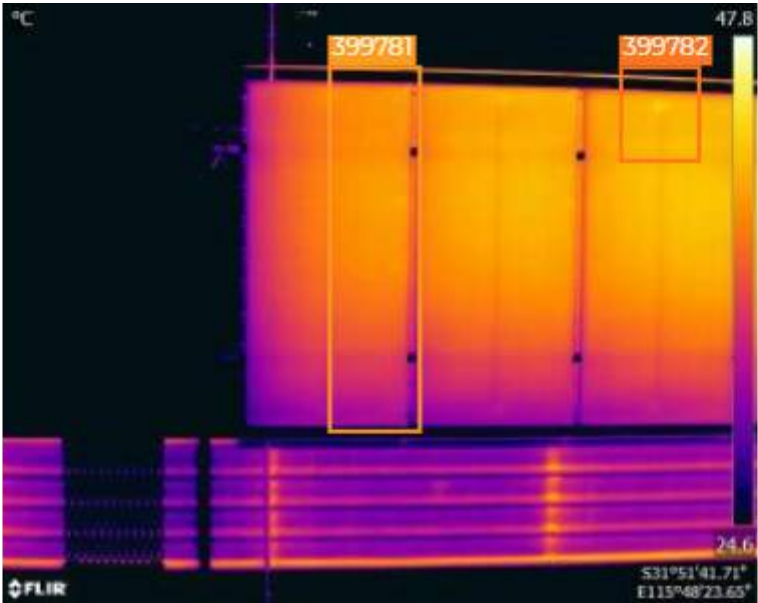

For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403665


- 399781

Severity: 1

Soiling
- 399782



Severity: 2

Junction box

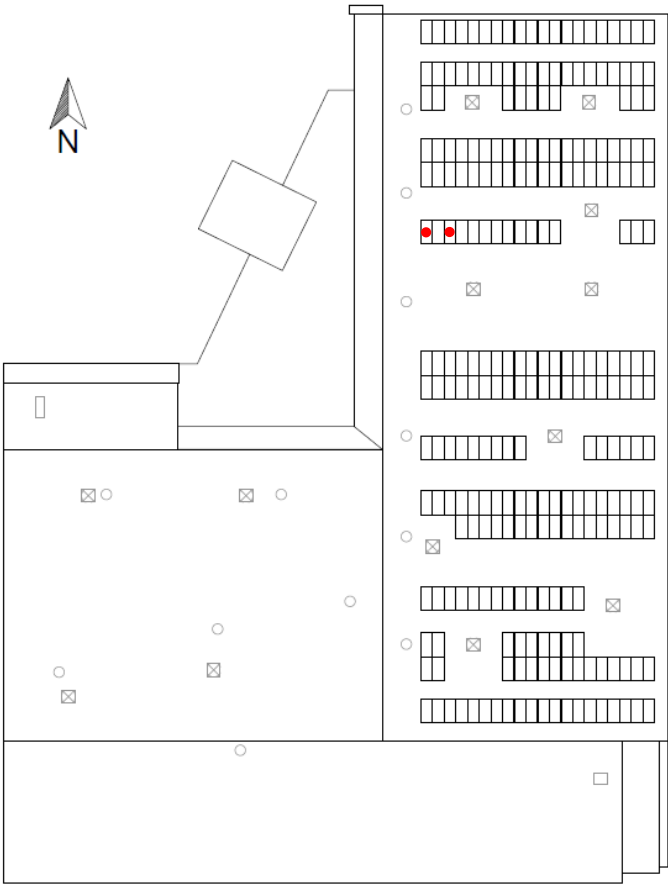


File name: 20190410_114132_067_R.JPG
Date taken: Apr 10, 2019 11:41:32 AM
Position:  -31.8616115, 115.8066596

Altitude: 34.8m
Heading: North (0°)
User tags: Thermal

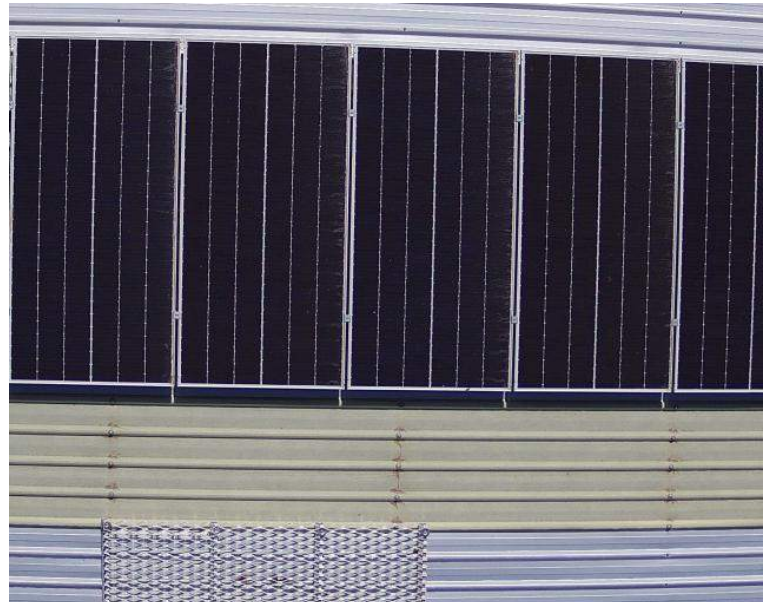
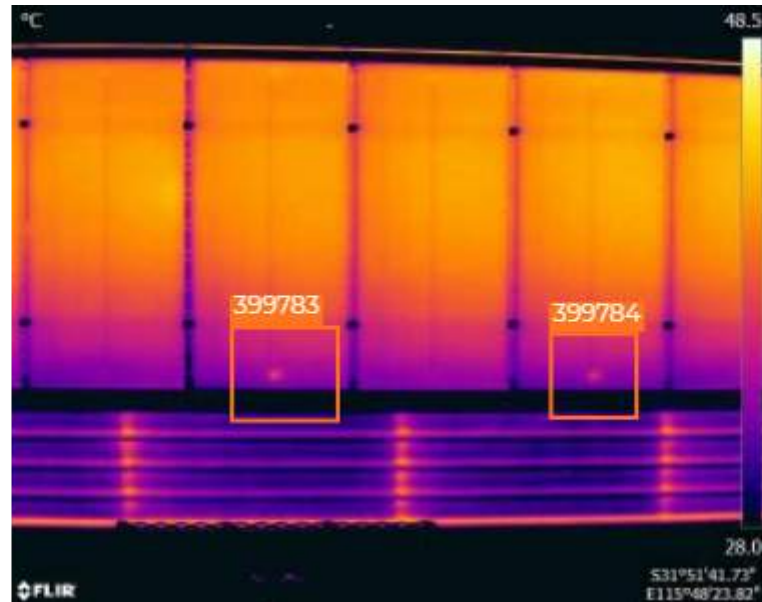


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403669

399783 Severity: 2 Junction box
399784 Severity: 2 Junction box

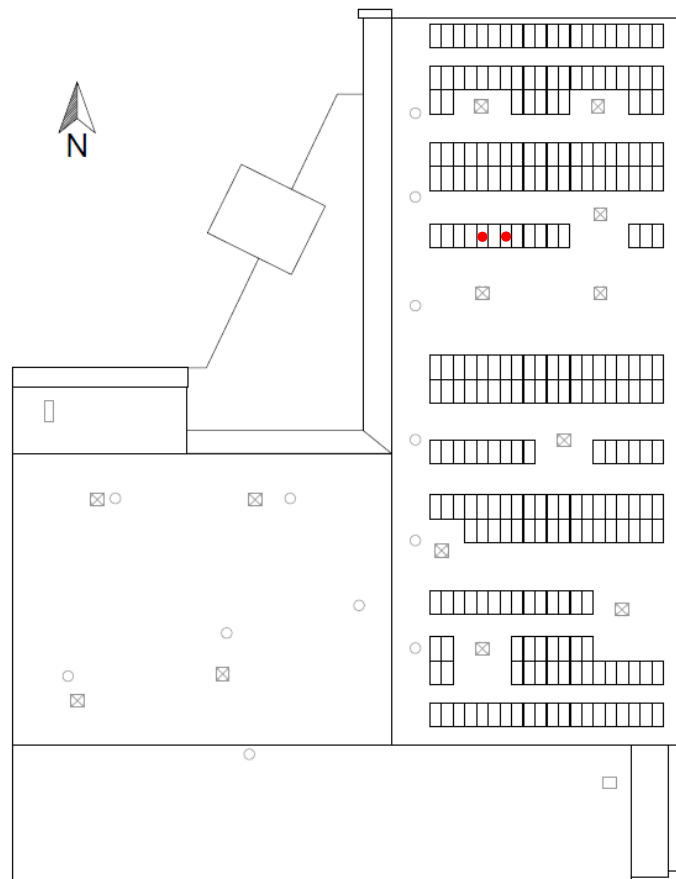


File name:	20190410_114134_468_R.JPG	Altitude:	34.7m
Date taken:	Apr 10, 2019 11:41:34 AM	Heading:	North (0°)
Position:	 -31.8616110, 115.8066846	User tags:	Thermal

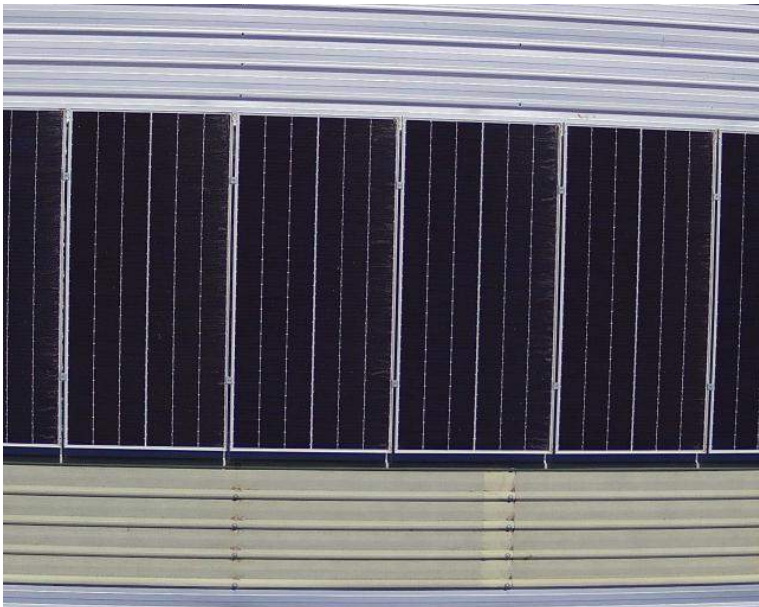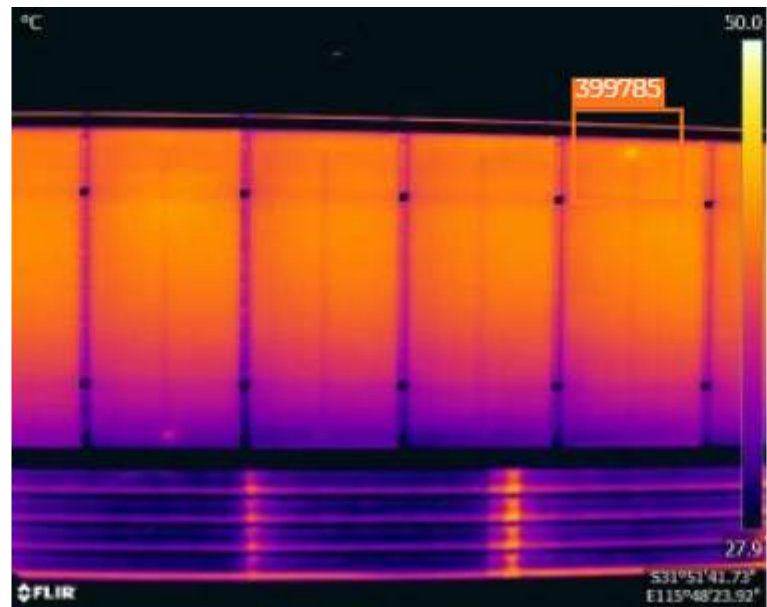



For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403671

399785 Severity: 2 Junction box

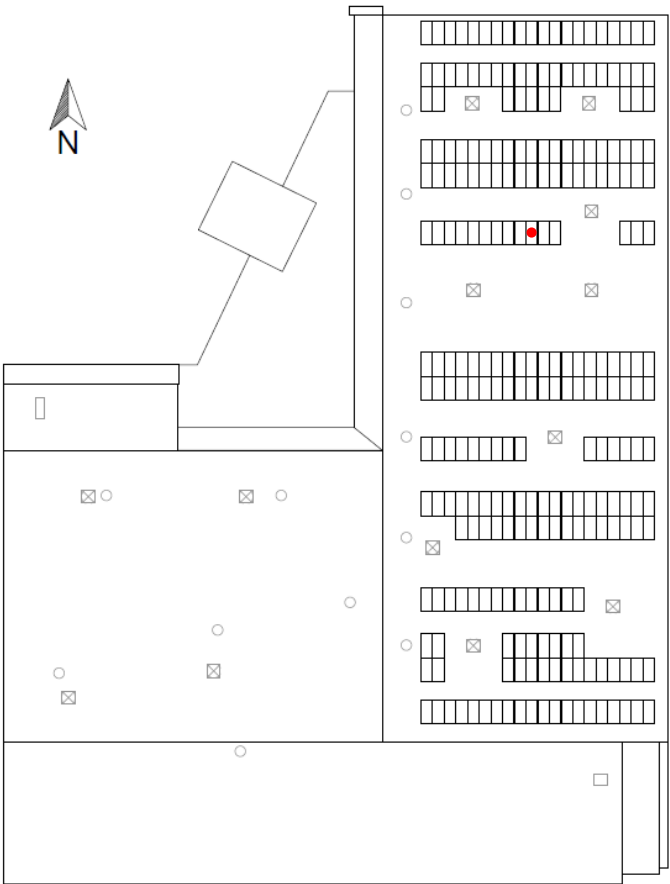


File name: 20190410_114232_458_R.JPG
Date taken: Apr 10, 2019 11:42:32 AM
Position:  -31.8616937, 115.8067374

Altitude: 31.8m
Heading: North (0°)
User tags: Thermal

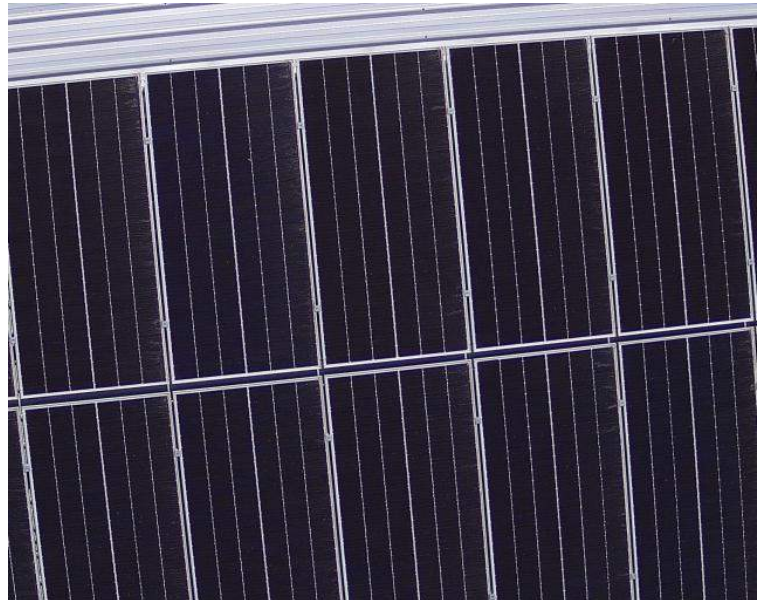
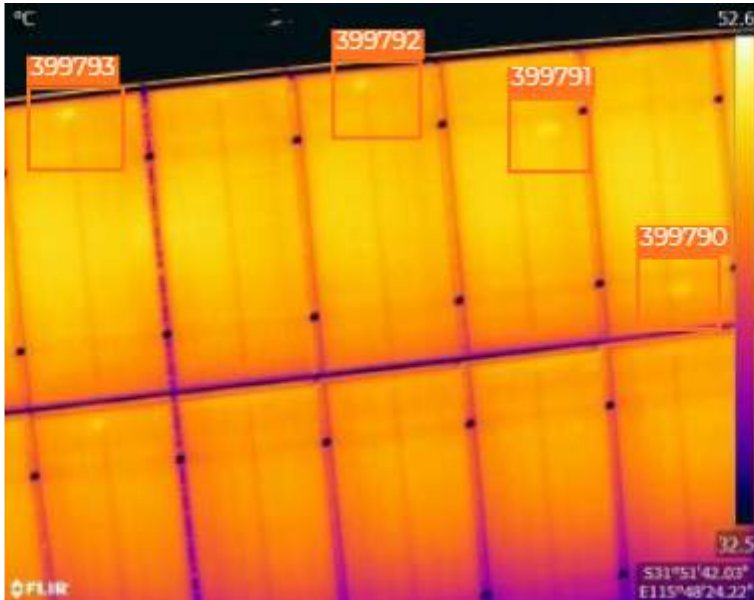


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403683

- 399790 Severity: 2 Single Cell
- 399791 Severity: 2 Single Cell
- 399792 Severity: 2 Junction box
- 399793 Severity: 2 Junction box

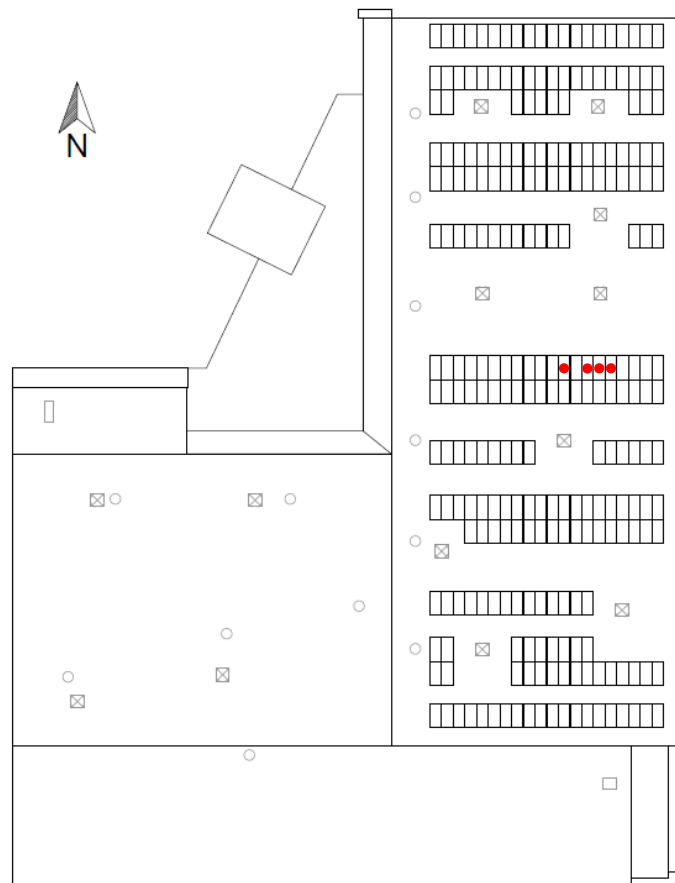


File name:	20190410_114308_759_R.JPG	Altitude:	34.8m
Date taken:	Apr 10, 2019 11:43:08 AM	Heading:	North (0°)
Position:	 -31.8616937, 115.8066743	User tags:	Thermal

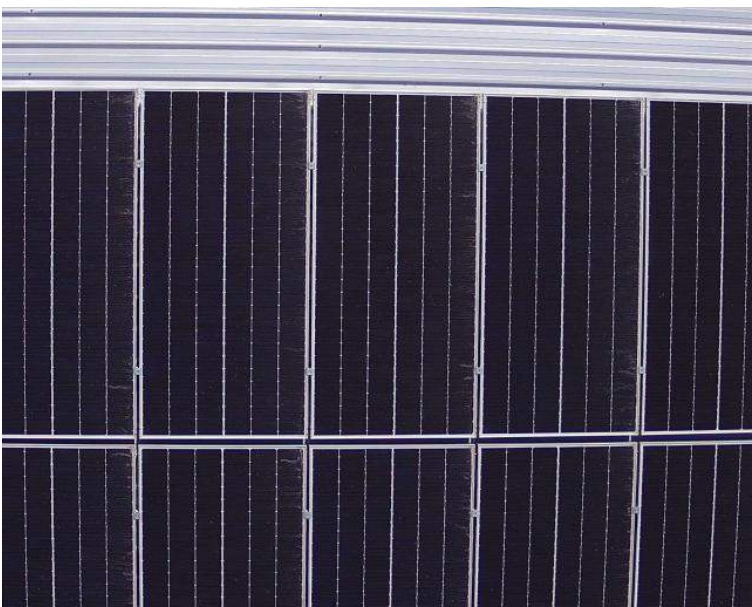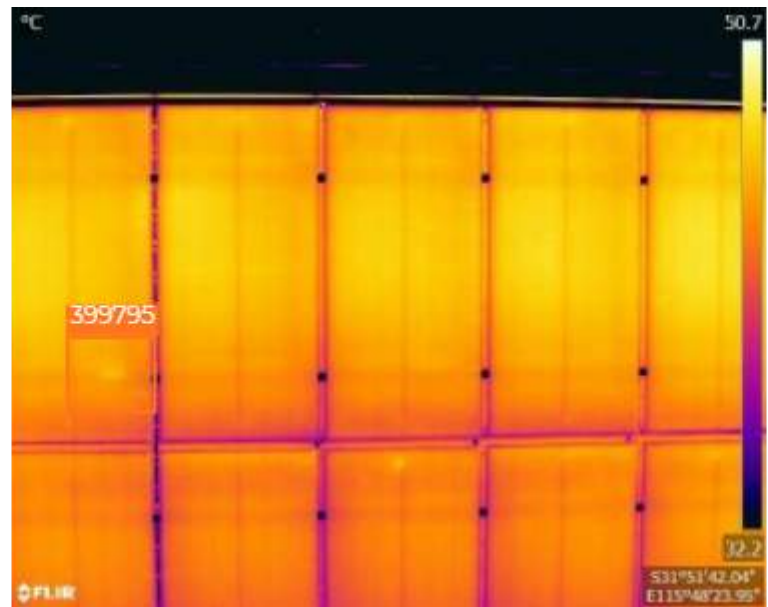



For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403689

399795 Severity: 2 Single Cell

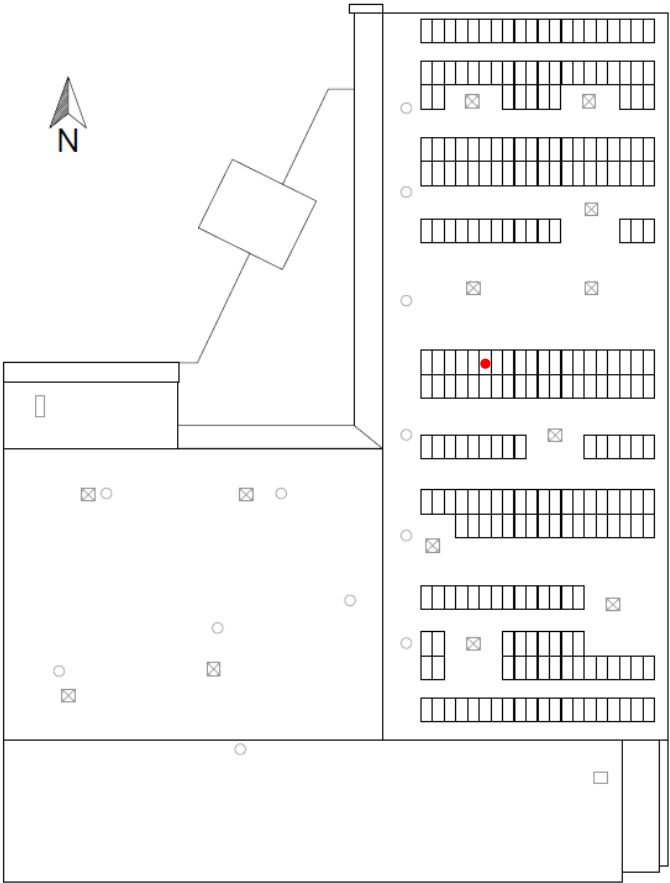


File name: 20190410_114320_068_R.JPG
Date taken: Apr 10, 2019 11:43:20 AM
Position:  -31.8616937, 115.8066047

Altitude: 35.7m
Heading: North (0°)
User tags: Thermal

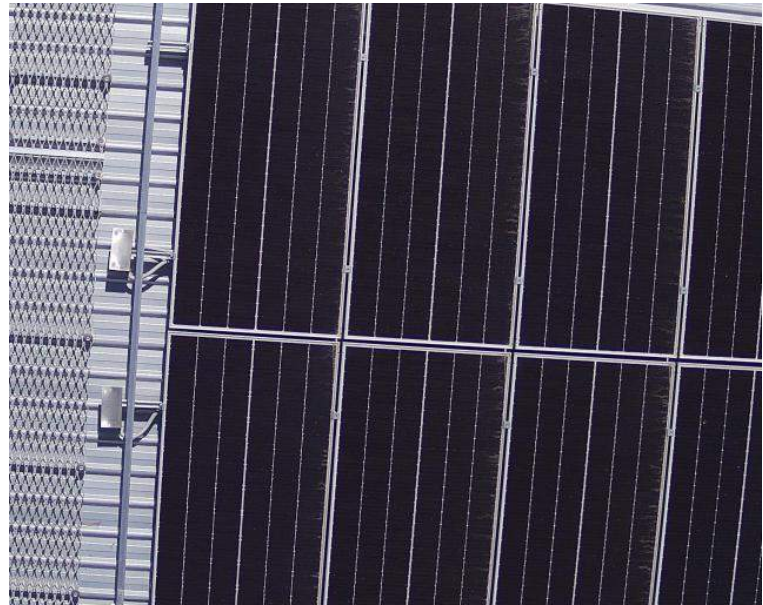
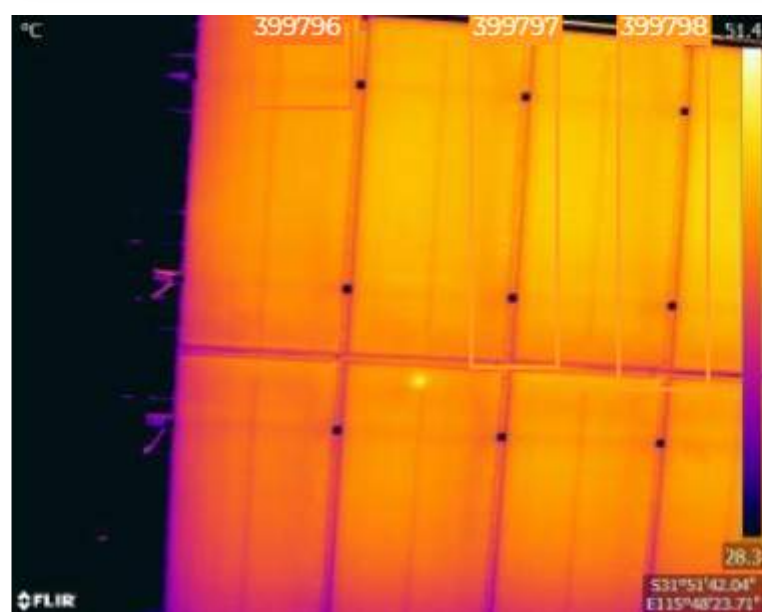


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403695

399796 Severity: 2 Junction box
399797 Severity: 1 Soiling
399798 Severity: 1 Soiling

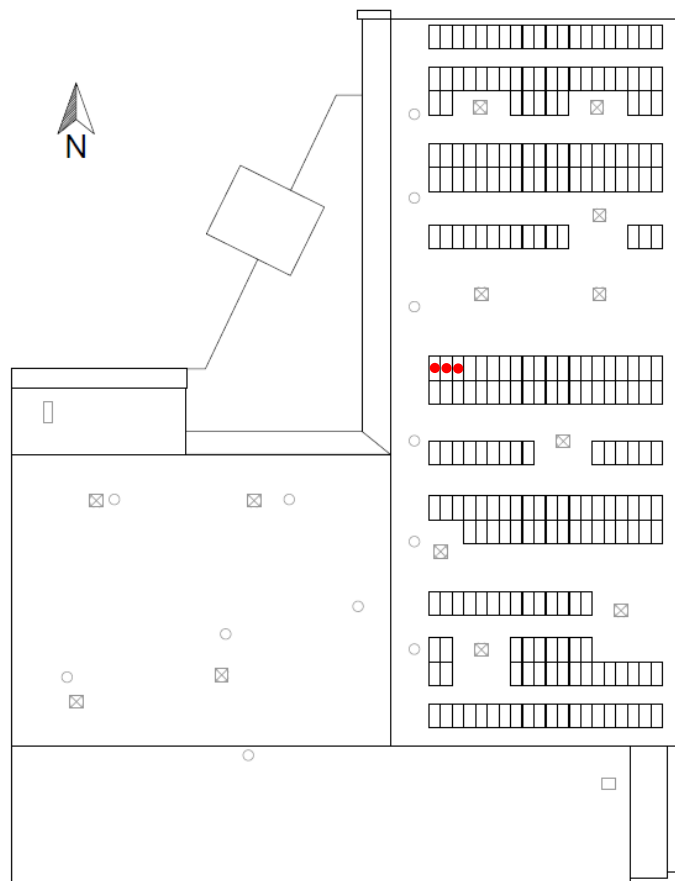


File name:	20190410_114338_058_R.JPG	Altitude:	34m
Date taken:	Apr 10, 2019 11:43:38 AM	Heading:	North (0°)
Position:	 -31.8617122, 115.8066108	User tags:	Thermal

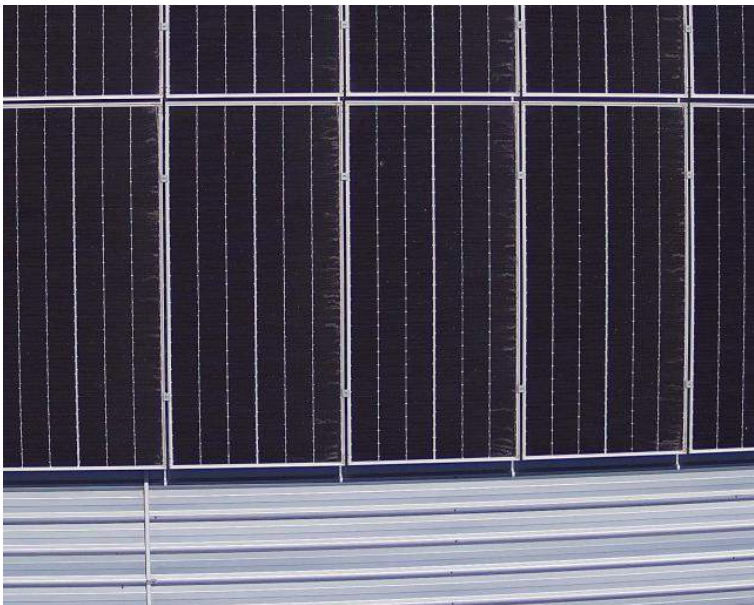
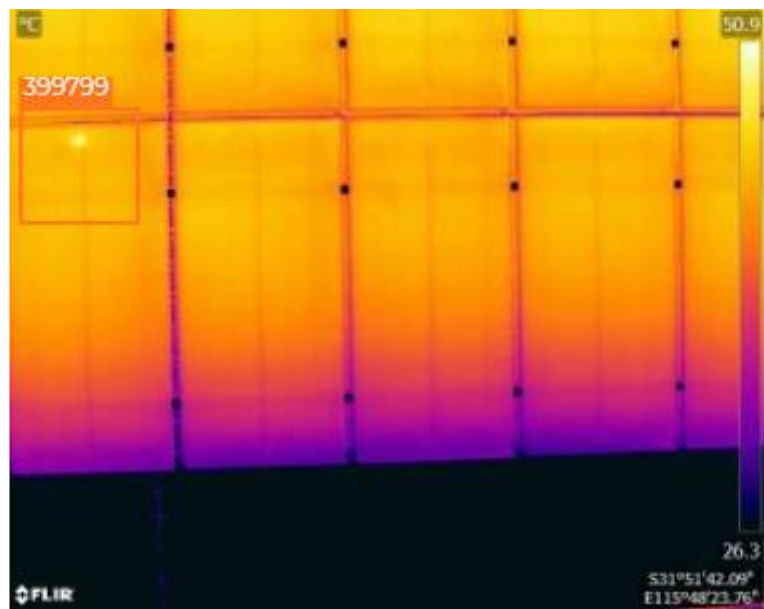


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403697

399799 Severity: 2 Junction box

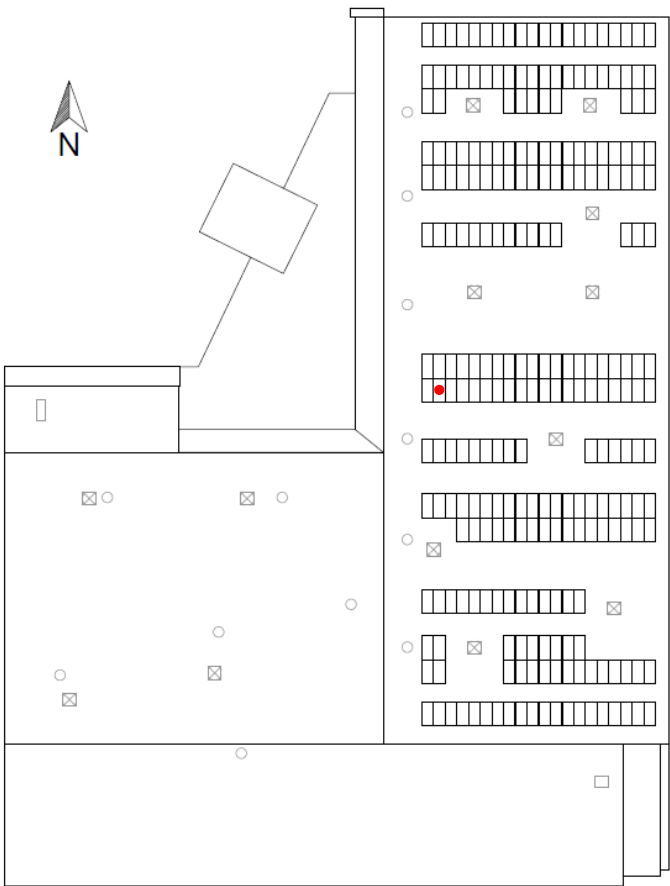


File name:	20190410_114403_779_R.JPG	Altitude:	34.3m
Date taken:	Apr 10, 2019 11:44:03 AM	Heading:	North (0°)
Position:	 -31.8617122, 115.8066739	User tags:	Thermal

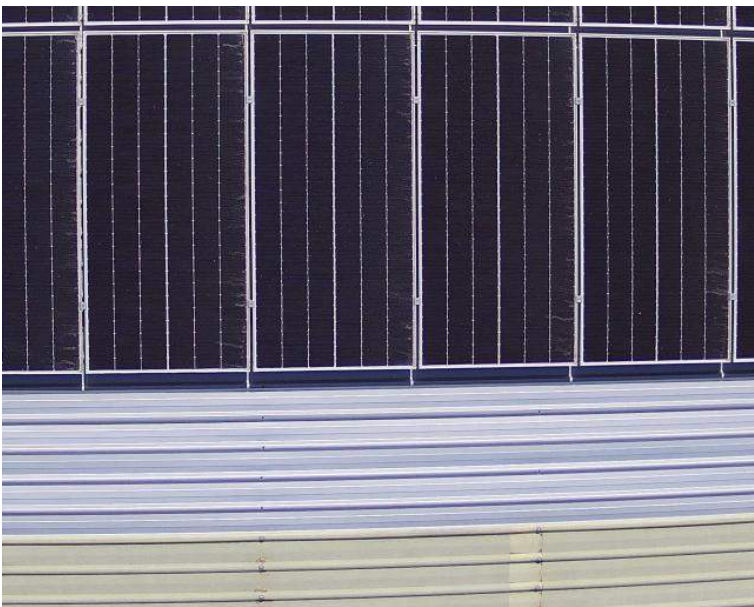
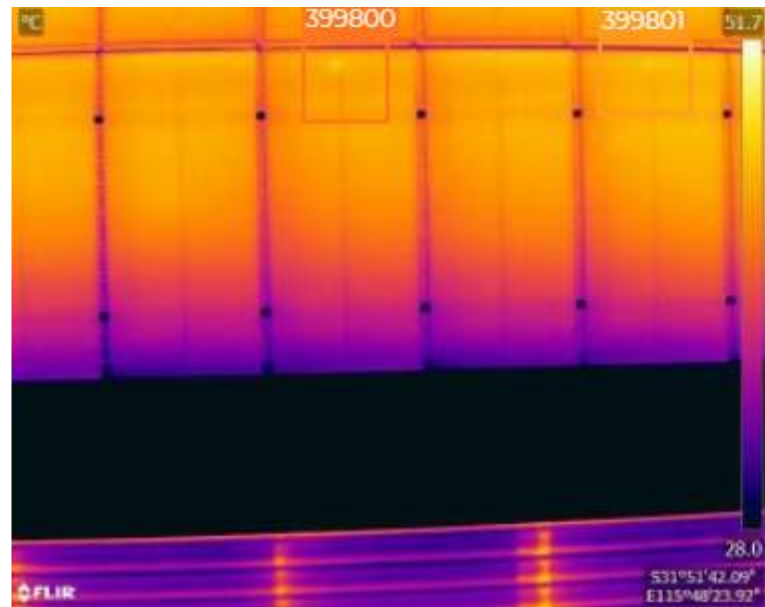


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403701

- 399800Severity: 2Junction box
- 399801Severity: 1Junction box

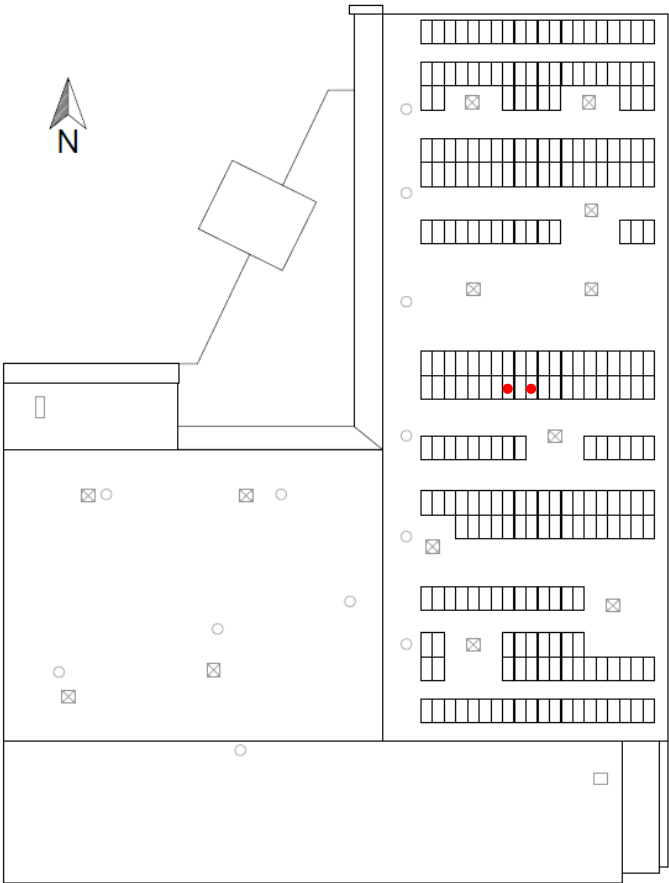


File name:	20190410_114412_757_R.JPG	Altitude:	33.8m
Date taken:	Apr 10, 2019 11:44:12 AM	Heading:	North (0°)
Position:	 -31.8617080, 115.8067311	User tags:	Thermal

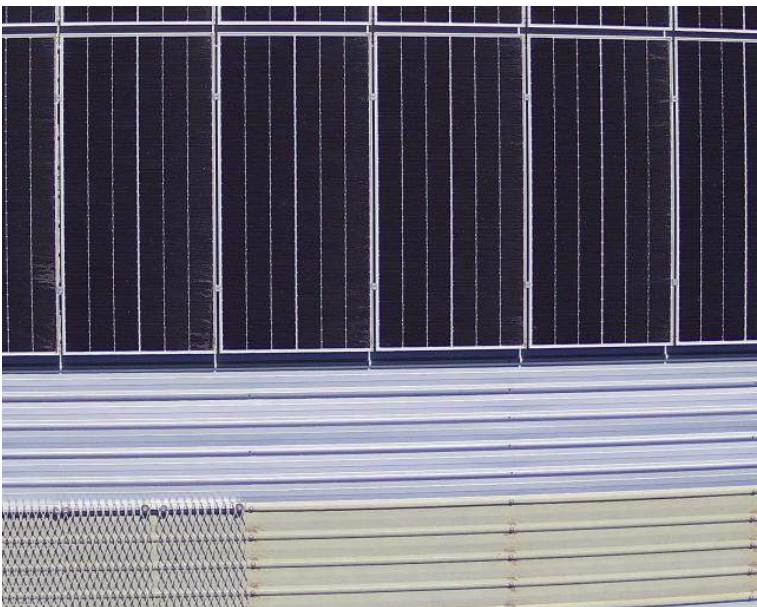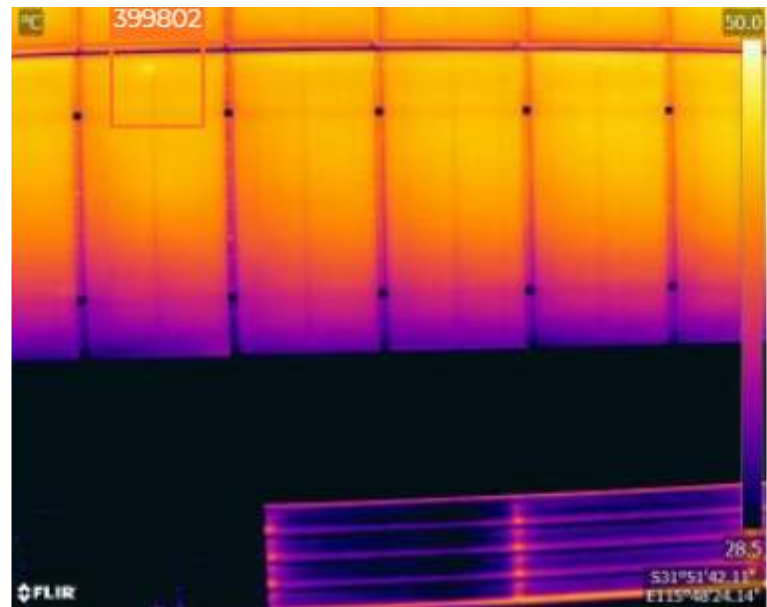


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403705

399802 Severity: 2 Junction box

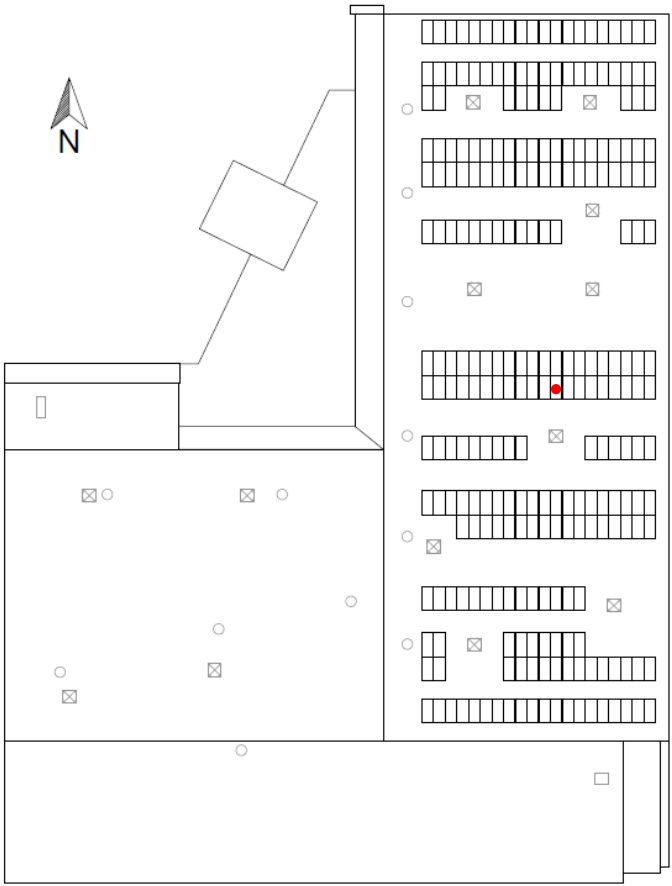


File name:	20190410_114416_658_R.JPG	Altitude:	33.7m
Date taken:	Apr 10, 2019 11:44:16 AM	Heading:	North (0°)
Position:	 -31.8617080, 115.8067633	User tags:	Thermal


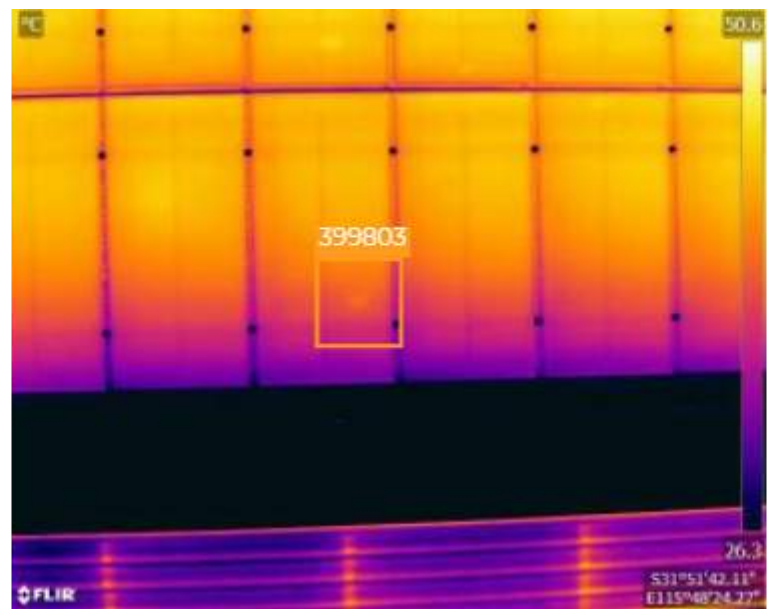


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403707

399803 Severity: 1 Single Cell

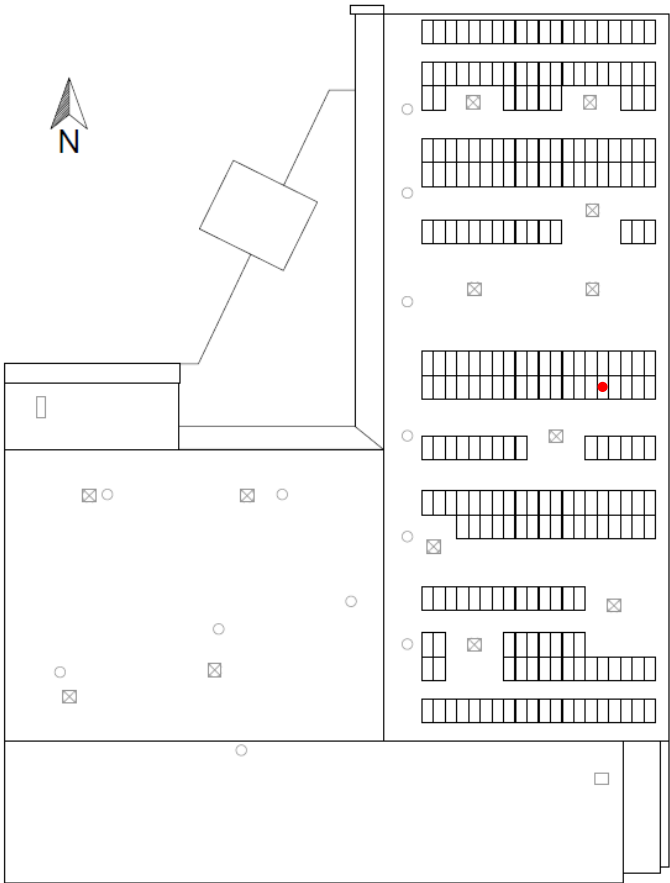


File name:	20190410_114420_268_R.JPG	Altitude:	33.7m
Date taken:	Apr 10, 2019 11:44:20 AM	Heading:	North (0°)
Position:	 -31.8617109, 115.8067989	User tags:	Thermal

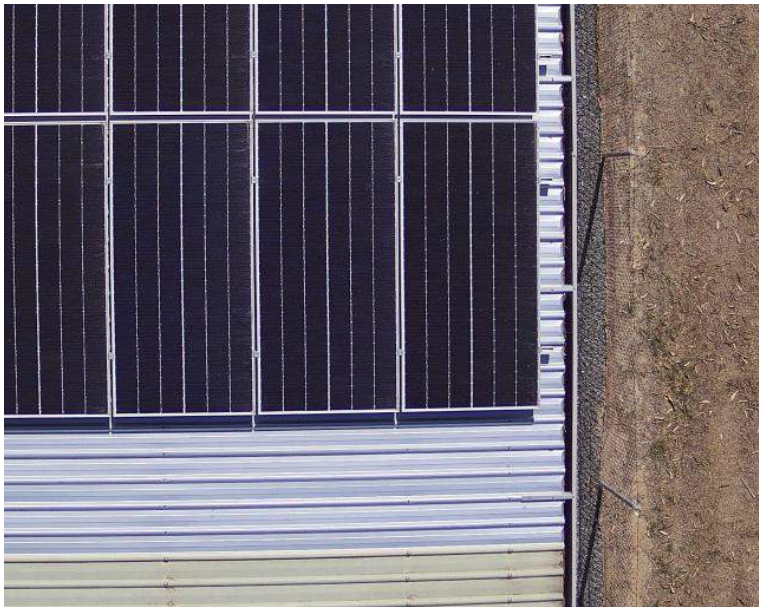
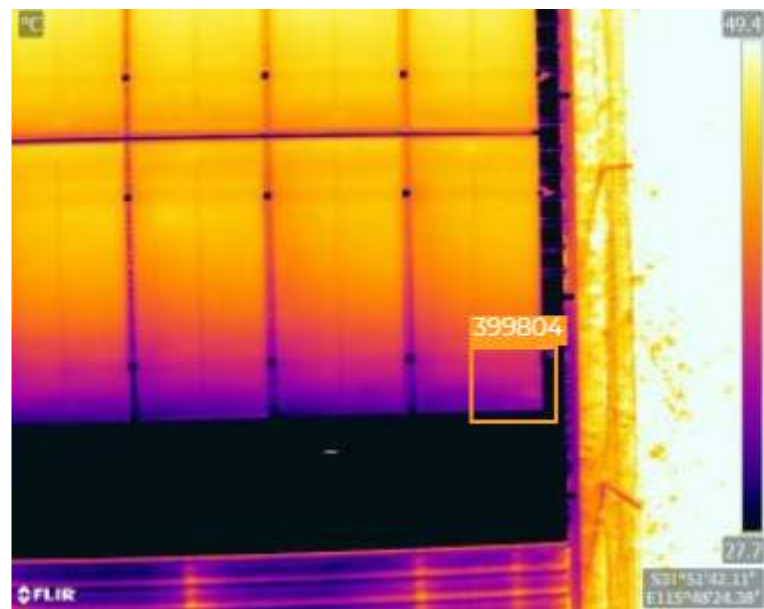


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403709

399804 Severity: 1 Single Cell

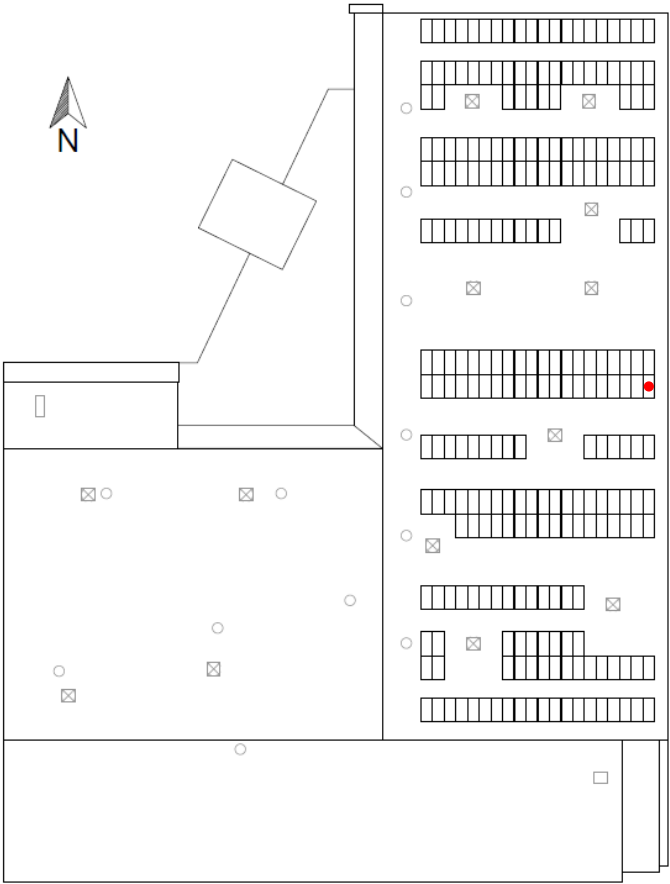


File name:	20190410_114430_078_R.JPG	Altitude:	32.8m
Date taken:	Apr 10, 2019 11:44:30 AM	Heading:	North (0°)
Position:	 -31.8617558, 115.8067915	User tags:	Thermal

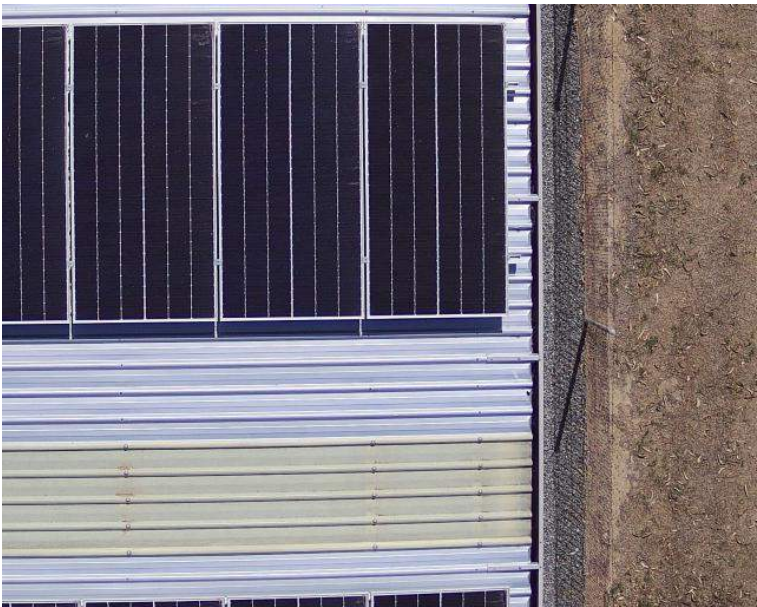
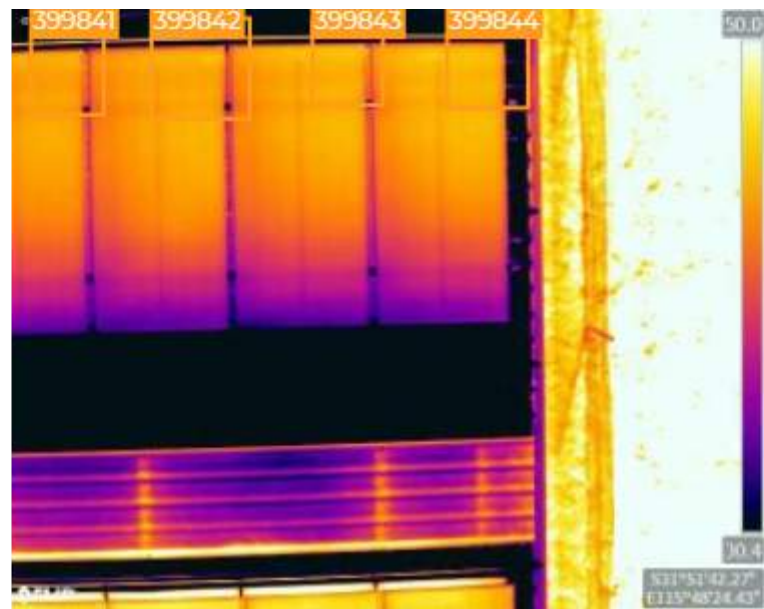


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403711

- | | | |
|--------|-------------|---------|
| 399841 | Severity: 1 | Soiling |
| 399842 | Severity: 1 | Soiling |
| 399843 | Severity: 1 | Soiling |
| 399844 | Severity: 1 | Soiling |

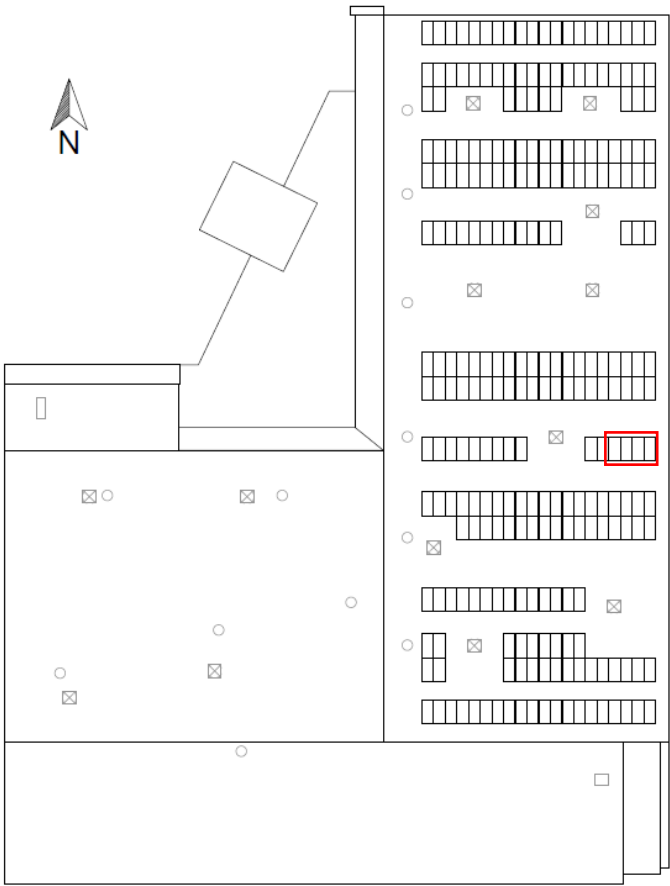


File name:	20190410_114448_357_R.JPG	Altitude:	32m
Date taken:	Apr 10, 2019 11:44:48 AM	Heading:	North (0°)
Position:	 -31.8617545, 115.8067556	User tags:	Thermal

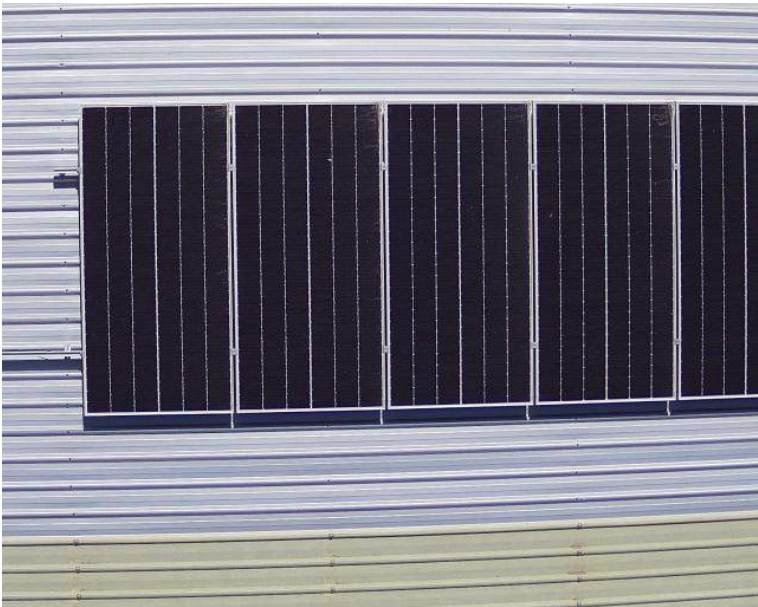
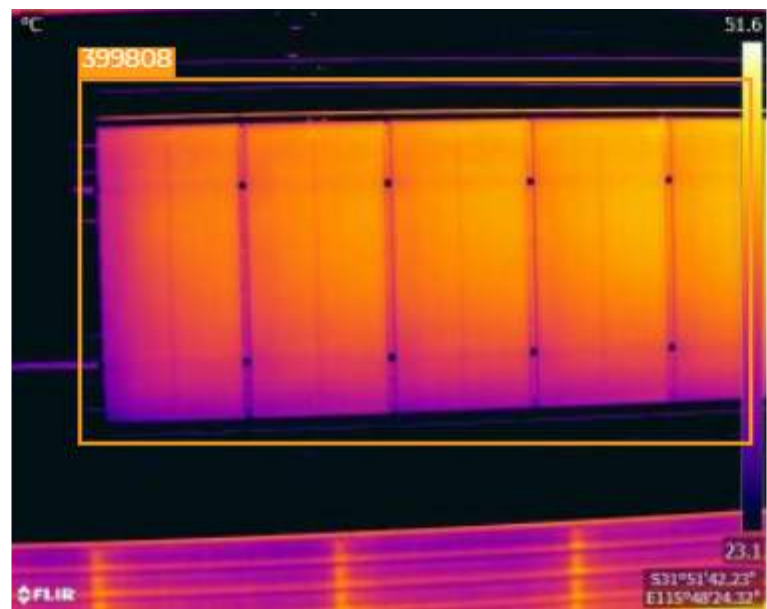


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403713

399808 Severity: 1 Soiling

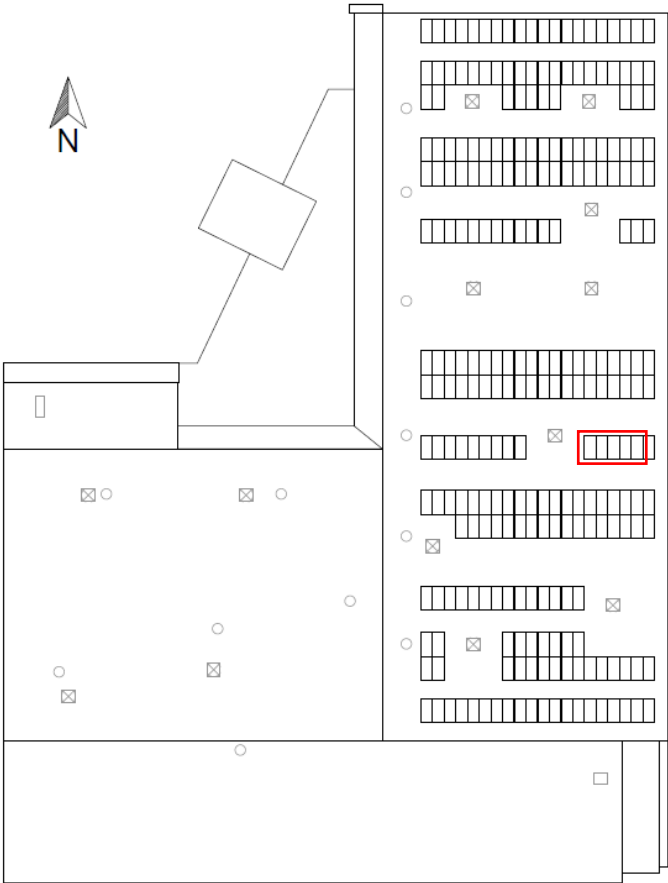


File name:	20190410_114457_968_R.JPG	Altitude:	30.6m
Date taken:	Apr 10, 2019 11:44:58 AM	Heading:	North (0°)
Position:	 -31.8617545, 115.8066843	User tags:	Thermal

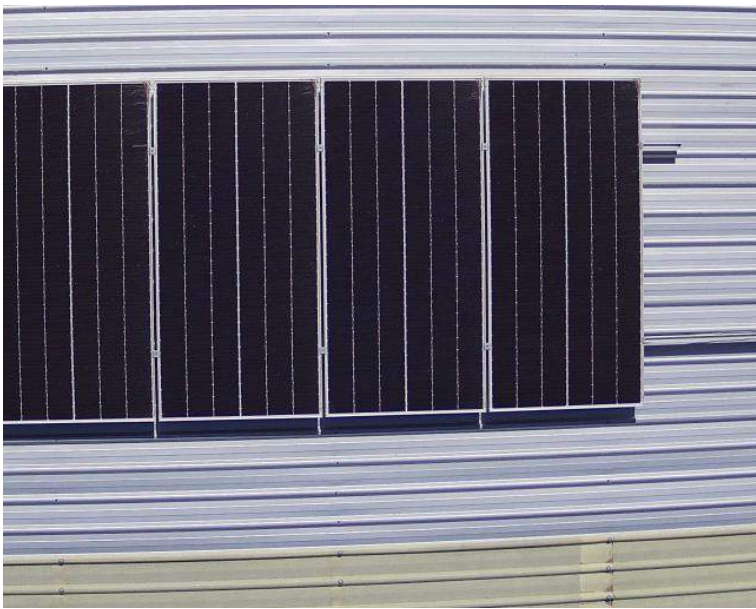
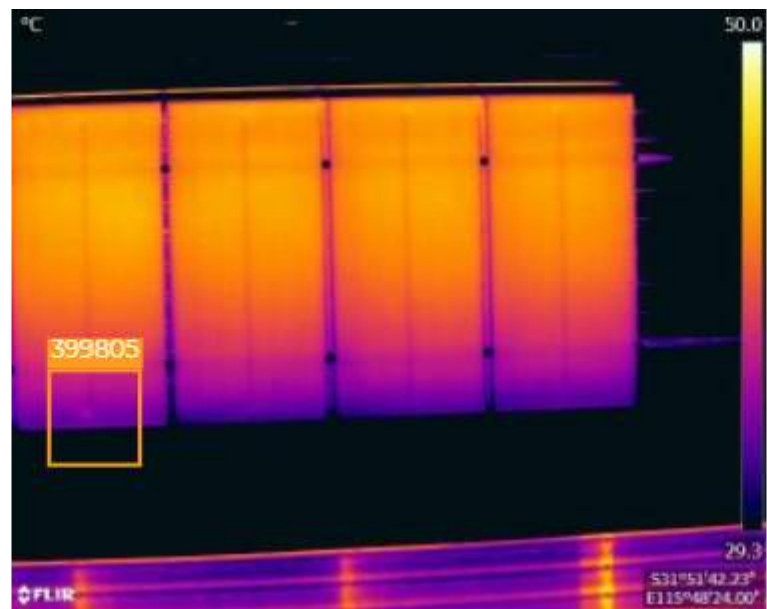


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403715

399805 Severity: 1 Junction box

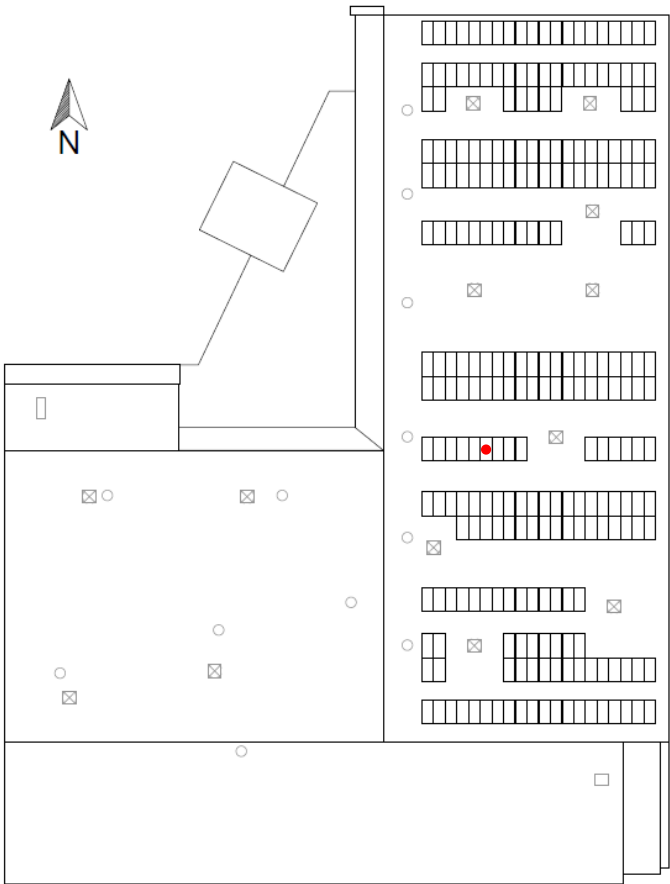


File name:	20190410_114519_658_R.JPG	Altitude:	31.9m
Date taken:	Apr 10, 2019 11:45:19 AM	Heading:	North (0°)
Position:	 -31.8617538, 115.8065998	User tags:	Thermal

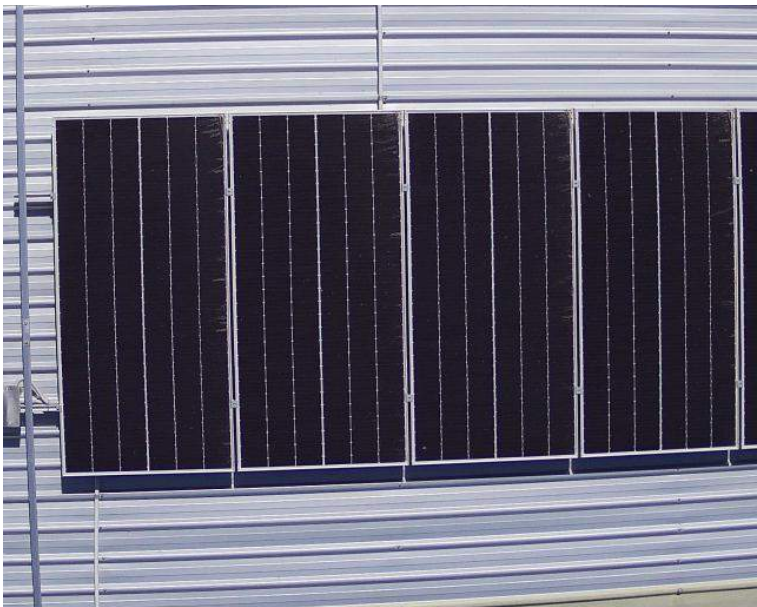
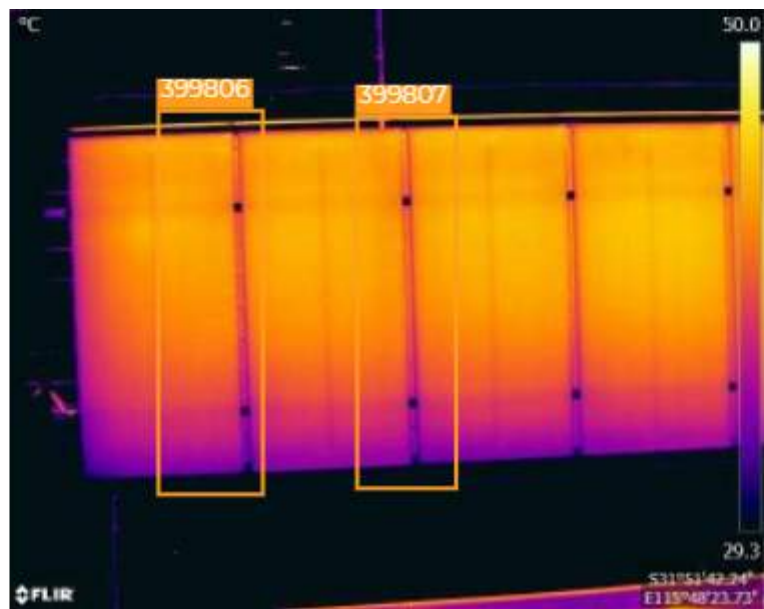


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403721

399806	Severity: 1	Soiling
399807	Severity: 1	Soiling

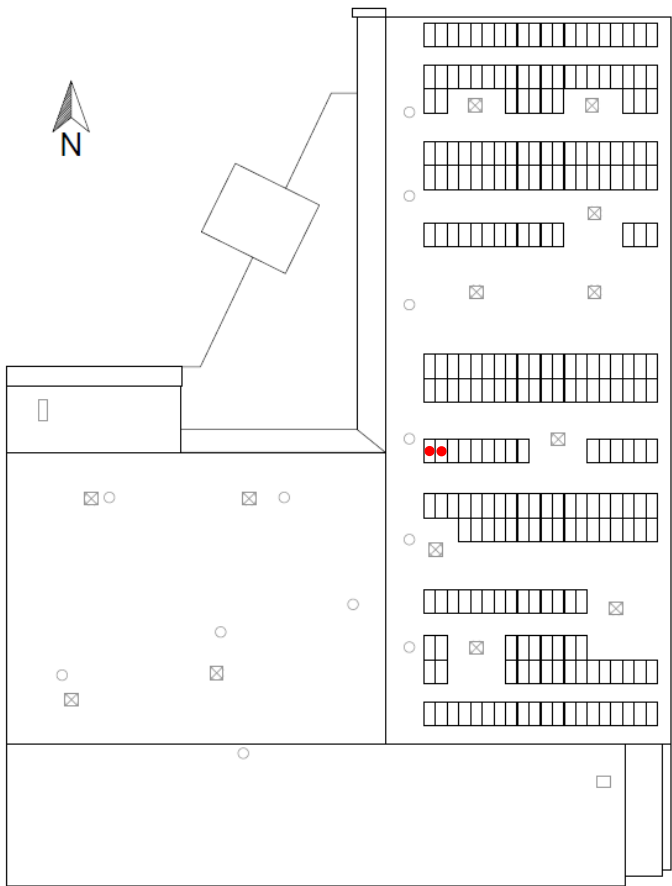


File name:	20190410_114528_767_R.JPG	Altitude:	32.9m
Date taken:	Apr 10, 2019 11:45:28 AM	Heading:	North (0°)
Position:	 -31.8617900, 115.8066078	User tags:	Thermal

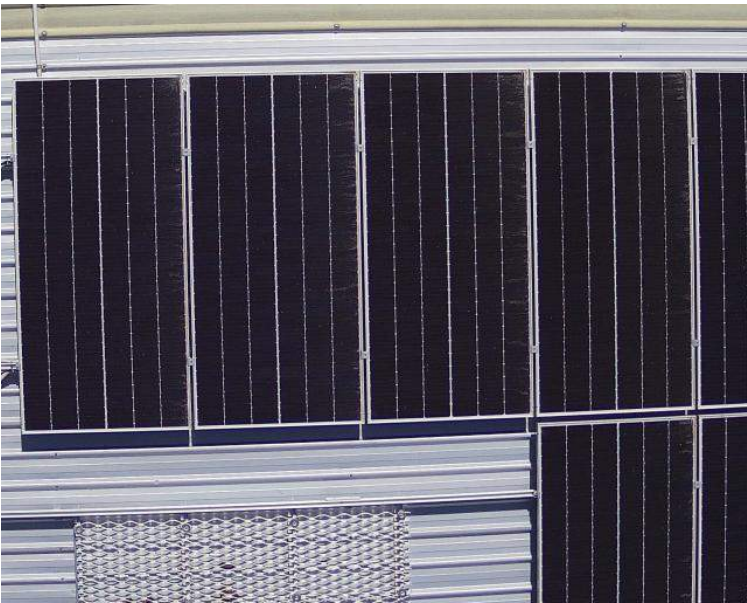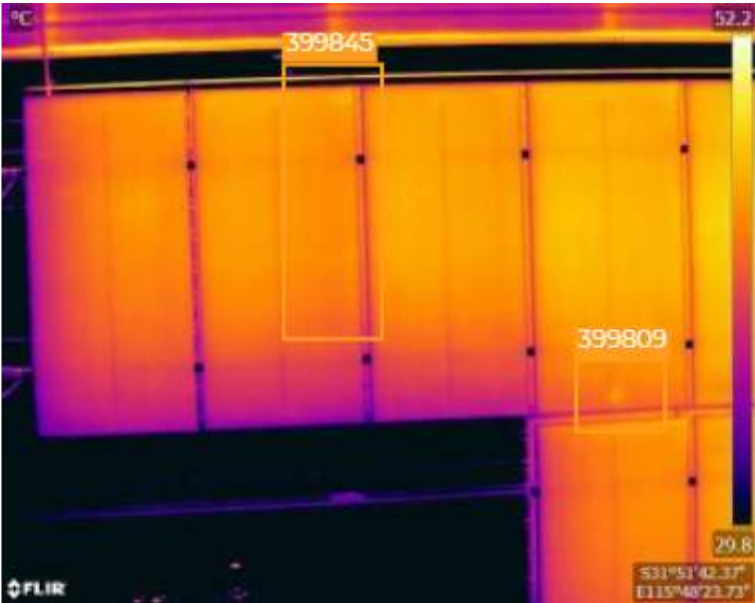

For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403723

- 399809Severity: 1Junction box
- 399845Severity: 1Soiling

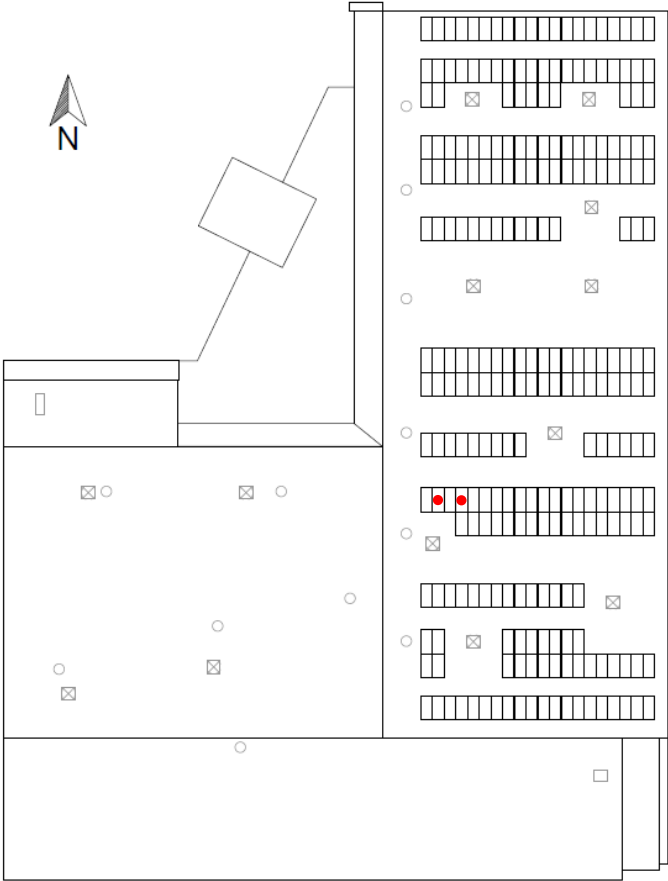

File name: 20190410_114534_972_R.JPG



Altitude: 32.8m

Date taken: Apr 10, 2019 11:45:35 AM

Heading: North (0°)

Position:  -31.8617900, 115.8066588


User tags: Thermal

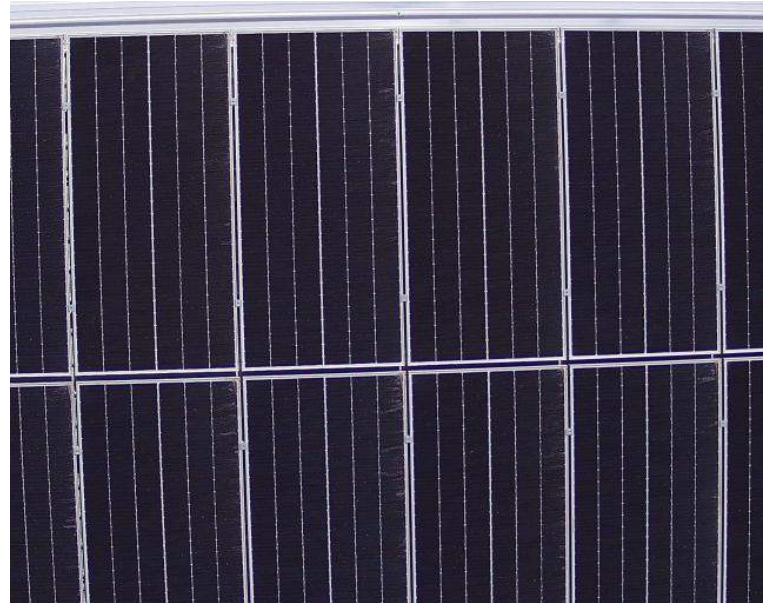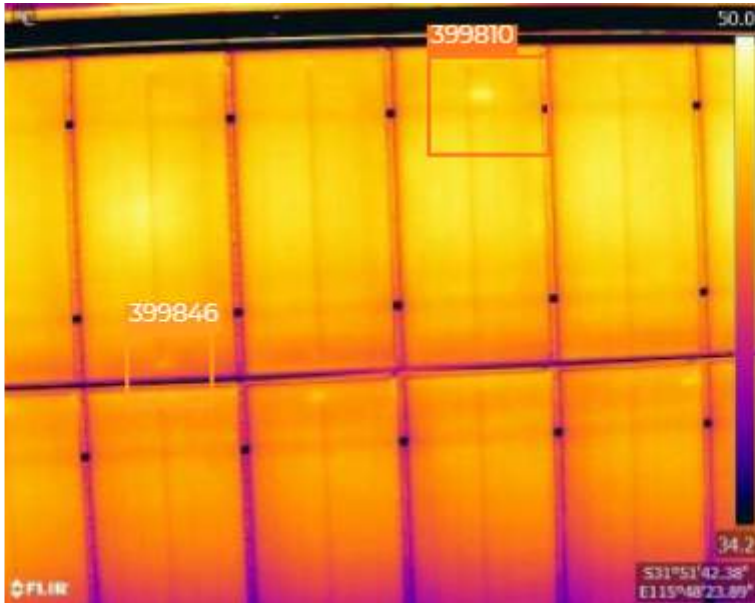



For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403727

399810 Severity: 2 Single Cell

399846 Severity: 1 Junction box

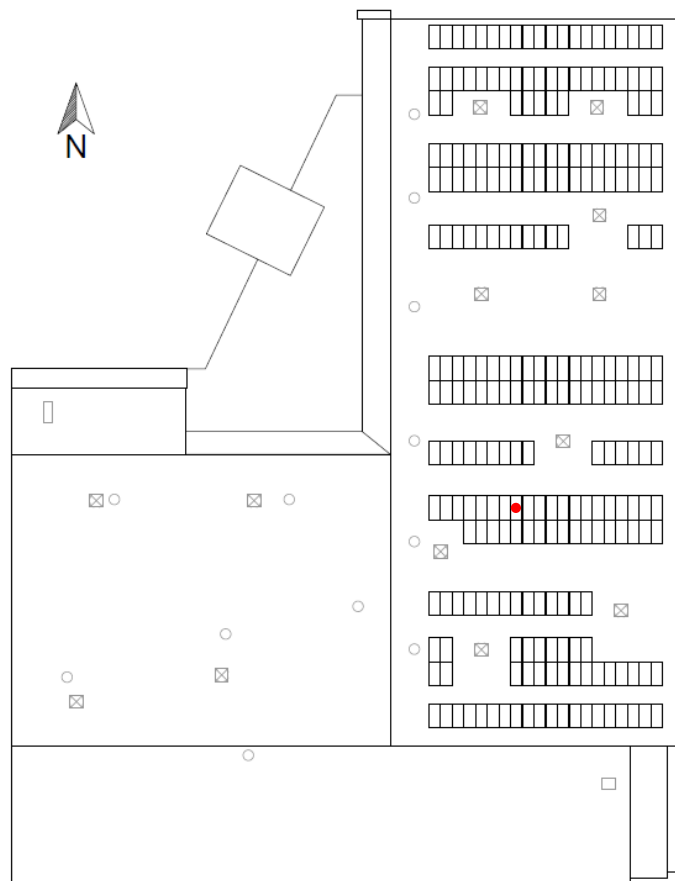


File name:	20190410_114539_878_R.JPG	Altitude:	32.6m
Date taken:	Apr 10, 2019 11:45:39 AM	Heading:	North (0°)
Position:	 -31.8617922, 115.8066945	User tags:	Thermal

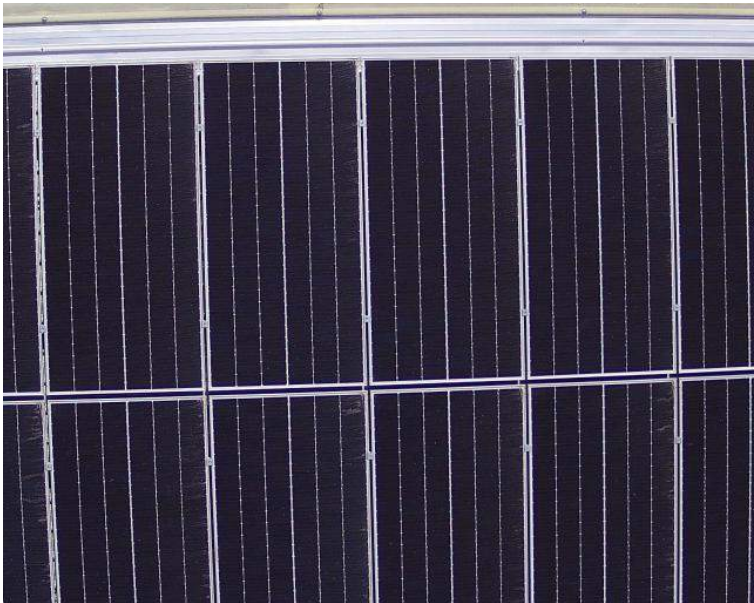
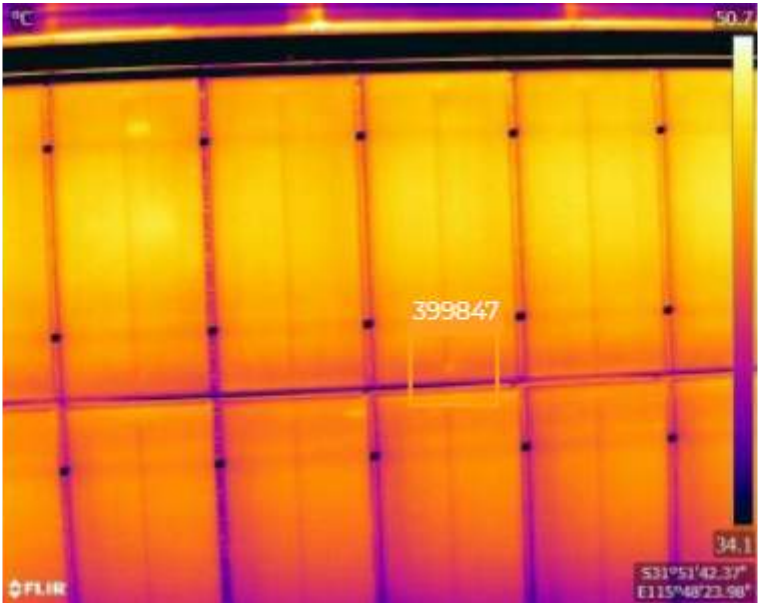


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403729

399847 Severity: 1 Junction box

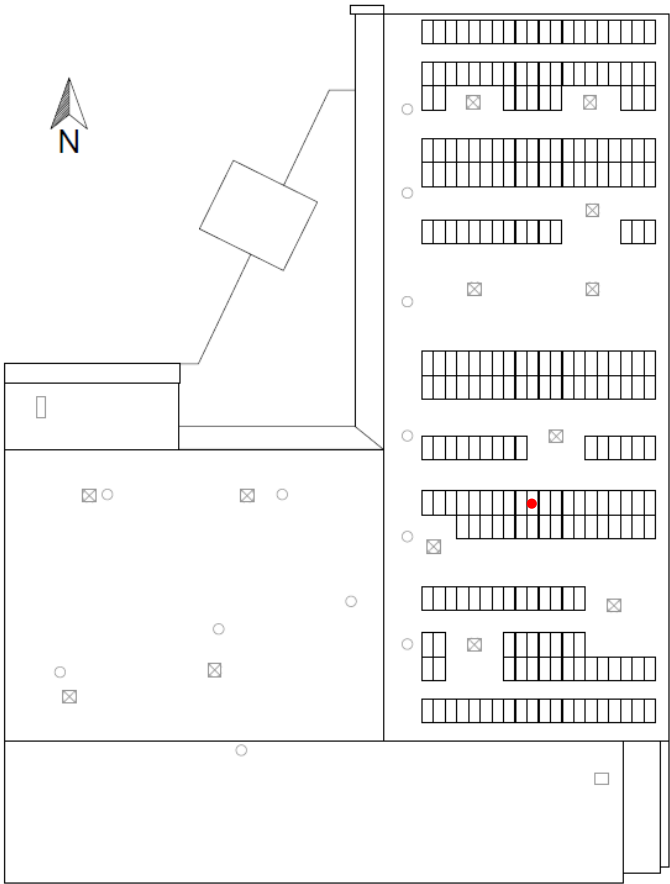


File name:	20190410_114542_678_R.JPG	Altitude:	32.8m
Date taken:	Apr 10, 2019 11:45:42 AM	Heading:	North (0°)
Position:	 -31.8617916, 115.8067314	User tags:	Thermal

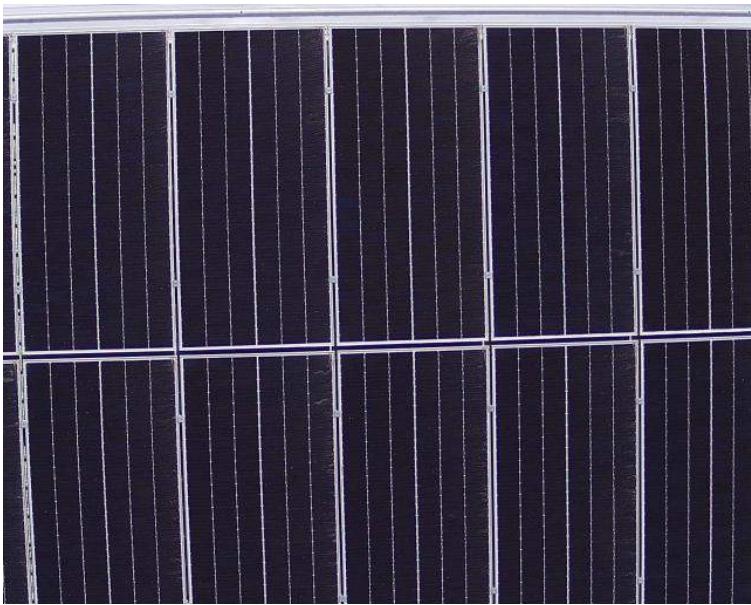
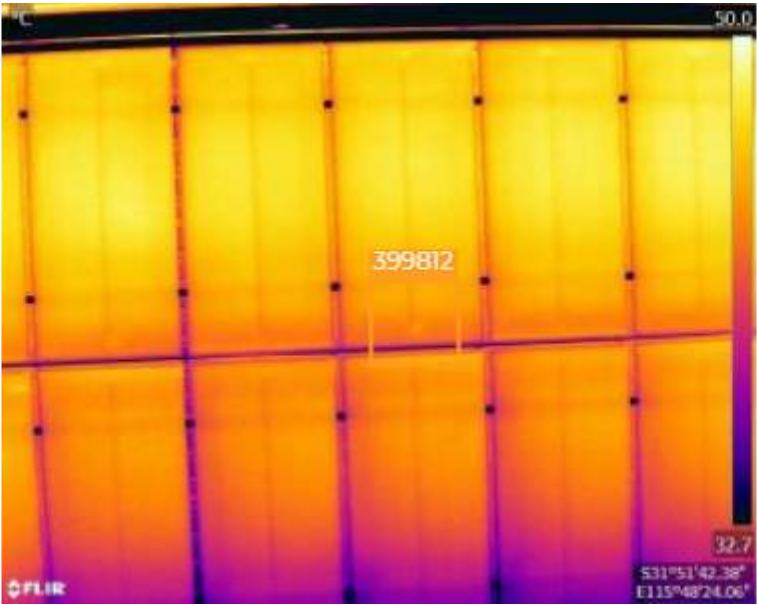


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403731

399812 Severity: 1 Junction box

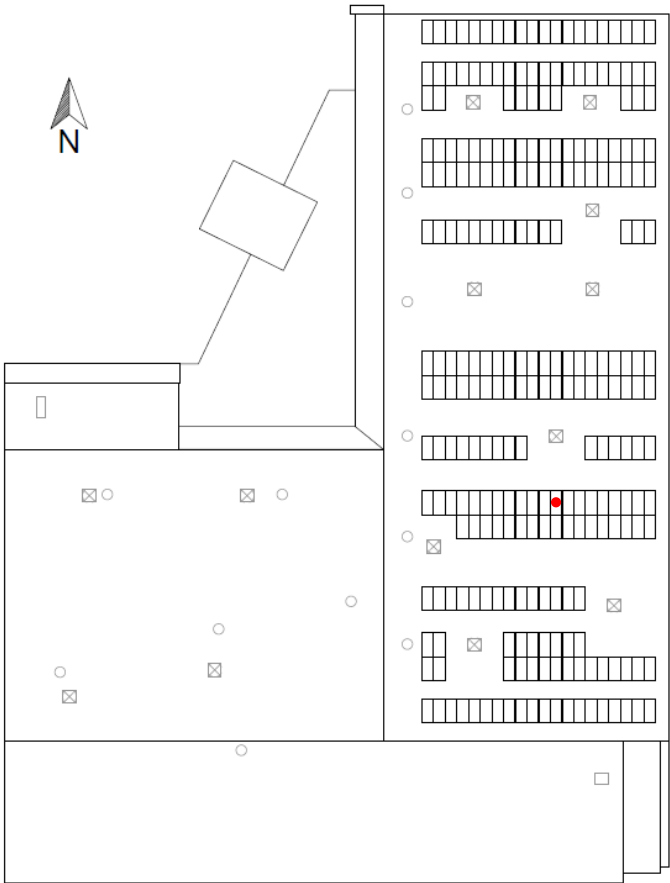


File name:	20190410_114548_787_R.JPG	Altitude:	32.4m
Date taken:	Apr 10, 2019 11:45:48 AM	Heading:	North (0°)
Position:	 -31.8617934, 115.8067650	User tags:	Thermal

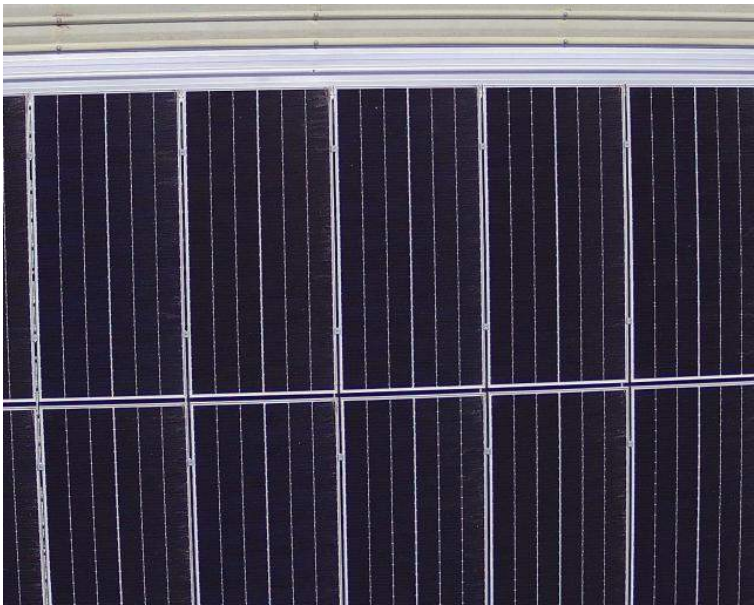
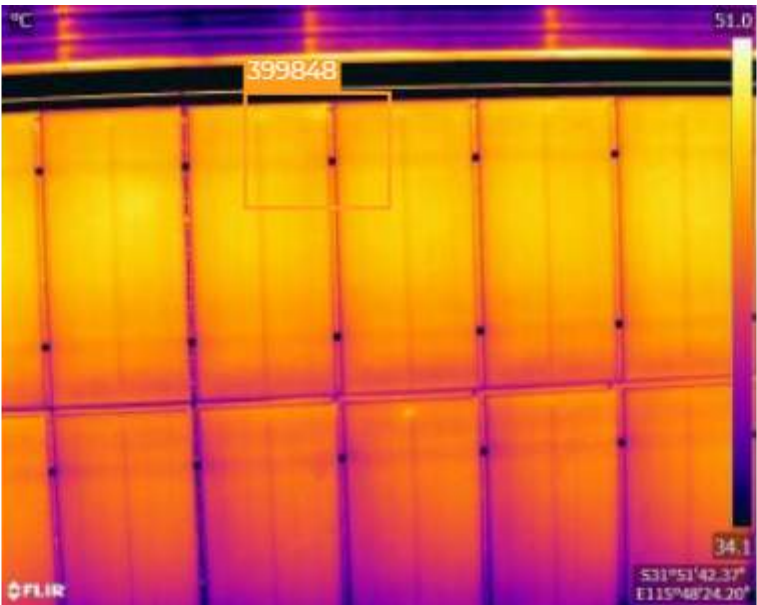


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403733

399848 Severity: 1 Soiling

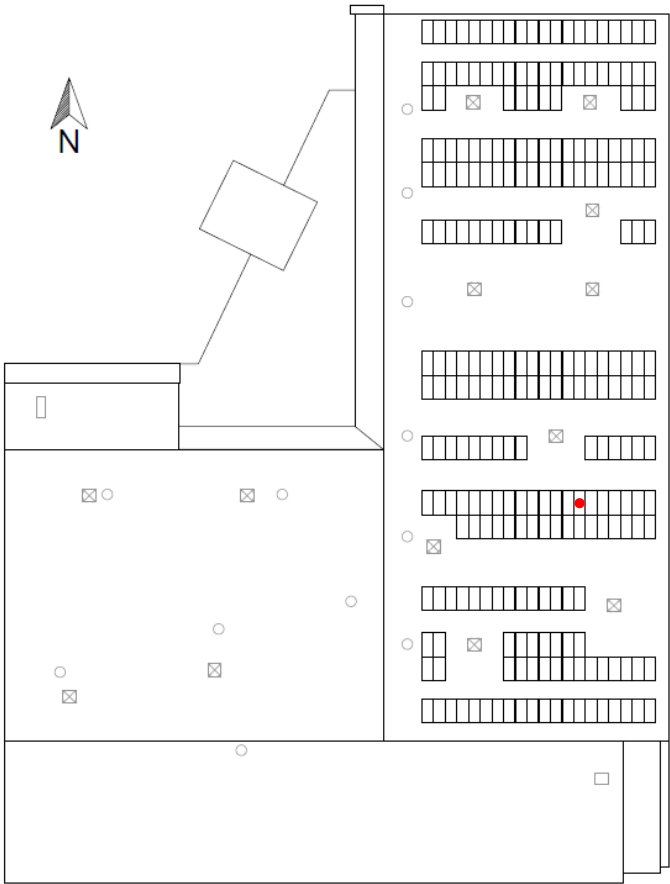


File name:	20190410_114552_158_R.JPG	Altitude:	32.6m
Date taken:	Apr 10, 2019 11:45:52 AM	Heading:	North (0°)
Position:	 -31.8617916, 115.8067955	User tags:	Thermal

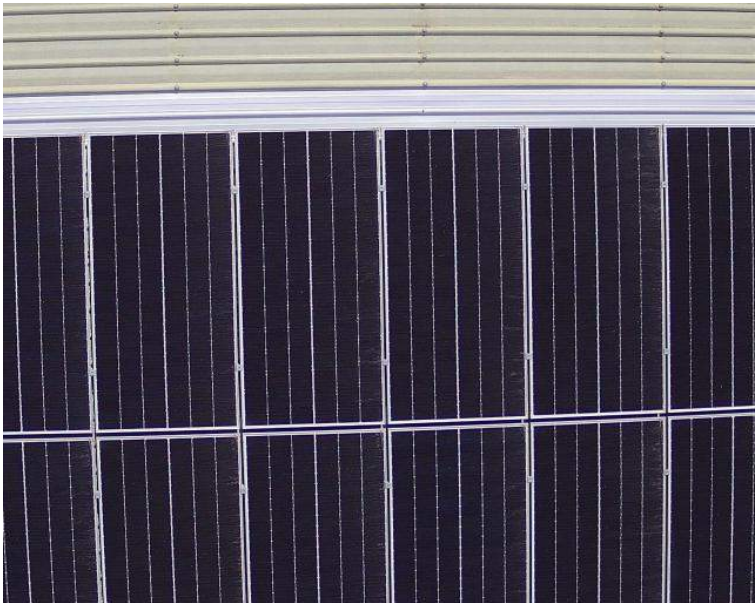
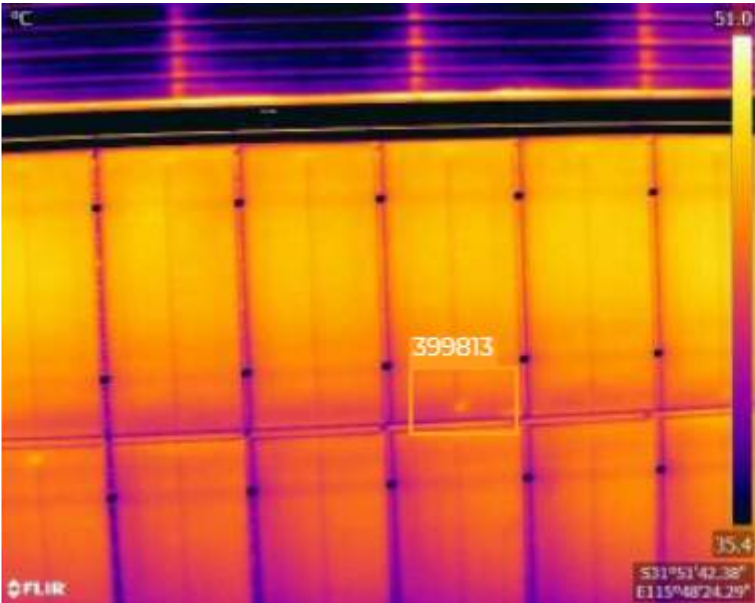


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403735

399813 Severity: 1 Junction box

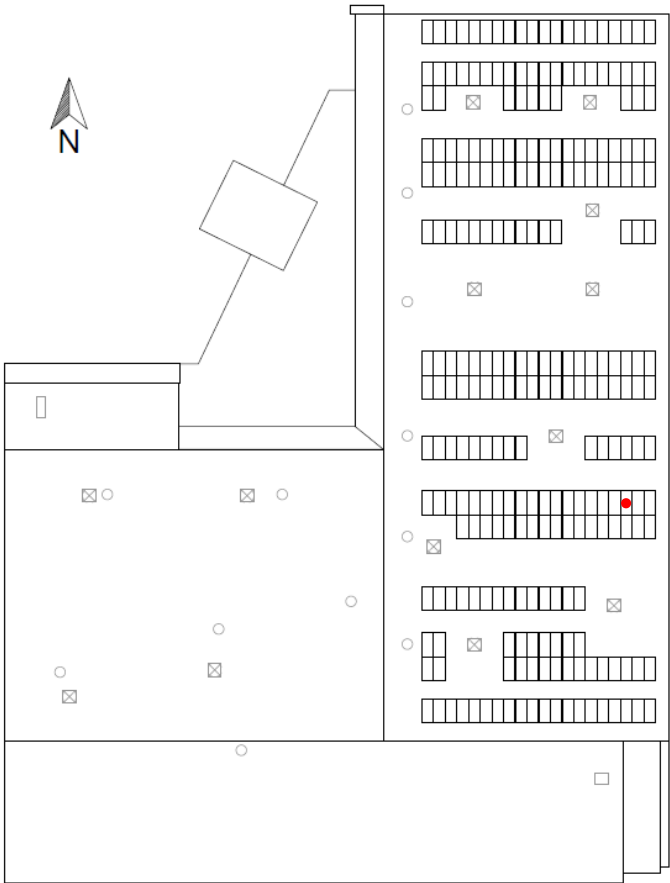


File name:	20190410_114606_870_R.JPG	Altitude:	31.8m
Date taken:	Apr 10, 2019 11:46:06 AM	Heading:	North (0°)
Position:	 -31.8618065, 115.8067301	User tags:	Thermal

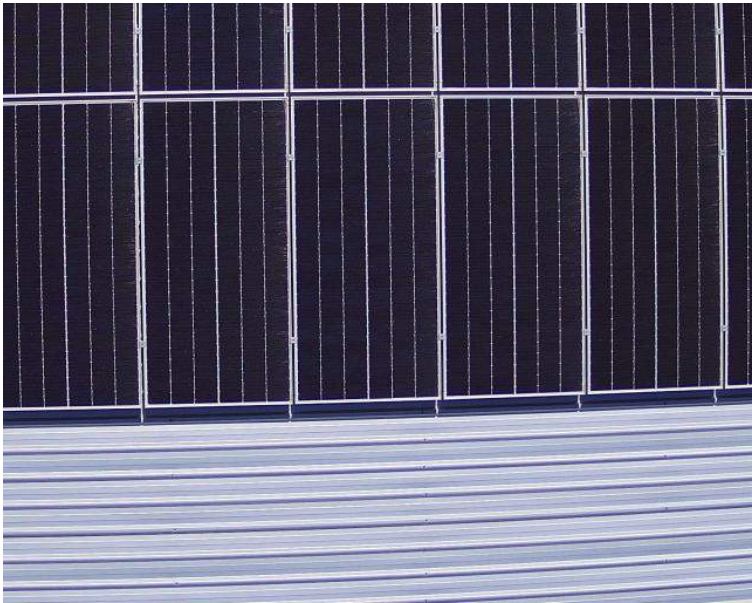
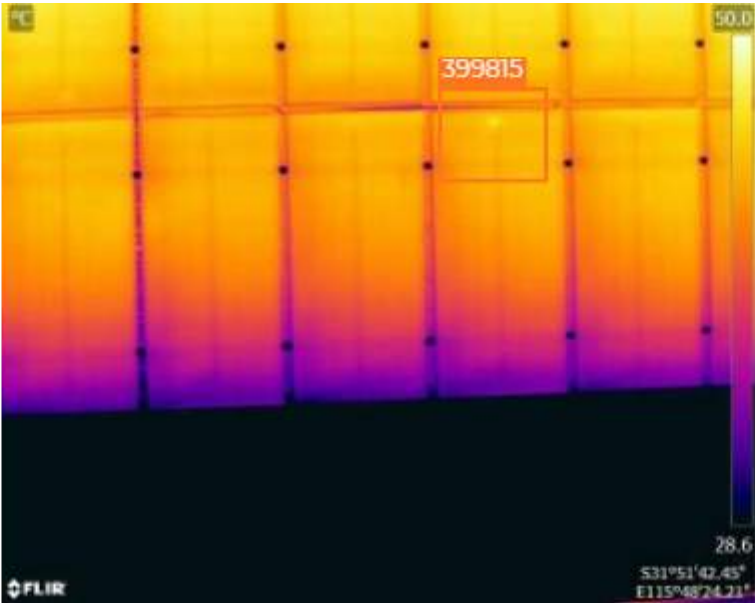


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403741

399815 Severity: 2 Junction box

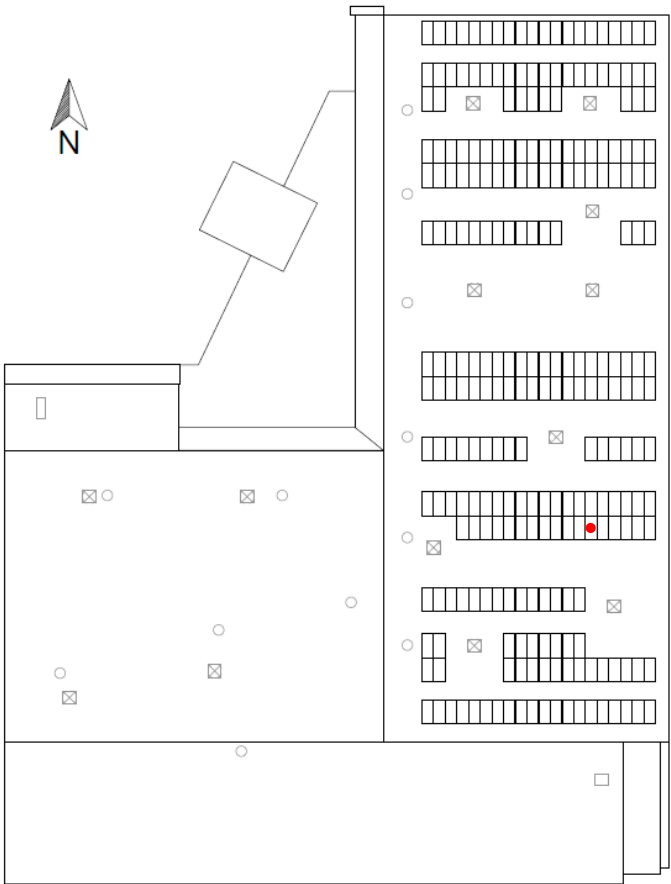


File name:	20190410_114618_482_R.JPG	Altitude:	30.8m
Date taken:	Apr 10, 2019 11:46:18 AM	Heading:	North (0°)
Position:	 -31.8618053, 115.8066596	User tags:	Thermal

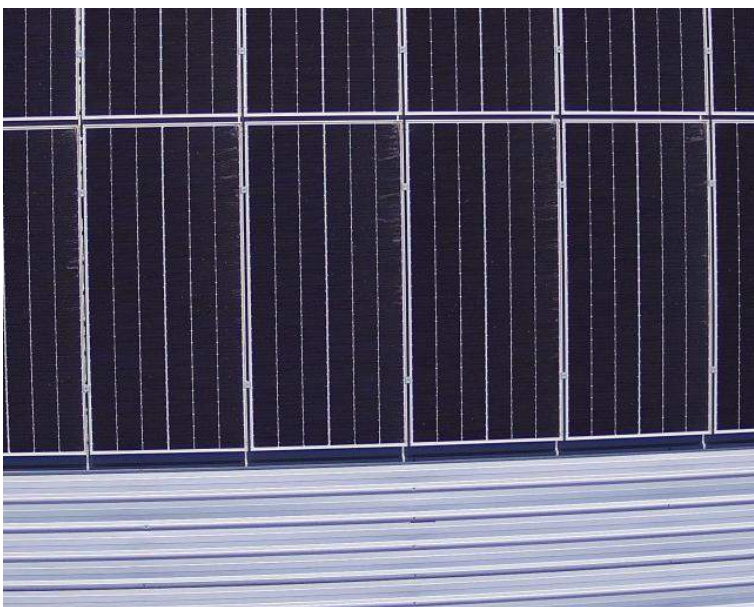
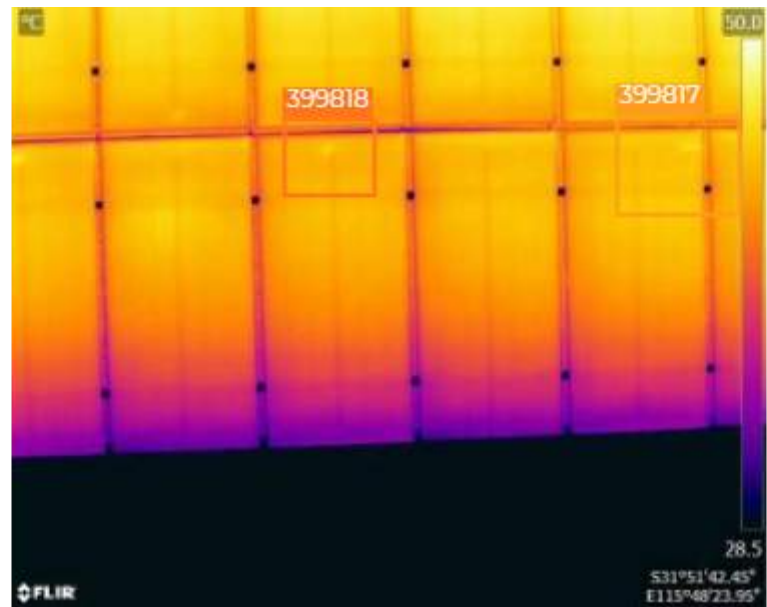


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403745

- 399817Severity: 1Soiling
- 399818Severity: 2Junction box

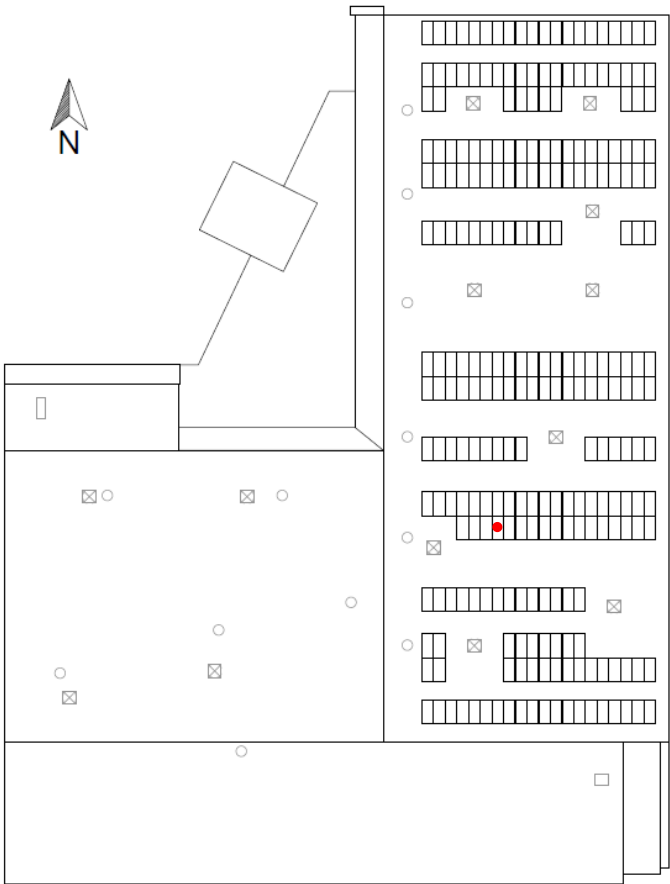


File name:	20190410_114622_087_R.JPG	Altitude:	31.1m
Date taken:	Apr 10, 2019 11:46:22 AM	Heading:	North (0°)
Position:	 -31.8618048, 115.8066266	User tags:	Thermal

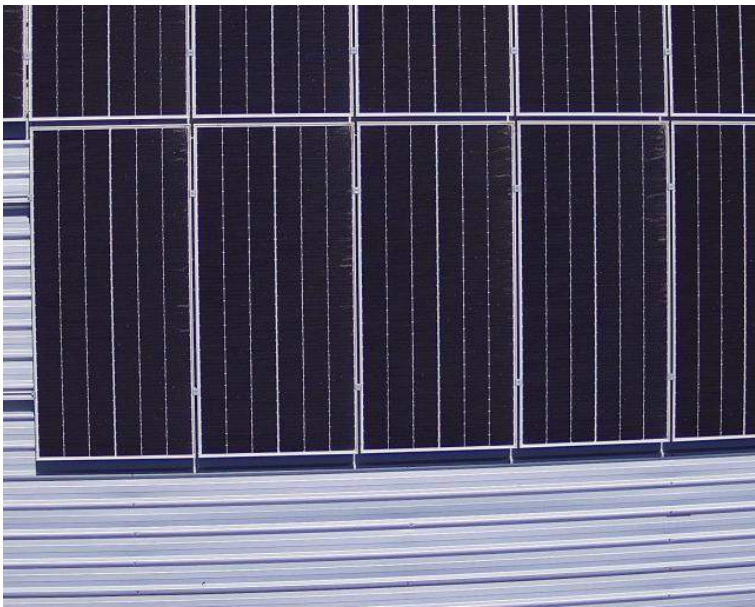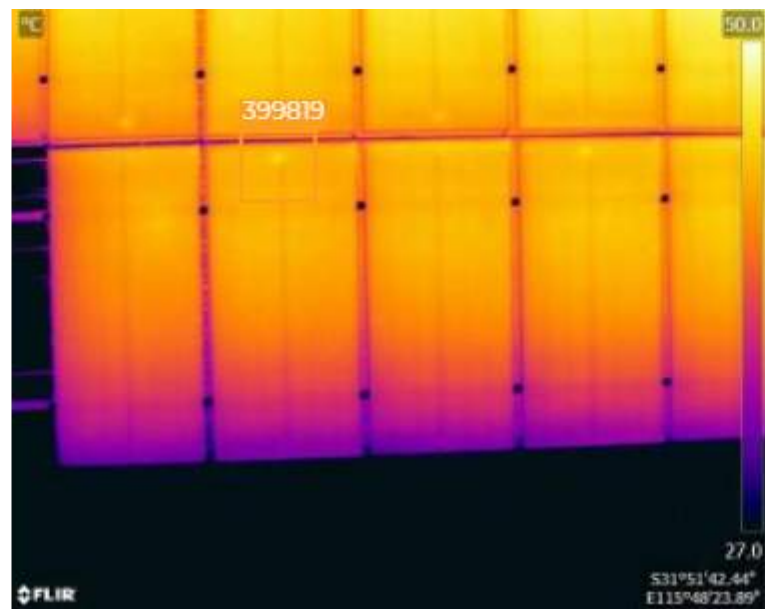



For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403747

399819 Severity: 1 Junction box

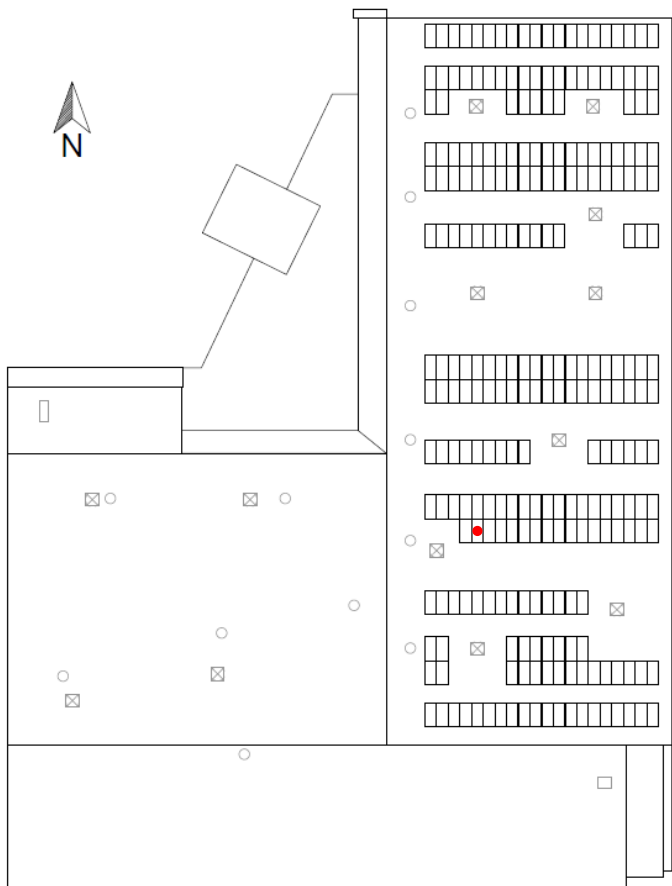


File name: 20190410_114643_278_R.JPG
Date taken: Apr 10, 2019 11:46:43 AM
Position:  -31.8618613, 115.8066105

Altitude: 33.3m
Heading: North (0°)
User tags: Thermal

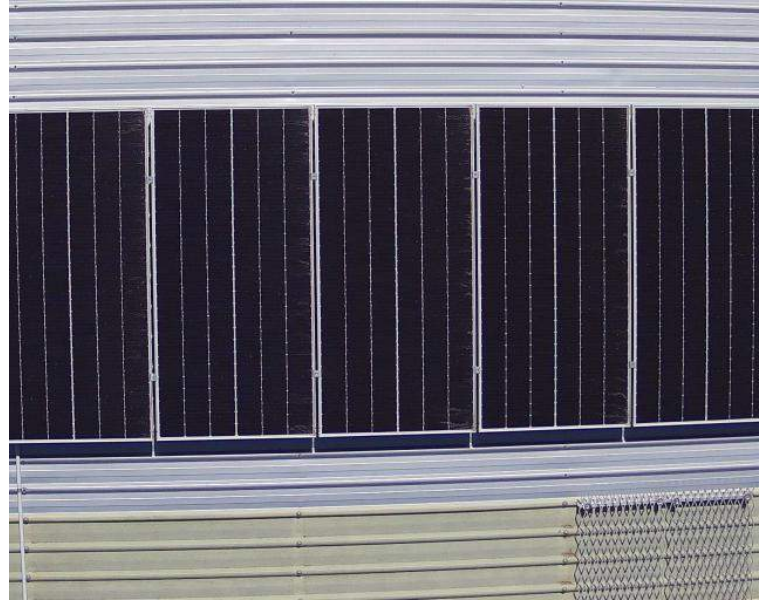
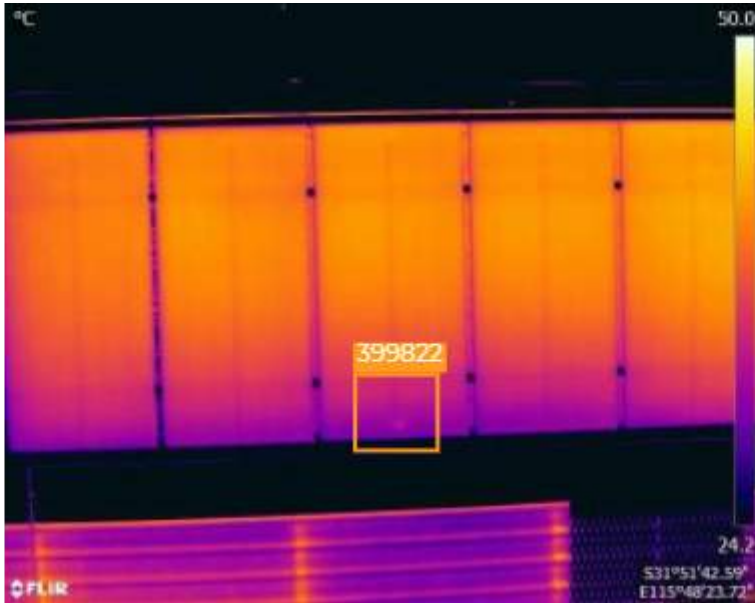


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403758

399822 Severity: 1 Junction box

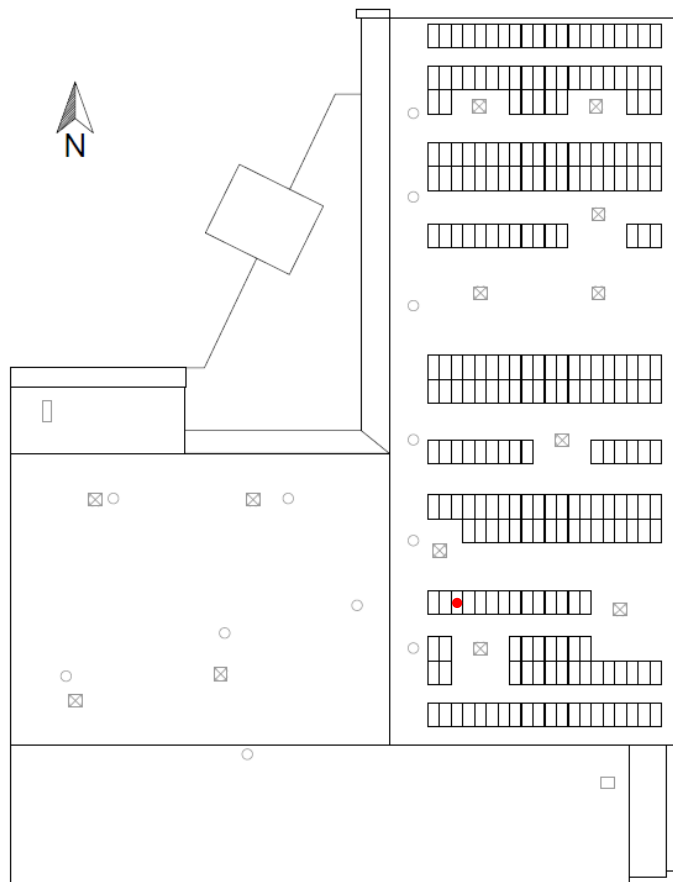


File name:	20190410_114651_880_R.JPG	Altitude:	33.7m
Date taken:	Apr 10, 2019 11:46:51 AM	Heading:	North (0°)
Position:	 -31.8618619, 115.8066770	User tags:	Thermal

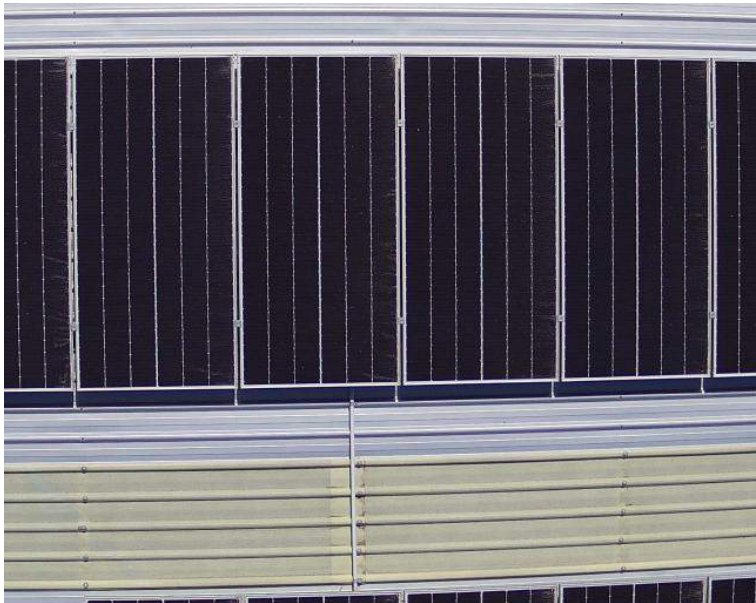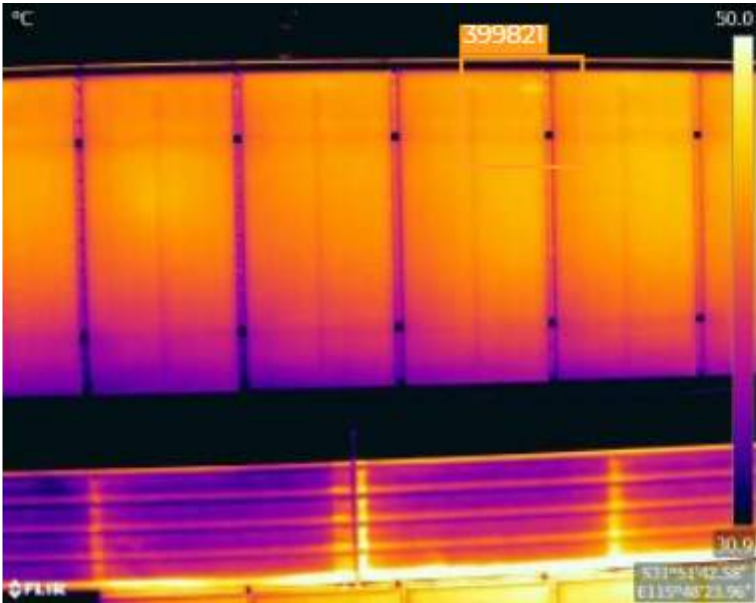



For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403780

399821 Severity: 1 Soiling

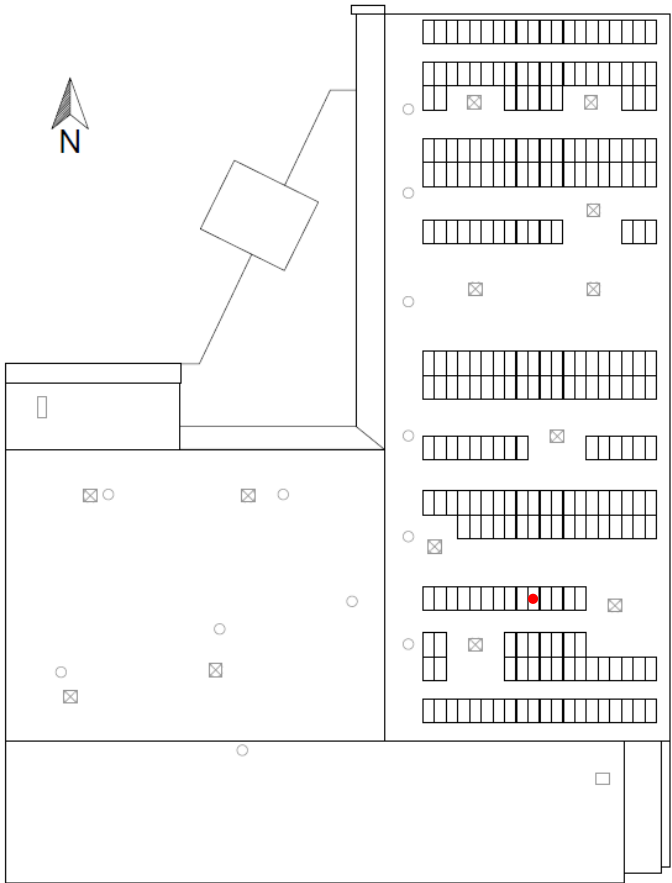


File name: 20190410_114655_288_R.JPG
Date taken: Apr 10, 2019 11:46:55 AM
Position:  -31.8618619, 115.8067280

Altitude: 33.3m
Heading: North (0°)
User tags: Thermal

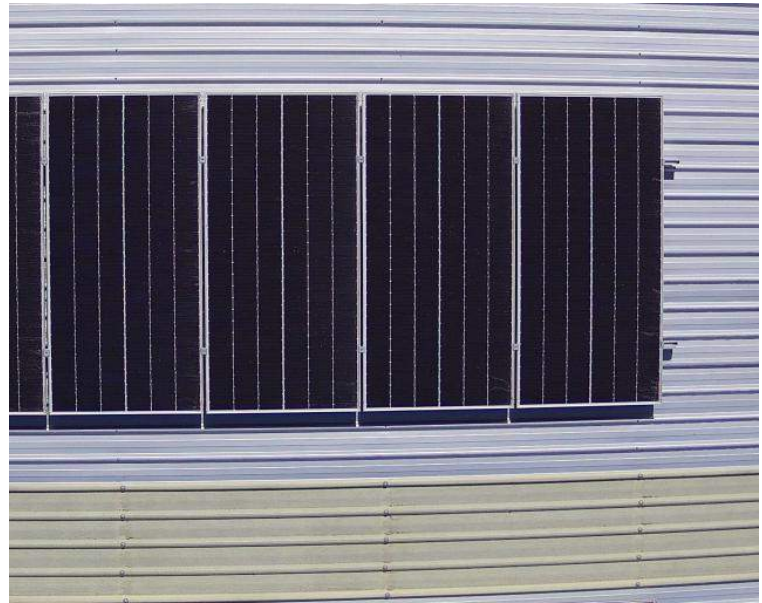
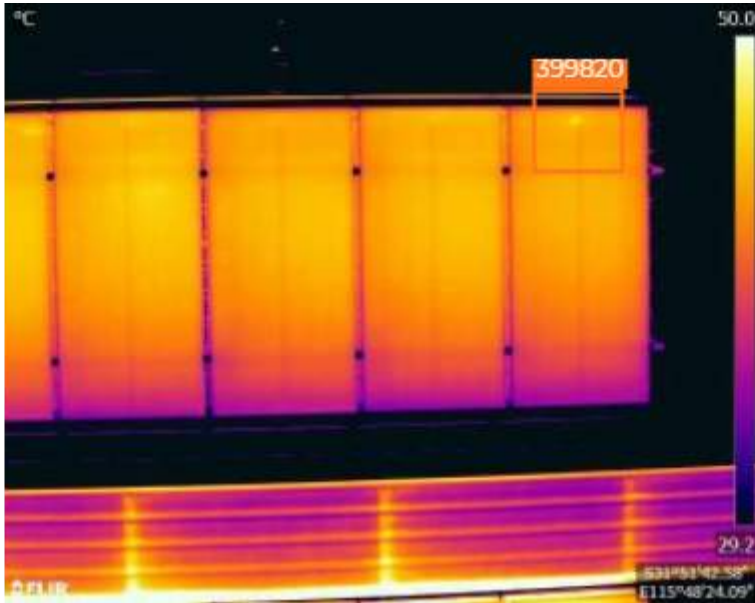


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403792

399820 Severity: 2 Junction box

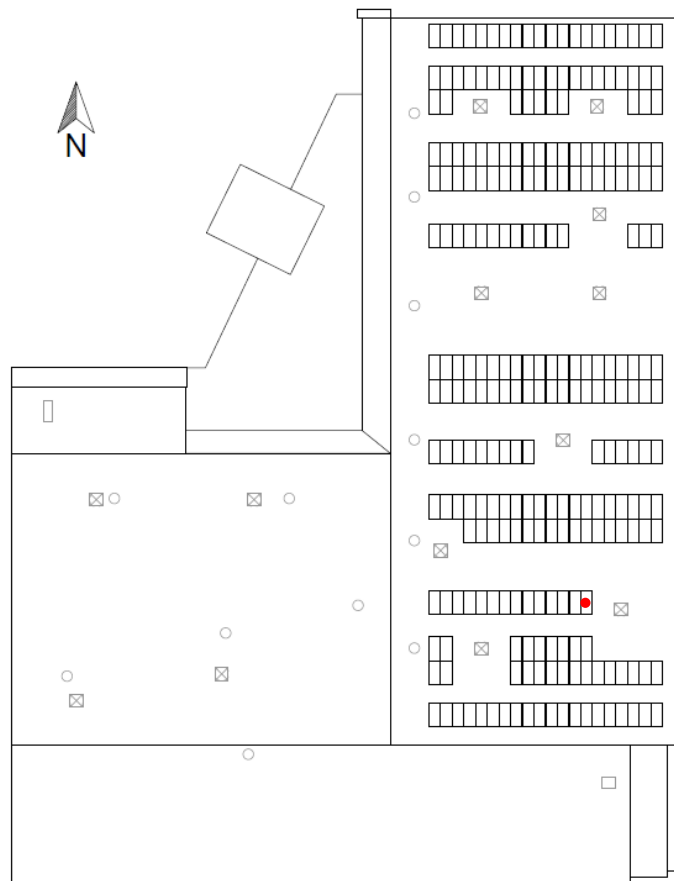


File name:	20190410_114712_568_R.JPG	Altitude:	33.1m
Date taken:	Apr 10, 2019 11:47:12 AM	Heading:	North (0°)
Position:	 -31.8618883, 115.8066762	User tags:	Thermal

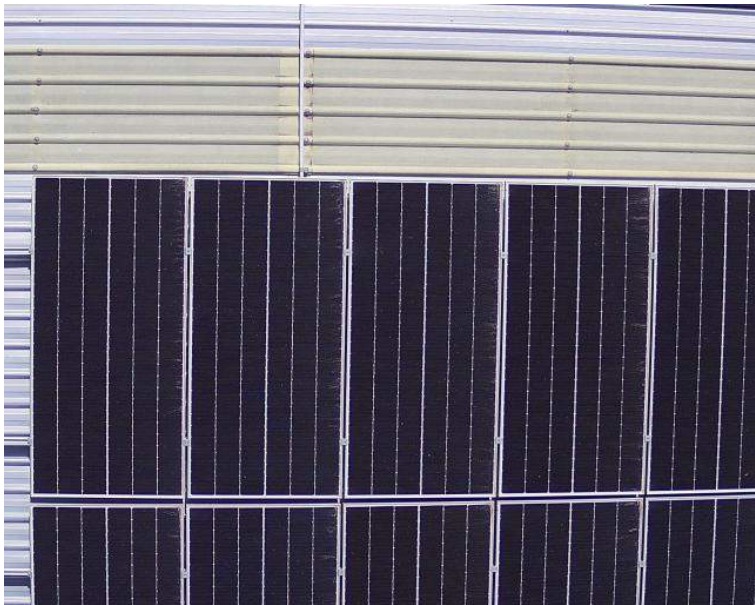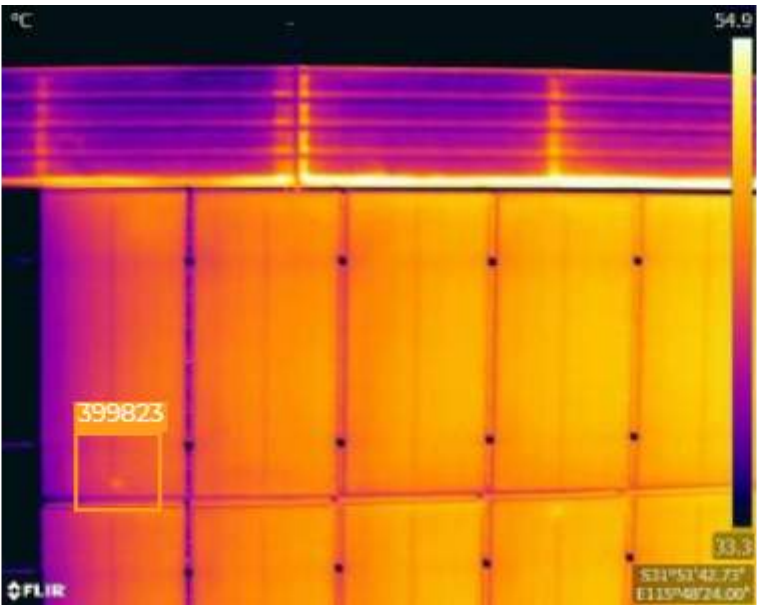


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403810

399823 Severity: 1 Junction box

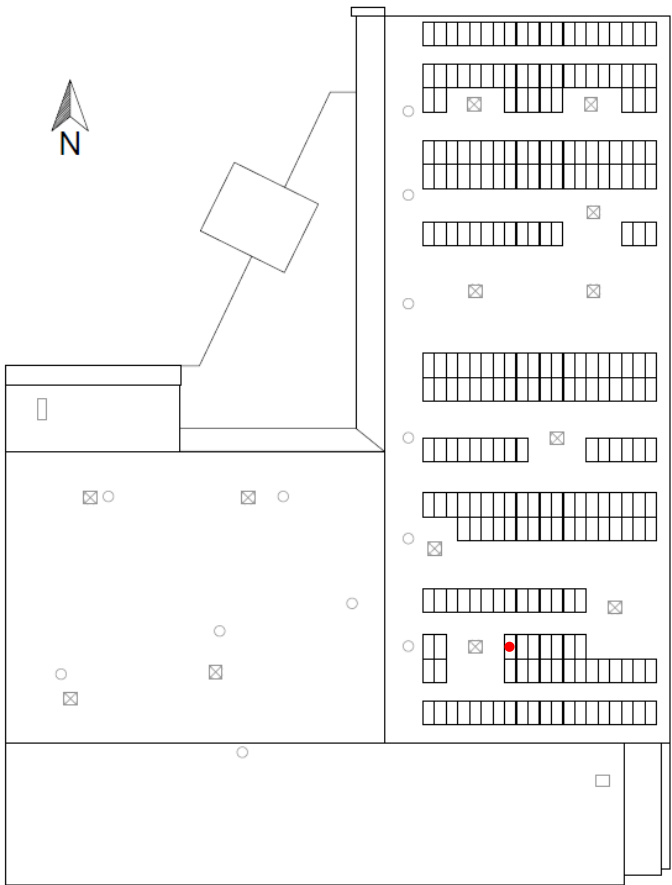


File name:	20190410_114800_588_R.JPG	Altitude:	34.4m
Date taken:	Apr 10, 2019 11:48:00 AM	Heading:	North (0°)
Position:	 -31.8619042, 115.8067119	User tags:	Thermal


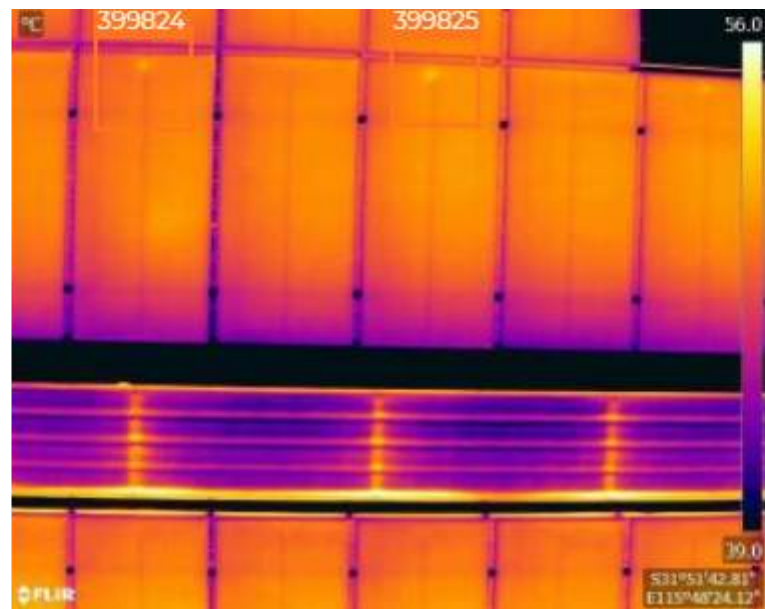


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403814

- 399824Severity: 2Junction box
- 399825Severity: 2Junction box

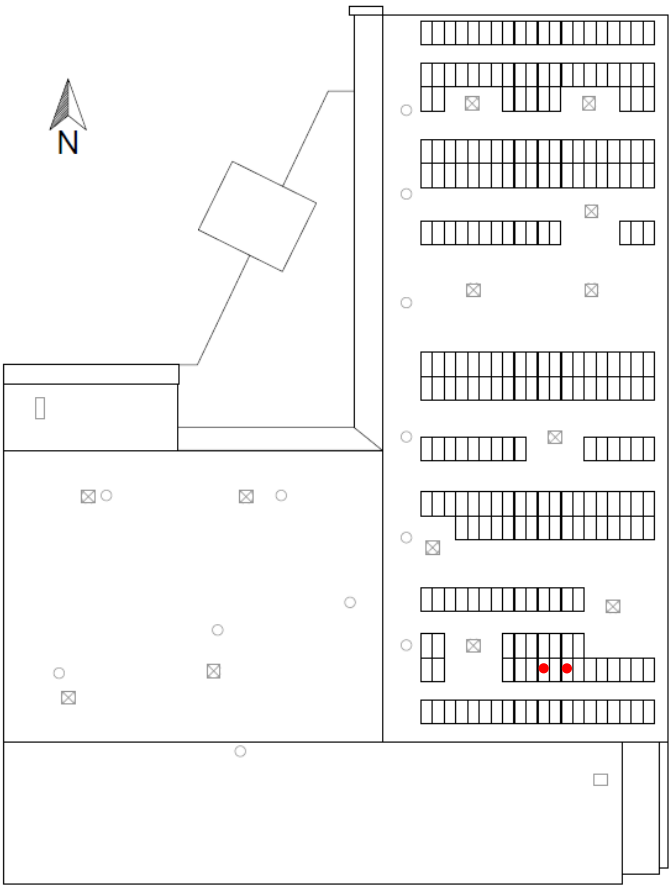


File name:	20190410_114803_388_R.JPG	Altitude:	34.5m
Date taken:	Apr 10, 2019 11:48:03 AM	Heading:	North (0°)
Position:	 -31.8619042, 115.8067462	User tags:	Thermal

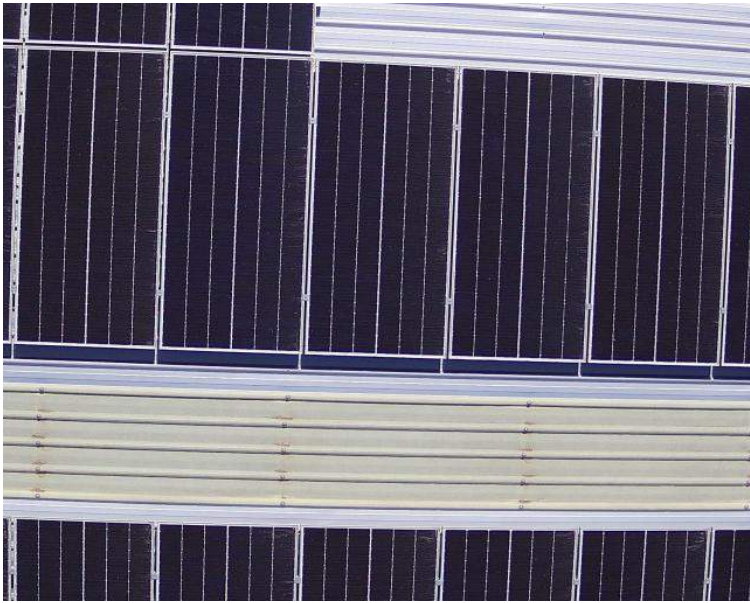
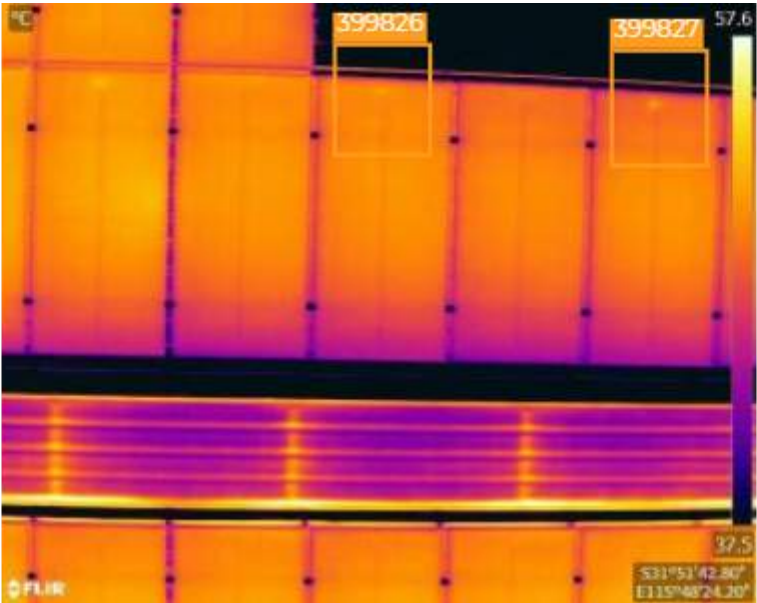


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403816

- 399826Severity: 1Junction box
- 399827Severity: 1Junction box

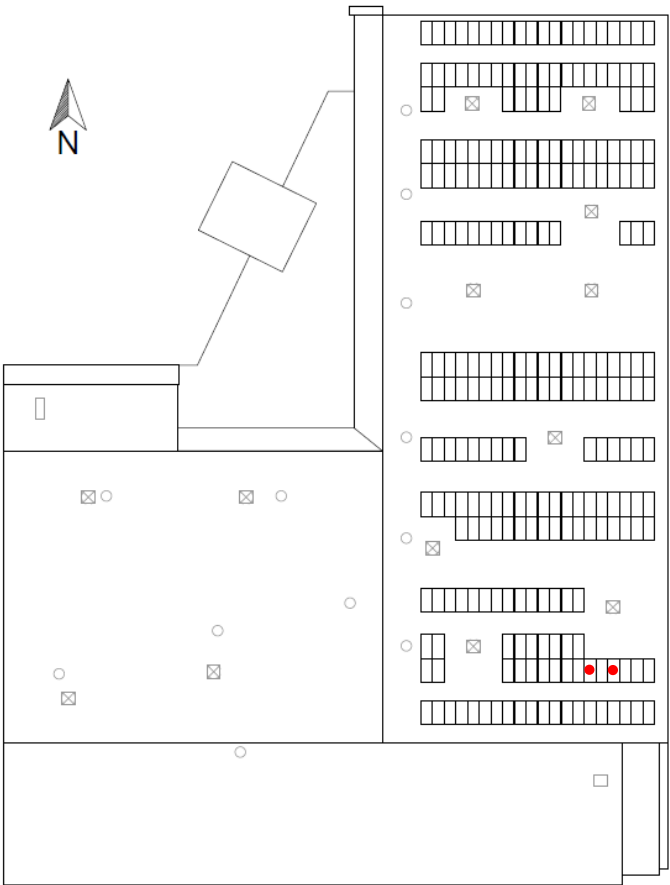


File name:	20190410_114806_857_R.JPG	Altitude:	34m
Date taken:	Apr 10, 2019 11:48:06 AM	Heading:	North (0°)
Position:	 -31.8619019, 115.8067842	User tags:	Thermal

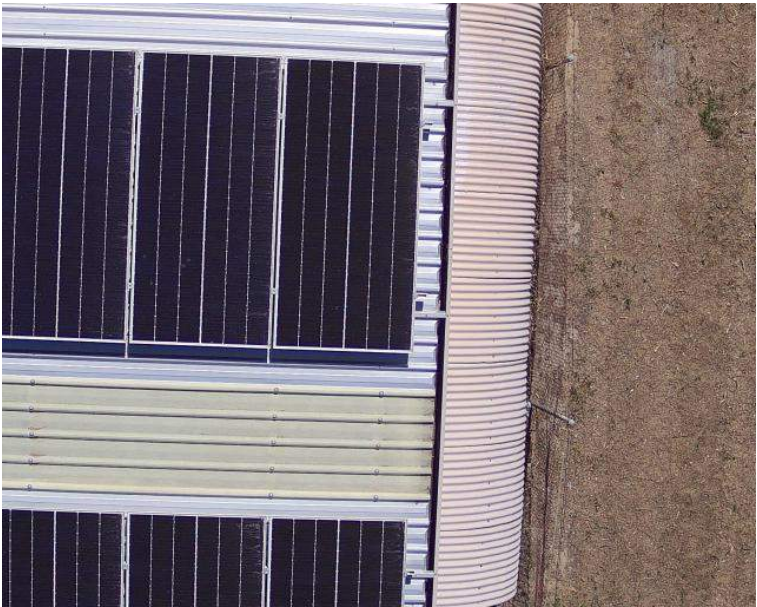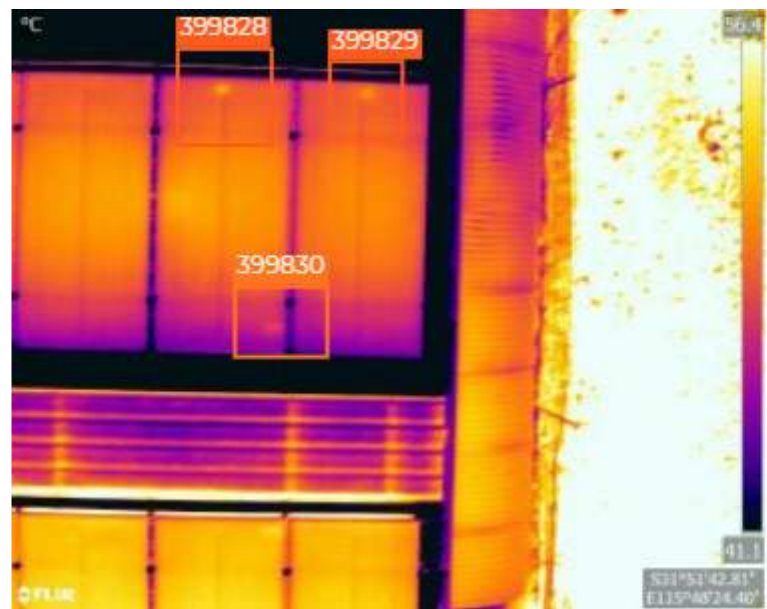

For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403818

- 399828 Severity: 3 Junction box
- 399829 Severity: 3 Junction box
- 399830 Severity: 2 Single Cell

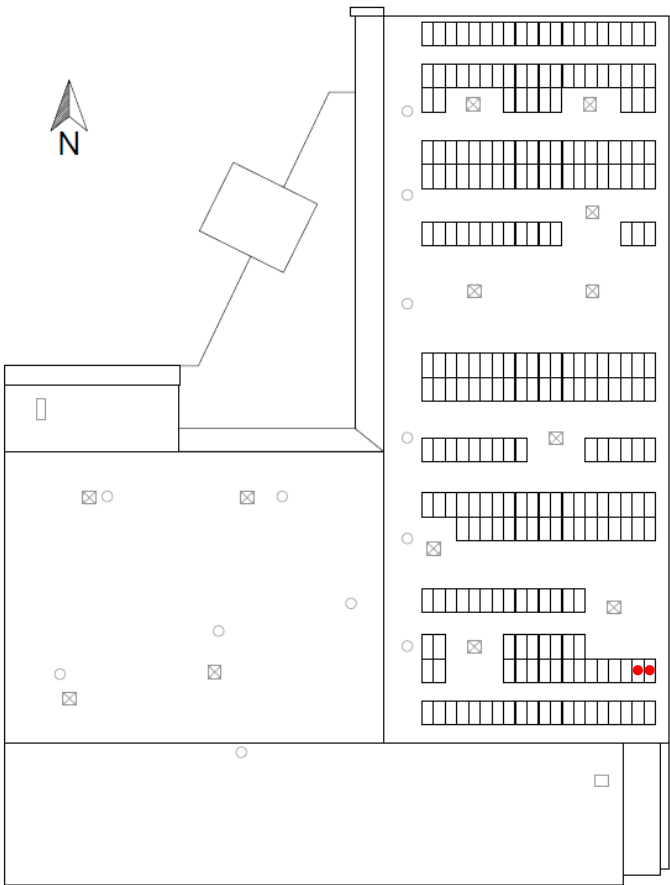

File name: 20190410_114815_667_R.JPG



Altitude: 34.6m

Date taken: Apr 10, 2019 11:48:15 AM

Heading: North (0°)

Position:  -31.8619429, 115.8067775


User tags: Thermal

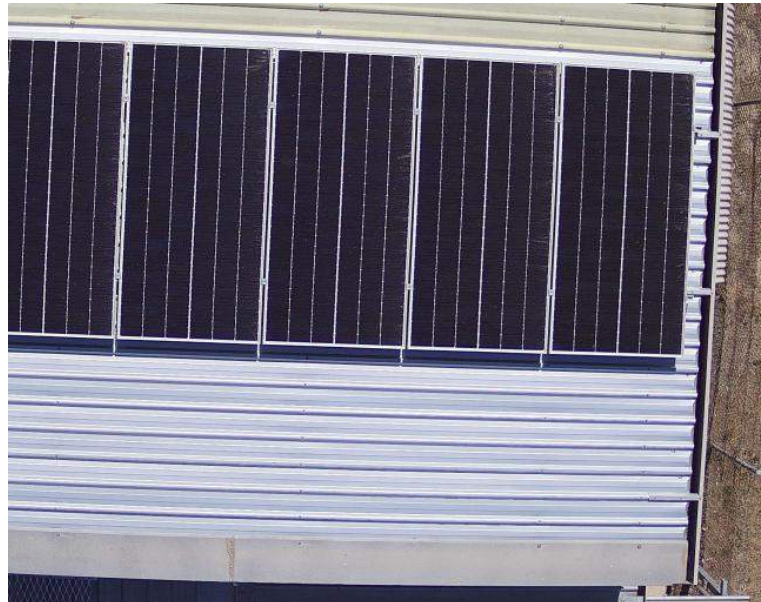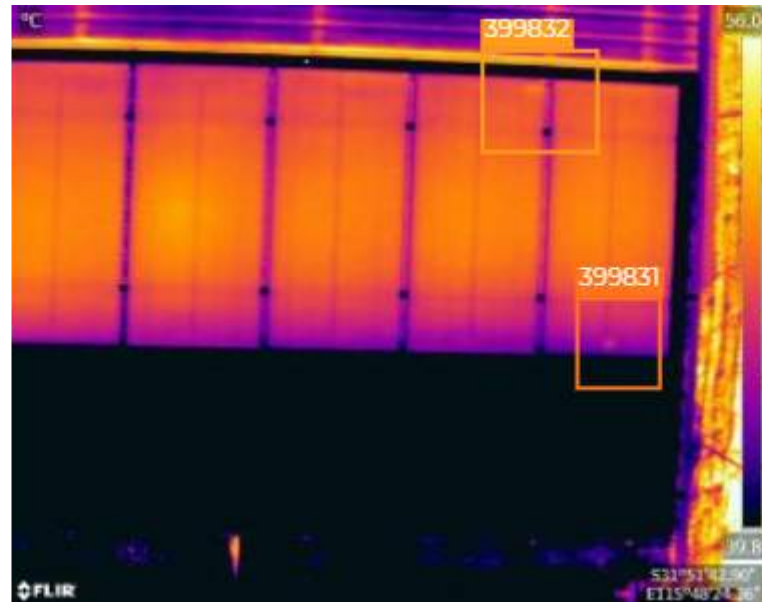


For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403820

399831 Severity: 2 Junction box

399832 Severity: 1 Soiling

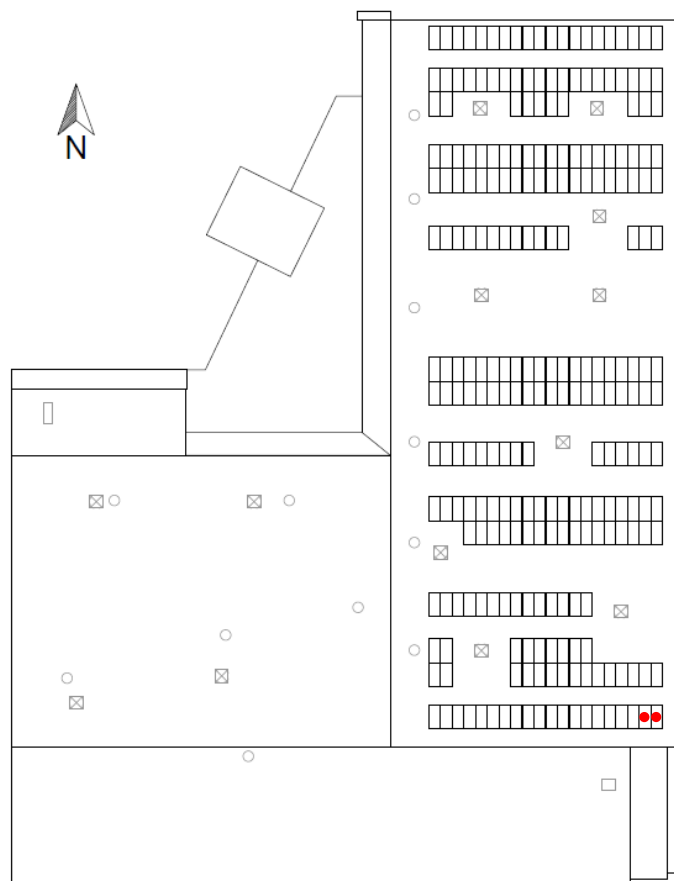

File name:	20190410_114823_878_R.JPG	Altitude:	34.3m
Date taken:	Apr 10, 2019 11:48:23 AM	Heading:	North (0°)
Position:	 -31.8619401, 115.8066630	User tags:	Thermal

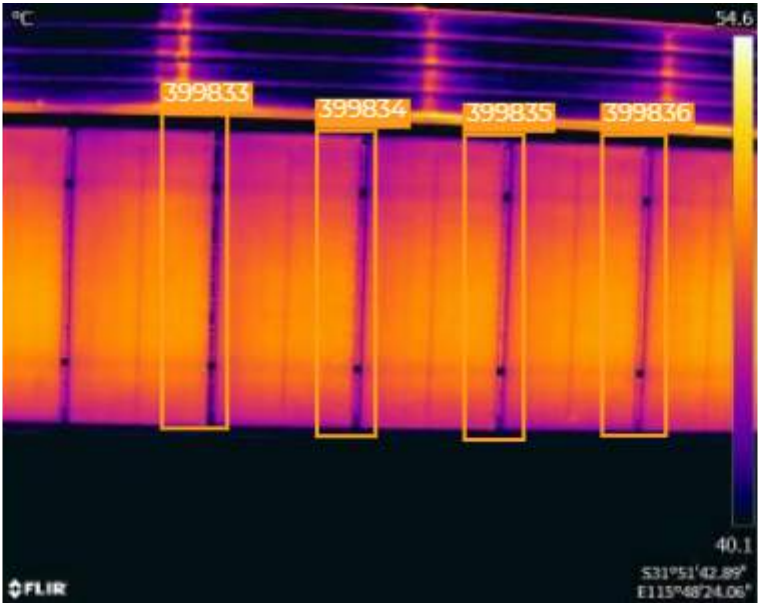

For a more detailed overview go to app.scopito.com/#/inspection/8647?image=2403824

399833	Severity: 1	Soiling
399834	Severity: 1	Soiling
399835	Severity: 1	Soiling
399836	Severity: 1	Soiling

